



38DL PLUS

Ultrasonic Thickness Gage

User's Manual

DMTA-10004-01EN — Revision B

May 2011

Olympus NDT, 48 Woerd Avenue, Waltham, MA 02453, USA

© 2010, 2011 Olympus NDT, Inc. All rights reserved. No part of this publication may be reproduced, translated, or distributed without the express written permission of Olympus NDT, Inc.

This document was prepared with particular attention to usage to ensure the accuracy of the information contained therein. It corresponds to the version of the product manufactured prior to the date appearing on the title page. There could, however, be some differences between the manual and the product if the product was modified thereafter.

The information contained in this document is subject to change without notice.

Part number: DMTA-10004-01EN

Revision B

May 2011

Printed in the United States of America.

All brands are trademarks or registered trademarks of their respective owners and third party entities.

Table of Contents

List of Abbreviations	ix
Labels and Symbols	1
Important Information — Please Read Before Use	5
Intended Use	5
Instruction Manual	5
Repair and Modification	6
Safety Symbols	6
Safety Signal Words	7
Notes Signal Words	7
Warnings	8
WEEE Directive	9
China RoHS	9
EMC Directive Compliance	10
Warranty Information	10
Technical Support	11
1. Instrument Description	13
1.1 Product Description	13
1.2 Environmental Ratings	16
1.3 Instrument Hardware Components	16
1.4 Connectors	17
1.5 Keypad Functions	19
2. Powering the 38DL PLUS	25
2.1 About the Power Indicator	25
2.2 Using the AC Power	26
2.3 Using Battery Power	27

2.3.1	Battery Operating Time	28
2.3.2	Charging the Battery	28
2.3.3	Replacing the Battery	30
3.	Software User Interface Elements	33
3.1	About the Measurement Screen	33
3.2	About Menus and Submenus	35
3.3	About Parameter Screens	36
3.4	Selecting the Text Edit Mode	38
3.4.1	Editing Text Parameters Using the Virtual Keyboard	38
3.4.2	Editing Text Parameters Using the Traditional Method	40
4.	Initial Setup	43
4.1	Setting the User Interface Language and Other System Options	43
4.2	Selecting the Measurement Units	44
4.3	Setting the Clock	44
4.4	Changing Display Settings	45
4.4.1	About the Color Schemes	46
4.4.2	About Display Brightness	47
4.4.3	About Waveform Rectification	48
4.4.4	About the Waveform Trace	49
4.5	About the Range of the Waveform Display	50
4.5.1	Selecting the Range Value	51
4.5.2	Adjusting the Delay Value	51
4.5.3	Activating the Zoom Function	52
4.6	Adjusting the Measurement Update Rate	54
4.7	Changing the Thickness Resolution	54
5.	Basic Operation	57
5.1	Setting Up the Transducer	57
5.2	About the Calibration	60
5.2.1	Calibrating the Instrument	61
5.2.2	About Test Blocks	64
5.2.3	About the Transducer Zero Compensation	64
5.2.4	About the Material Sound Velocity and the Zero Calibrations	65
5.2.5	Entering a Known Material Sound Velocity	66
5.2.6	About Locked Calibrations	67
5.2.7	Factors Affecting the Performance and the Accuracy	67
5.3	Measuring Thicknesses	69
5.4	Saving Data	70
5.5	Measurements with THRU-COAT D7906 and D7908 Transducers	72

5.5.1	Enabling the THRU-COAT Function	72
5.5.2	Performing a THRU-COAT Calibration	73
5.6	About Echo Detection Modes with Dual Element Transducers	74
5.6.1	Blanking Adjustments in Manual Echo-to-Echo Detection Mode	77
5.6.2	Dual Element Transducer Selection in Echo-to-Echo Modes	78
5.6.3	Echo-to-Echo Mode Datalogger Flags	80
5.7	Using the VGA Output	80
6.	Using EMAT Transducers	83
6.1	Connecting the E110-SB EMAT Transducer	84
6.2	Calibrating with the E110-SB EMAT Transducer	85
7.	Software Options	87
7.1	Activating Software Options	88
7.2	High Resolution Software Option	89
7.3	Oxide Layer Software Option	89
7.3.1	About Steam Boiler Tube Scale	90
7.3.2	Setting Up for Oxide Layer Measurement	91
7.3.3	Calibrating for Oxide Layer Measurement	92
7.3.4	Measuring Boiler Tube and Oxide Layer Thicknesses	93
7.4	Multi-Measurement Software Option	95
7.4.1	About the Active Measurement	96
7.4.2	Using the Multi-Measurement Normal Mode	97
7.4.3	Using the Multi-Measurement with the Soft Contact Mode	99
7.4.4	Using the Multi-Measurement % Total Thickness Mode	100
7.5	Encoded B-Scan Option	101
7.6	High Penetration Software Option	107
8.	Using Special Functions	109
8.1	Activating and Configuring a Differential Mode	109
8.2	Using the Minimum, Maximum, or Min/Max Thickness Mode	112
8.3	Preventing False Minimum/Maximum Thickness Readings	113
8.4	Using Alarms	114
8.5	Locking the Instrument	119
8.6	Freezing Waveforms	121
9.	Configuring the Instrument	123
9.1	Configuring Measurement Parameters	123
9.2	Configuring System Parameters	126
9.3	Configuring Communications	127

10. Using Advanced Gaging Features	133
10.1 Adjusting the Gain with Dual Element and E110 EMAT Transducers	133
10.2 Adjusting the Extended Blank with Dual Element Transducers	135
10.3 About the B-Scan	137
10.3.1 Using the B-Scan	142
10.3.2 Using the B-Scan Alarm Mode	142
10.3.3 Saving B-Scans, A-Scans, or Thickness Readings	143
10.4 About the DB Grid	145
10.4.1 Activating and Configuring the DB Grid	145
10.4.2 Changing the Highlighted Cell in the DB Grid	148
10.4.3 Saving Thickness Readings in the DB Grid	149
10.4.4 Viewing an Inserted or an Appended Cell in the DB Grid	150
10.5 Configuring AVG/MIN Measurements	151
10.6 Making AVG/MIN Measurements	152
10.7 Using Temperature Compensation	154
11. Using the Datalogger	157
11.1 About the Datalogger	157
11.2 Creating a Data File	161
11.2.1 About Data File Types	162
11.2.1.1 About the Incremental Data File Type	163
11.2.1.2 About the Sequential Data File Type	165
11.2.1.3 About the Sequential with Custom Points Data File Type	166
11.2.1.4 About the 2-D Grid Data File Type	168
11.2.1.5 About the 2-D Grid with Custom Points Data File Type	172
11.2.1.6 About the 3-D Grid Data File Type	174
11.2.1.7 About the Boiler Data File Type	176
11.2.1.8 About the 3-D Custom File Type	178
11.2.2 About File Data Modes	180
11.3 Performing File Operations	181
11.3.1 Opening a File	182
11.3.2 Copying a File	182
11.3.3 Editing a File	183
11.3.4 Deleting a File or its Contents	186
11.3.5 Deleting a Range of IDs	187
11.3.6 Deleting All Data Files	188
11.4 About Notes	189
11.4.1 Creating or Editing Notes	190
11.4.2 Associating a Note to an ID or to a Range of IDs	191
11.4.3 Deleting a Note from a File	192
11.4.4 Copying a Note Table	192

11.5	Setting the ID Overwrite Protection	194
11.6	About the ID Review Screen	194
11.6.1	Reviewing Stored Data and Changing the Active ID	196
11.6.2	Editing the ID	196
11.6.3	Erasing Data in the Active File	198
11.7	Using the Optional Bar Code Wand to Enter an ID Number	199
11.8	Generating Reports	200
12.	About Dual Element Transducer Setups	209
12.1	About Standard D79X and Other Dual Element Transducers	209
12.2	Creating a Setup for Nonstandard Dual Element Transducers	210
12.3	Recalling Stored Dual Element Transducer Setups	213
12.4	About the V-Path	213
12.4.1	Activating the V-Path Function	214
12.4.2	Building a V-Path Correction Curve for a Nonstandard Dual Element Transducer	214
13.	About Custom Setups for Single Element Transducers	219
13.1	Creating a Custom Setup for a Single Element Transducer	220
13.2	Quickly Adjusting Waveform Parameters For Single Element Transducers .	222
13.3	About the Detection Modes	224
13.4	About the First Peak	226
13.5	About the Pulser Power	227
13.6	About the Time-Dependent Gain Curve	227
13.6.1	About the Maximum Gain	228
13.6.2	About the Initial Gain	229
13.6.3	About the TDG Slope	229
13.7	About the Main Bang Blank	230
13.8	About the Echo Window	231
13.8.1	About the Detection of Echo 1 and Echo 2	233
13.8.2	About the Interface Blank	234
13.8.3	About the Mode 3 Echo Blank	236
13.9	Saving Setup Parameters	237
13.10	Quickly Recalling a Custom Setup for Single Element Transducers	238
14.	Managing Communications and Data Transfer	241
14.1	About GageView	241
14.2	Setting Up USB Communication	242
14.3	Setting Up RS-232 Serial Communication	243
14.4	Exchanging Data with a Remote Device	246
14.4.1	Sending Entire Files (RS-232)	246

14.4.2	Sending an ID Range from a File (RS-232)	247
14.4.3	Sending the Currently Displayed Measurement (RS-232)	248
14.4.4	Exporting a File to the External Memory Card	249
14.4.5	Importing Survey Files from the External Memory Card	250
14.4.6	Receiving Files from a Computer	252
14.5	Capturing 38DL PLUS Screen Images	253
14.5.1	Sending a Screen Capture to GageView	253
14.5.2	Sending a Screen Capture to the External microSD Card	255
14.6	RS-232 Serial Data Output Formats	256
14.7	Resetting the Communication Parameters	258
15	Maintaining and Troubleshooting the 38DL PLUS	261
15.1	Providing Routine Gage Maintenance	261
15.2	Cleaning the Instrument	262
15.3	Maintaining Transducers	262
15.4	Using Instrument Resets	263
15.5	Performing Hardware Diagnostic Tests	265
15.6	Performing the Software Diagnostic Test	267
15.7	Viewing the Instrument Status	268
15.8	Understanding Error Messages	269
15.9	Resolving Battery Pack and Charger Problems	269
15.10	Resolving Measurement Problems	270
	Appendix A: Technical Specifications	273
	Appendix B: Sound Velocities	281
	Appendix C: Accessories and Replacement Parts	283
	List of Figures	287
	List of Tables	293
	Index	295

List of Abbreviations

2-D	two-dimensions	MAX	maximum
3-D	three-dimensional	MB	main bang
AC	alternative current	MEtoE	manual echo-to-echo
AEtoE	automatic echo-to-echo	MII	Ministry of Information Industry (People's Republic of China)
AGC	automatic gain control	MIL	military
ASCII	American standard code for information interchange	MIN	minimum
AVG	average	MM	multi measurement
CSV	comma separated variables	MTI	measured time interval
DB	database	MULTI	multiple
DC	direct current	NiMH	nickel metal hydride
DIA	diameter	P/N	part number
DIAG	diagnostic	PDF	portable document format
DIFF	differential	PDSTL	pedestal
EFUP	environmental friendly usage period	PRF	pulse repetition frequency
EIP	electronic information products	PVC	polyvinylchloride
EMAT	electromagnetic acoustic transducer	RoHS	restriction of hazardous substances
EMC	electromagnetic compatibility	SE	single element
ESS	electronic stress screening	SEC	second
EXT	extended	SP	special
FCC	federal communications commission (USA)	STD	standard
FRP	fiber reinforced polymer	SW	software
GB	giga bytes	SWC	shear wave couplant
GRN	green	TDG	time-dependent gain
HDPE	high density polyethylene	TFT	thin film transistor (liquid crystal display technology)
HI	high	TOF	time-of-flight
HR	high resolution	USB	universal serial bus
ID	identification	VAC	voltage alternative current
LDPE	low density polyethylene	WEEE	waste electrical and electronics equipment
Li-ion	Lithium-ion	YEL	yellow
LOS	loss-of-signal		

Labels and Symbols

Safety-related labels and symbols are attached to the instrument at the locations shown in Figure i-1 on page 1 and Figure i-2 on page 2. If labels or symbols are missing or illegible, please contact Olympus.



DANGER

Do not touch the inner conductor of the T/R 1 and T/R 2 connectors to avoid risks of an electric shock. Up to 200 V can be present on the inner conductor. The warning symbol between the Transmit/Receive (T/R) connector markings is shown in Figure i-1 on page 1.

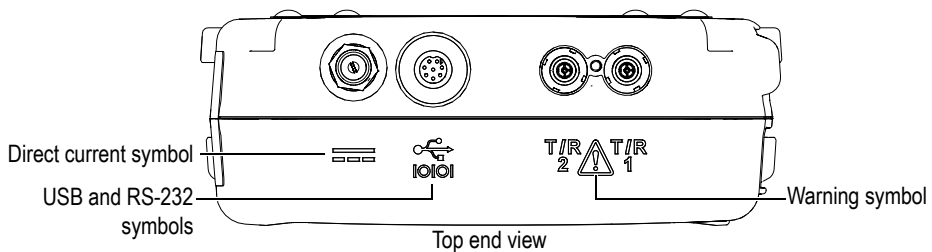


Figure i-1 The warning symbol between the T/R connectors

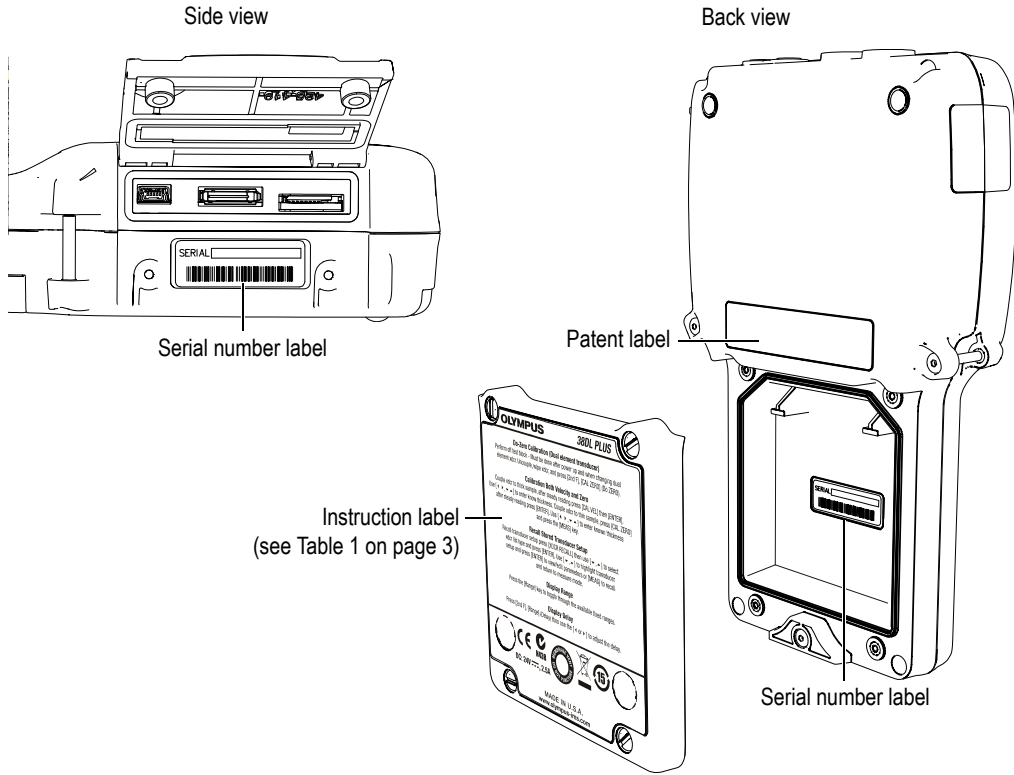


Figure i-2 Labels and symbols are attached to the instrument

Table 1 Label contents











Serial number label	<div data-bbox="642 204 1036 345" style="border: 1px solid black; padding: 5px; margin: 10px auto; width: fit-content;"> <p>SERIAL yyynnnnmm</p>  </div> <p>Where:</p> <p>yy: last two digits of the production year</p> <p>nnnnn: 5-digit nonduplicated incrementing number representing the nth production unit of this product</p> <p>mm: production month</p>
Instruction label:	<div style="border: 1px solid black; padding: 10px; text-align: center;"> <p>OLYMPUS 38DL PLUS</p> <hr/> <p>Do-Zero Calibration (Dual element transducer) Perform off test block - Must be done after power up and when changing dual element xdcr. Uncouple, wipe xdcr, and press [2nd F], [CAL ZERO] (Do ZERO).</p> <p>Calibration Both Velocity and Zero Couple xdcr to thick sample, after steady reading press [CAL VEL] then [ENTER]. Use [◀ ▶, ▼ ▲] to enter known thickness. Couple xdcr to thin sample, press [CAL ZERO] after steady reading press [ENTER]. Use [◀ ▶, ▼ ▲] to enter known thickness and press the [MEAS] key.</p> <p>Recall Stored Transducer Setup Recall transducer setup press [XDCR RECALL] then use [▼, ▲] to select xdcr list type and press [ENTER]. Use [▼, ▲] to highlight transducer setup and press [ENTER] to view/edit parameters or [MEAS] to recall and return to measure mode.</p> <p>Display Range Press the [Range] key to toggle through the available fixed ranges.</p> <p>Display Delay Press [2nd F], [Range] (Delay) then use the [◀ or ▶] to adjust the delay.</p> <hr/> <div style="display: flex; justify-content: space-around; align-items: center;"> <div style="border: 1px dashed black; border-radius: 50%; width: 40px; height: 40px; margin: 0 10px;"></div> <div style="text-align: center;">  <p>N438</p> <p>DC: 24V , 2.5A</p> </div> <div style="border: 1px solid black; border-radius: 50%; padding: 5px; text-align: center; margin: 0 10px;"> MEMBRANE VENT DO NOT PUNCTURE </div> <div style="text-align: center;">  </div> <div style="border: 1px solid black; border-radius: 50%; padding: 5px; text-align: center; margin: 0 10px;"> 15 </div> <div style="border: 1px dashed black; border-radius: 50%; width: 40px; height: 40px; margin: 0 10px;"></div> </div> <hr/> <p style="text-align: center;">MADE IN U.S.A. www.olympus-ims.com</p> </div>

Table 1 Label contents (continued)

Symbol	Description
	The CE marking symbolizes conformity to all the essential requirements of the applicable European Union directives.
	The C-Tick label indicates that the product complies with the applicable standard and establishes a traceable link between the equipment and the manufacturer, importer, or their agent responsible for compliance and for placing it on the Australian market.
	This symbol indicates the location of the membrane vent.
	The WEEE symbol indicates that the product must not be disposed of as unsorted municipal waste, but should be collected separately.
	The China RoHS mark indicates the product's Environmental Friendly Usage Period (EFUP). The EFUP is defined as the number of years for which listed controlled substances will not leak or chemically deteriorate while in the product. The EFUP for the 38DL PLUS Series has been determined to be 15 years. Note: The Environmental Friendly Usage Period (EFUP) is not meant to be interpreted as the period assuring functionality and product performance.
	The direct current symbol

Important Information — Please Read Before Use

Intended Use

The 38DL PLUS instrument has been designed to measure thicknesses of industrial and commercial materials.



DANGER

Do not use the 38DL PLUS instrument for any purpose other than its intended use.

Instruction Manual

This instruction manual contains complete and essential information on how to safely and efficiently use this Olympus product. Before use, thoroughly review this instruction manual and use the product as instructed. Keep this instruction manual in a safe, accessible location.

The other 38DL PLUS documents are:

38DL PLUS Ultrasonic Thickness Gage — Getting Started (P/N: DMTA-10010-01EN [U8778357])

A short leaflet containing essential information on how to quickly start operating the 38DL PLUS instrument.

38DL PLUS Ultrasonic Thickness Gage — Basic Operation Manual (P/N: DMTA-10009-01EN [U8778346])

A printed document containing a detailed description of the instrument as well as basic setup and operation procedures.

GageView Interface Program — User's Manual (P/N: 910-259-EN [U8778347])

The 38DL PLUS also works with the GageView interface program. Refer to this document for detailed information on GageView. The document is available in PDF format on the GageView CD and as online help in GageView.

Repair and Modification

Apart from the battery, the 38DL PLUS instrument does not contain any user-serviceable parts.



CAUTION

To prevent human injury and/or equipment damage, do not disassemble, modify, or attempt to repair the instrument.

Safety Symbols

The following safety symbols may appear on the instrument and in the instruction manual:



General warning symbol:

This symbol is used to alert the user to potential hazards. All safety messages that follow this symbol shall be obeyed to avoid possible harm.



High voltage warning symbol:

This symbol is used to alert the user to potential electric shock hazards higher than 1,000 volts. All safety messages that follow this symbol shall be obeyed to avoid possible harm.

Safety Signal Words

The following safety symbols may appear in the documentation of the instrument:



DANGER

The DANGER signal word indicates an imminently hazardous situation. It calls attention to a procedure, practice, or the like, which, if not correctly performed or adhered to, could result in death or serious personal injury. Do not proceed beyond a DANGER signal word until the indicated conditions are fully understood and met.



WARNING

The WARNING signal word indicates a potentially hazardous situation. It calls attention to a procedure, practice, or the like, which, if not correctly performed or adhered to, could result in death or serious personal injury. Do not proceed beyond a WARNING signal word until the indicated conditions are fully understood and met.



CAUTION

The CAUTION signal word indicates a potentially hazardous situation. It calls attention to an operating procedure, practice, or the like, which, if not correctly performed or adhered to, could result in minor or moderate personal injury, material damage, particularly to the product, destruction of part or all of the product, or loss of data. Do not proceed beyond a CAUTION signal word until the indicated conditions are fully understood and met.

Notes Signal Words

The following safety symbols may appear in the documentation of the instrument:



IMPORTANT

The IMPORTANT signal word calls attention to a note that provides important information or information essential to the completion of a task.

NOTE

The NOTE signal word calls attention to an operating procedure, practice, or the like that requires special attention. A note also denotes related, parenthetical information that is useful but not imperative.

TIP

The TIP signal word calls attention to a type of note that helps you apply the techniques and procedures described in the manual to your specific needs, or that provides hints on how to use effectively the capabilities of the product.

Warnings



General Warnings

- Carefully read the instructions contained in this instruction manual prior to turning on the instrument.
- Keep this instruction manual in a safe place for further reference.
- Follow the installation and operation procedures.
- It is imperative to respect the safety warnings on the instrument and in this instruction manual.
- If the equipment is used in a manner not specified by the manufacturer, the protection provided by the equipment could be impaired.
- Do not install substitute parts or perform any unauthorized modification to the instrument.
- Service instructions, when applicable, are for trained service personnel. To avoid a dangerous electric shock, do not perform any service unless qualified to do so. For any problem or question regarding this apparatus, contact Olympus or an authorized Olympus representative.



WARNING

 


- When using the 38DL PLUS charger/adaptor, you must connect the protective earth terminal of the charger/adaptor to the protective conductor of the (mains) power cord. The mains plug shall only be inserted in a socket outlet provided

with a protective earth contact. Never negate the protective action by using an extension cord (power cable) without a protective conductor (grounding.)

- Whenever it is likely that the ground protection is impaired, you must turn off the instrument and secure it against any unintended operation.
- The instrument must be connected only to a power source corresponding to the type indicated on the rating plate.

WEEE Directive



In accordance with European Directive 2002/96/EC on Waste Electrical and Electronic Equipment (WEEE), this symbol indicates that the product must not be disposed of as unsorted municipal waste, but should be collected separately. Refer to your local Olympus distributor for return and/or collection systems available in your country.

China RoHS

China RoHS is the term used by industry generally to describe legislation implemented by the Ministry of Information Industry (MII) in the People's Republic of China for the control of pollution by electronic information products (EIP).



The China RoHS mark indicates the product's Environmental Friendly Usage Period (EFUP). The EFUP is defined as the number of years for which listed controlled substances will not leak or chemically deteriorate while in the product. The EFUP for the 38DL PLUS Series has been determined to be 15 years.

Note: The Environmental Friendly Usage Period (EFUP) is not meant to be interpreted as the period assuring functionality and product performance.

EMC Directive Compliance

This equipment generates and uses radio-frequency energy, and if not installed and used properly (that is, in strict accordance with the manufacturer's instructions), may cause interference. The 38DL PLUS has been tested and found to comply with the limits for an industrial device in accordance with the specifications of the EMC directive.

FCC (USA) Compliance

This equipment has been tested and found to comply with the limits for a Class A digital device, pursuant to Part 15 of the FCC Rules. These limits are designed to provide reasonable protection against harmful interference when the equipment is operated in a commercial environment. This equipment generates, uses, and can radiate radio frequency energy and, if not installed and used in accordance with the instruction manual, may cause harmful interference to radio communications. Operation of this equipment in a residential area is likely to cause harmful interference in which case you will be required to correct the interference at your own expense.

ICES-003 (Canada) Compliance

This Class A digital apparatus complies with Canadian ICES-003.

Cet appareil numérique de la classe A est conforme à la norme NMB-003 du Canada.

Warranty Information

Olympus guarantees your Olympus product to be free from defects in materials and workmanship for a period and conditions specified in the Olympus terms and conditions, available at <http://www.olympus-ims.com/en/terms/>.

The Olympus warranty only covers equipment that has been used in a proper manner as described in this instruction manual and has not been subjected to excessive abuse, attempted unauthorized repair, or modification.

Inspect materials thoroughly on reception for evidence of external or internal damage that might have occurred during shipment. Notify the carrier making the delivery immediately of any damage, since the carrier is normally liable for damage in

shipment. Preserve packing materials, waybills, and other shipping documentation in order to establish a damage claim. After notifying the carrier, contact Olympus for assistance with the damage claim and equipment replacement, if necessary.

This instruction manual attempts to teach the proper operation of your Olympus product. The information contained herein is intended solely as a teaching aid and shall not be used in any particular application without independent testing and/or verification by the operator or the supervisor. Such independent verification of procedures becomes more important as the criticality of the application increases. For this reason, Olympus makes no warranty, expressed or implied, that the techniques, examples, or procedures described herein are consistent with industry standards nor that they meet the requirements of any particular application.

Olympus reserves the right to modify all products without incurring the responsibility for modifying previously manufactured products.

Technical Support

Olympus is firmly committed to providing the highest level of customer service and product support. If you experience any difficulties when using this Olympus product, or if it fails to operate as described in the documentation, first consult this instruction manual, and then, if you are still in need of assistance, contact the Olympus after-sales service. To locate the nearest service center, visit the Service Centers page at: www.olympus-ims.com.

1. Instrument Description

This chapter describes the main features and the hardware components of the 38DL PLUS instrument.

1.1 Product Description

The 38DL PLUS by Olympus is a hand-held ultrasonic thickness gage designed for a wide variety of thickness measurement applications. With the 38DL PLUS, you only need access to one side of a part to measure, in a nondestructive manner, the thickness of corroded, pitted, scaled, granular, and other difficult materials (see Figure 1-1 on page 13).



Figure 1-1 Measuring thicknesses with the 38DL PLUS

The 38DL PLUS simultaneously displays a thickness readout and an A-scan view for waveform verification. The microprocessor of the 38DL PLUS continuously adjusts the receiver setup so that every measurement is optimized for reliability, range, sensitivity, and accuracy. An advanced internal datalogger can store up to 475,000 thickness measurements and 20,000 waveforms.

The 38DL PLUS operates with a full line of single element and dual element transducers to measure material thicknesses between 0.003 in. and 25 in. (0.08 mm and 635 mm). The temperature range of measured materials can be between -4°F and 932°F (-20°C and 500°C) depending on the material characteristics, the transducer, and the measurement mode. You can also use single element or dual element transducers for echo-to-echo measurements.

You can connect the 38DL PLUS to a printer and to a computer using the bidirectional serial USB/RS-232 communication ports.

Advanced Measurement Features

- THRU-COAT measurement
- Temperature-compensated measurement
- Min/Average mode
- EMAT transducer capability
- Measurement-related status flags and alarms
- Full VGA color transfective LED back-lite display
- Automatic probe recognition for the standard D79X and MTD705 series transducers
- Dynamic default gain optimization
- V-path calibration to build custom V-path correction tables for any dual element transducer
- Warning against calibration doubling
- Calibration for unknown material sound velocity and/or transducer zero
- Echo-to-echo measurements
- Fast scan mode with 30 readings per second
- Manual gain adjustment in 1-dB steps
- Hold or blank thickness display during loss-of-signal (LOS) conditions
- Hold minimum, maximum, or both minimum and maximum functions
- Differential thickness display relative to the set point in absolute or percentage ratio

- Selection of password-protected lockout functions
- Selectable resolution: low of 0.01 in. (0.1 mm), standard of 0.001 in. (0.01 mm), or high (optional) of 0.0001 in. (0.001 mm) [option not available for all transducers]

A-Scan and B-Scan Display Options

- Real-time A-scan waveform display for verification of critical measurements
- Manual freeze mode with post processing
- Manual zoom and range control of waveform display
- Auto hold on LOS and auto zoom (measured echo centering)
- Extended blank
- Blank after first received echo in echo-to-echo mode
- Receiver gain readout
- Ability to capture and display waveform associated with minimum thickness during scanned measurements
- Display stored and downloaded waveforms

Internal Datalogger Functions

- Internal data storage and possibility to export data to a removable microSD memory card
- Capacity to store 475,000 fully-documented thickness readings or 20,000 waveforms with thickness readings
- Database enhancements include 32-character file naming and 20-character ID naming
- Automatic ID number increments following a preset sequence, or manual ID numbering using the keypad
- Save reading/waveform to an ID number
- Simultaneously show ID number, stored comments, and stored reference thickness while displaying active thickness and waveform
- Nine file formats available
- Erase selected data or all stored data
- Save or send an held or frozen reading to the thickness display
- Transmit selected data or all stored data
- Keypad-programmable communication parameters
- Standard USB and RS-232 directional communication

1.2 Environmental Ratings

The 38DL PLUS is a rugged and durable instrument that you may use in harsh environments. The 38DL PLUS was designed to meet the requirement of the IP67 standard (Ingress Protection).



CAUTION

Olympus cannot guarantee any level of ingress protection performance once the instrument seals have been manipulated. You must use sound judgment and take proper precautions before exposing the instrument to harsh environments.

To maintain the original level of ingress protection, you are responsible for the proper care of all routinely exposed membrane seals. Additionally, you are responsible for returning the instrument to an authorized Olympus service center each year to ensure that the instrument seals are properly maintained.

1.3 Instrument Hardware Components

The 38DL PLUS front panel features a color display and a keypad. The instrument comes with a hand strap. A protective rubber boot includes a dust flap seal for the DC power and serial communication connectors, strap rings at the four corners, and a stand at the back (see Figure 1-2 on page 17).

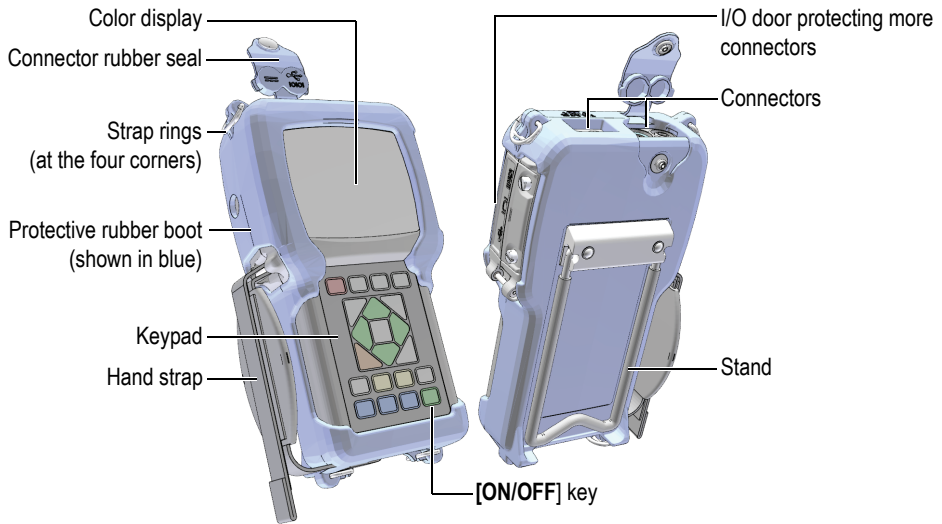


Figure 1-2 The 38DL PLUS hardware components

1.4 Connectors

Figure 1-3 on page 17 illustrates the possible connections of the 38DL PLUS with external devices.

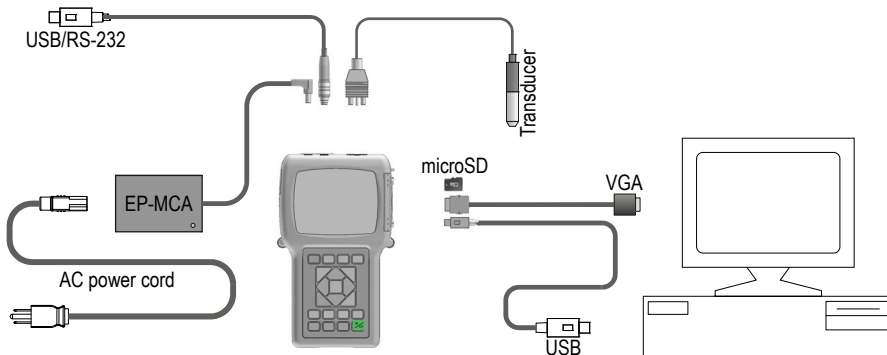


Figure 1-3 The 38DL PLUS connections



CAUTION

Use only the AC power cord supplied with the 38DL PLUS. Do not use this AC power cord with other products.

The DC power, USB/RS-232 communication, and Transmit/Receive probe connectors are located on the top end of the 38DL PLUS (see Figure 1-4 on page 18).

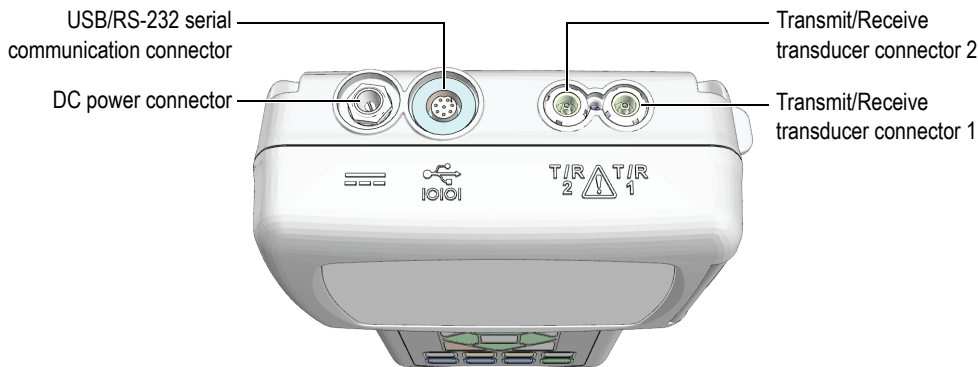


Figure 1-4 The top end connectors

The USB client connector, the VGA output connector, and the external microSD memory card slot are located on the right side of the instrument, hidden behind the I/O door (see Figure 1-5 on page 19).

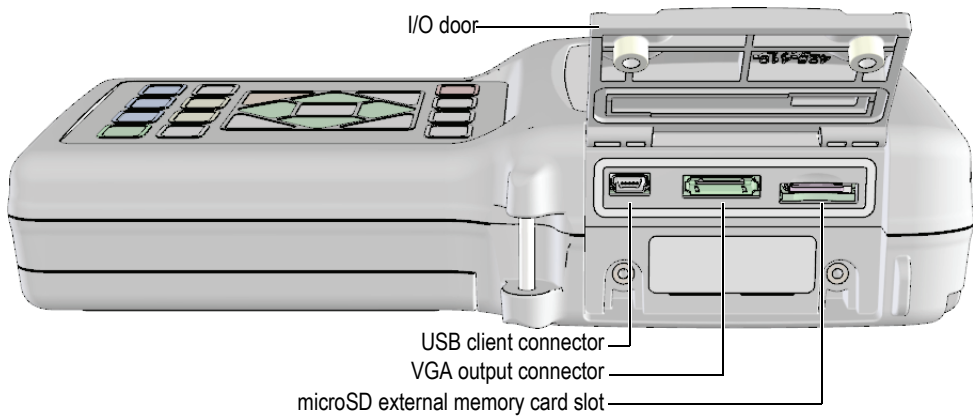


Figure 1-5 The connectors behind the I/O door

1.5 Keypad Functions

The 38DL PLUS comes either with the English or the international keypad (see Figure 1-6 on page 20). The functions are the same for both keypads. On the international keypad, the text labels on many keys are replaced by pictograms. In this document, keypad keys are referred to using the English label in bold and within brackets (ex.: **[MEAS]**).

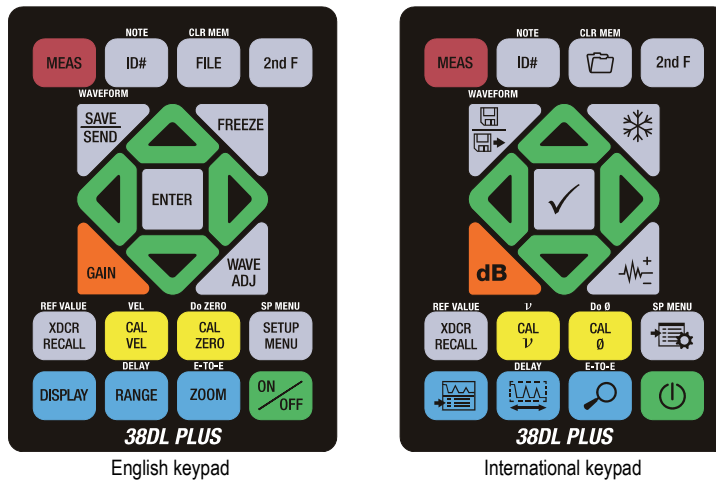


Figure 1-6 The 38DL PLUS keypads

Each key indicates its primary function. The area just above some of the keys indicates a secondary key function that you can activate by first pressing **[2nd F]**. Throughout this document, references to a secondary function are written as follows: **[2nd F], [Primary] (Secondary)**. For example, the instruction to activate the clear memory function is written as follows: “Press **[2nd F], [FILE] (CLR MEM)**”.

The **[▲]**, **[▼]**, **[◀]**, and **[▶]** keys, together with the **[ENTER]** key, are used to select menu items or screen parameters and to change parameter values. Use the **[MEAS]** key at any time to return to the measurement screen. The yellow keys are related to calibration. The blue keys are related to the display configuration.

Table 2 on page 20 lists the key functions available from the 38DL PLUS keypad.

Table 2 Keypad functions



English	International	Functions
		Measurement — Completes the current operation and returns to the measurement screen.
		Identification number — Accesses several functions related to the ID numbers for the thickness measurement location.

Table 2 Keypad functions (continued)










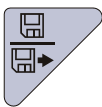











English	International	Functions
 		Note — Allows you to create or select comments to store at an ID number location.
		File — Opens the file menu to access file commands (open, review, create, copy, edit, delete, send, import, export, note-copy, memory, and report).
 		Clear memory — Acts as an alternative method to erase an entire file. Also erases a range of data in a file or a single ID number location.
		Secondary function — Needs to be pressed prior to a key to activate the secondary function of the key.
		Save or send — Stores a measurement and optionally the corresponding waveform in the datalogger at the current ID number.
 		Save waveform — Stores a measurement and the corresponding waveform in the datalogger at the current ID number.
		Freeze — Causes the displayed waveform to immediately hold until the key is pressed again.
		Gain — Initiates the adjustment of the gain value when using dual element transducers.
		Wave adjustment — Toggles the display of a selectable waveform parameter with an editable value.
		Enter — Selects an highlighted item or accepts an entered value.

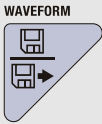Table 2 Keypad functions (continued)









English	International	Functions
		Up arrow <ul style="list-style-type: none"> In a screen or a list, moves to the previous element. For some parameters (ex.: Gain), increases the value.
		Down arrow <ul style="list-style-type: none"> In a screen or a list, moves to the next element. For some parameters (ex.: Gain), decreases the value.
		Left arrow <ul style="list-style-type: none"> Selects the previous available value for the selected parameter. In text edit mode, moves the cursor one character position to the left.
		Right arrow <ul style="list-style-type: none"> Selects the next available value for the selected parameter. In text edit mode, moves the cursor one character position to the right.
		Transducer recall — Recalls default or custom transducer (XDCR) setups.
		Reference value — For some functions (ex.: differential mode or temperature compensation) opens a screen allowing you to enter a reference value.
		Velocity calibration <ul style="list-style-type: none"> Switches to the semi-automatic step block calibration mode. When using THRU-COAT mode, press [CAL VEL] twice to view and set the coating velocity. With the traditional text edit mode only, deletes the character at the cursor position.

Table 2 Keypad functions (continued)



 




 


 
















English	International	Functions
 		Velocity <ul style="list-style-type: none"> • Opens a screen allowing you to view and manually change the sound velocity. • In THRU-COAT mode or with the internal oxide option, pressing the keys a second time allows you to view/adjust the velocity for the coating or the oxide layer.
		Zero calibration <ul style="list-style-type: none"> • Compensates for transducer zero or enables the step block zero calibration. • With the traditional text edit mode only, inserts a character at the cursor position.
 		Do zero — Compensates for transducer delay for dual element transducers and for the M2008 transducer.
		Setup menu — Provides access to instrument parameters (measurement, system, alarm, differential mode, communication, B-scan, DB grid, avg/min, temperature correction, multilayer [optional], oxide [optional], password set, instrument lock).
 		Special menu — Provides access to special gage parameters (clock, language, options, resets, tests, software diagnostics, instrument status).
		Display — Provides access to display parameters (color scheme, brightness, waveform rectification, waveform trace, and VGA output).
		Range — Changes the waveform display range to the next available value.
 		Delay — Allows editing the value for the beginning of the waveform display.

Table 2 Keypad functions (continued)

English	International	Functions
		Zoom — Dynamically changes the waveform display range so that the region immediately surrounding the measured echo is shown at maximum magnification.
 		Echo-to-Echo — With dual element transducers, opens a menu to select the measurement mode (standard, auto echo-to-echo, or manual echo-to-echo).
		On/Off — Turns the instrument power on or off.

2. Powering the 38DL PLUS

This chapter describes how to operate the 38DL PLUS using different power supply options.

2.1 About the Power Indicator

The power indicator is always present on the right side of the screen. It shows the level of the battery charge and on which type of power the instrument operates (see Figure 2-1 on page 25).

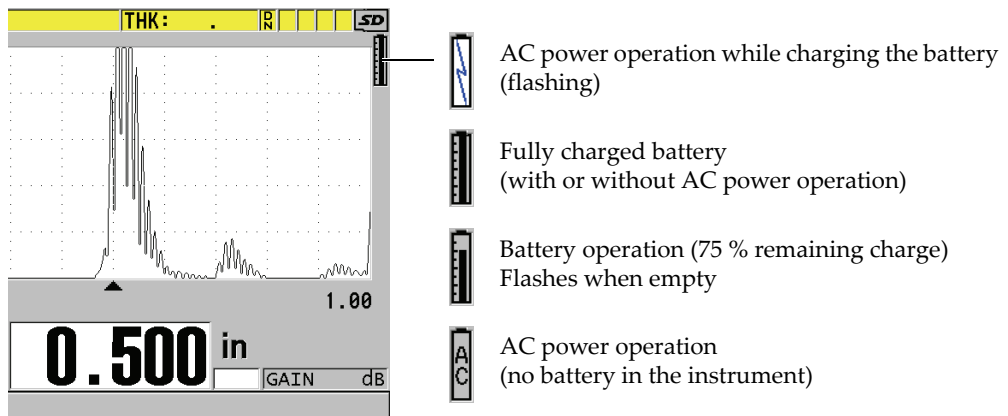


Figure 2-1 The power indicator for battery and AC operation

When the instrument operates on the battery, the vertical black bar in the power indicator indicates the remaining battery charge. Each graduation mark represents 12.5 % of the charge.

2.2 Using the AC Power

You can operate the 38DL PLUS with the AC power using the charger/adaptor (P/N: EP-MCA [U8767042]). The EP-MCA has a universal AC power input that operates with any line voltage from 100 VAC to 120 VAC or 200 VAC to 240 VAC and with 50 Hz to 60 Hz line frequency.

To use AC power

1. Connect the AC power cord to the charger/adaptor (P/N: EP-MCA [U8767042]), and to an appropriate power outlet (see Figure 2-2 on page 26).



CAUTION

Use only the AC power cord supplied with the 38DL PLUS. Do not use this AC power cord with other products.

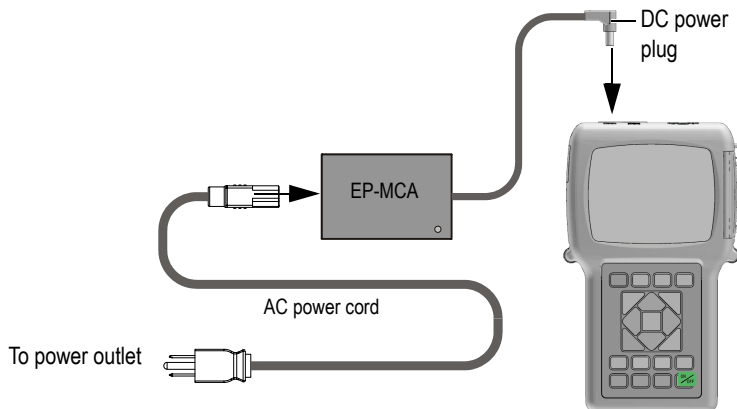


Figure 2-2 Connecting the charger/adaptor

2. On the 38DL PLUS, lift the rubber seal covering the DC adaptor connector on top of the 38DL PLUS (see Figure 2-3 on page 27).

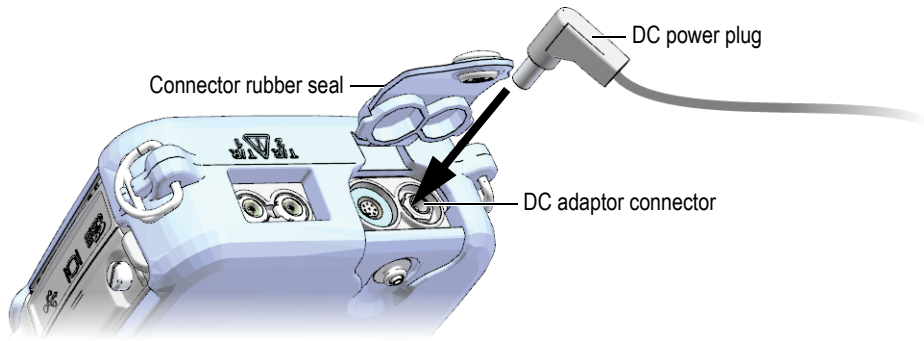


Figure 2-3 Connecting the DC power plug

3. Connect the DC power plug from the charger/adaptor to the DC adaptor connector (see Figure 2-3 on page 27).
4. Press [ON/OFF] to turn on the 38DL PLUS.

2.3 Using Battery Power

The 38DL PLUS comes with a rechargeable Lithium-ion (Li-ion) battery (P/N: 38-BAT [U8760054]). The 38DL PLUS automatically recharges the 38-BAT battery when you connect the instrument to the AC power.

You can also operate the 38DL PLUS using four AA-size Alkaline or nickel metal hydride (NiMH) rechargeable batteries using the AA battery holder (P/N: 38DLP/AA [U8780290]). The 38DL PLUS does not recharge NiMH batteries. You must recharge AA batteries with an external battery charger (not included).

NOTE

The 38DL PLUS battery is not fully charged when shipped. You must fully charge the battery before operating the instrument from the battery power.

2.3.1 Battery Operating Time

The battery operating time depends on the type of battery being used, the age of the battery, and the instrument settings. To provide realistic battery operating times, the 38DL PLUS has been tested with mid-level operating parameters (update rate set to 4 Hz and display brightness set to 50 %).

The nominal battery operating times for new batteries are:

- Rechargeable Li-ion: 12 to 14 hours
- AA NiMH: 4 to 5 hours (externally recharged)
- AA Alkaline: 2 to 3 hours (nonrechargeable)

2.3.2 Charging the Battery



WARNING

The 38DL PLUS charger/adaptor (P/N: EP-MCA [U8767042]) is designed to charge 38DL PLUS batteries only (P/N: 38-BAT [U8760054]). Do not attempt to charge any other battery types or use any other chargers/adaptors. Doing so may cause an explosion and injury.



WARNING

Do not attempt to power or charge other electronic equipment with the 38DL PLUS charger/adaptor (P/N: EP-MCA [U8767042]) as this may cause death or serious personal injury as the result of the explosion while charging a battery.

To charge the internal battery

- ◆ Connect the 38DL PLUS using the AC power (see section 2.2 on page 26). The battery charges when the instrument is ON or OFF, but the rate of charge is slower when the instrument is ON.

NOTE

When the battery is fully charged, the battery charging symbol (lightning bolt) is replaced with a “full battery” symbol (battery with all bars full). This is the indication that the battery is fully charged (see section 2.1 on page 25). It takes approximately 2 to 3 hours to fully charge a battery depending on its initial conditions.

NOTE

It may take several cycles of complete charging and discharging of the battery to bring the battery to full capacity. This conditioning process is normal for this type of rechargeable batteries.

Battery Usage Instructions

- If the battery is used daily (or frequently), connect the instrument to the charger/adaptor when not in use.
- Whenever possible, the instrument should remain connected to the EP-MCA charger/adaptor (overnight or over a weekend), so that the battery reaches a full charge.
- The battery must reach full charge on a regular basis for proper capacity and cycle-life maintenance.
- Fully recharge discharged batteries as soon as possible after use.

Battery Storage Instructions

- Never store discharged batteries without a full recharge.
- Store batteries in a cool, dry environment.
- Avoid long-term storage under sunlight or in other excessively hot places such as the trunk of an automobile.
- While in storage, fully recharge batteries at least once every two (2) months.

2.3.3 Replacing the Battery

The battery is located in a compartment that is accessible from the back of the 38DL PLUS (see Figure 2-4 on page 30).

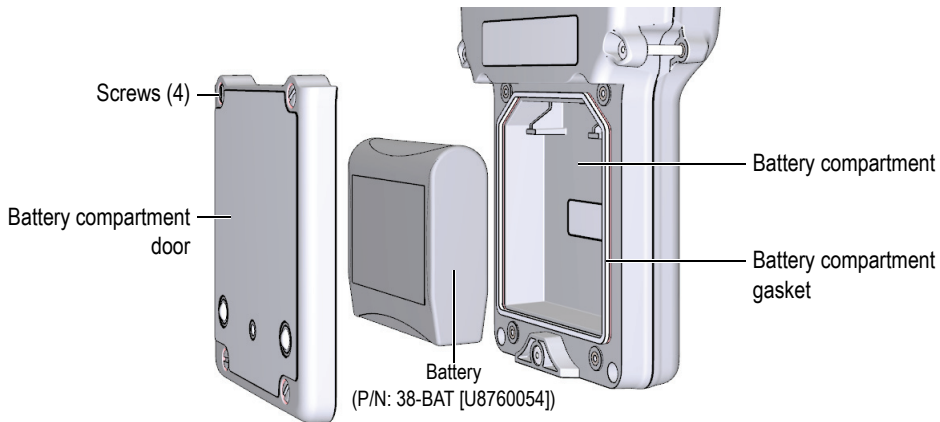


Figure 2-4 Opening the battery compartment



CAUTION

Do not attempt to replace the battery while the instrument is ON and/or connected to charger/adaptor. Dispose of used battery promptly. Keep away from children. The battery used in this device may present a risk of fire or chemical burn if mishandled. Do not disassemble, heat above 50 °C, or incinerate the battery. Replace the battery only with an Olympus battery (P/N: 38-BAT [U8760054]).

To replace the battery

1. Disconnect the instrument from the charger/adaptor.
2. Ensure that the 38DL PLUS power is off.
3. Disconnect any other cable connected to the 38DL PLUS.
4. Remove the hand strap.
5. Remove the protective rubber boot.

6. At the back of the instrument, unscrew the four screws of the battery compartment cover (see Figure 2-4 on page 30).
7. Remove the battery compartment cover.
8. Remove the battery and carefully disconnect the battery connector.
9. Connect the new battery in the battery compartment.
10. Ensure that the gasket of the battery compartment cover is clean and in good condition.
11. Reinstall the battery compartment cover at the back of the instrument, and then tighten the four screws.
12. Reinstall the protective rubber boot and the hand strap.
13. Press [ON/OFF] to turn on the 38DL PLUS.
14. To answer the question appearing at the bottom of the screen (see Figure 2-5 on page 31):
 - ◆ Select **Li-ion** when using a 38-BAT battery.
 - OR
 - ◆ Select **NiMH** or **Alkaline** when using four NiMH AA batteries or four Alkaline AA batteries with the AA battery holder.



Figure 2-5 Selecting the new battery type

NOTE

When replacing the rechargeable 38-BAT battery, fully charge the battery to ensure the accuracy of the estimated remaining battery charge shown by the power indicator (see section 2.1 on page 25).

3. Software User Interface Elements

The following sections describe the main elements of the 38DL PLUS software screens and menus.

3.1 About the Measurement Screen

The 38DL PLUS starts with the measurement screen where you can see the ultrasonic echo on the waveform display and read the measured thickness value (see Figure 3-1 on page 33). The measurement screen is the main screen of the 38DL PLUS software. From anywhere in the 38DL PLUS software, simply press [MEAS] to return to the measurement screen. The power indicator is always present on the right side of the 38DL PLUS screen (see section 2.3 on page 27 for details).

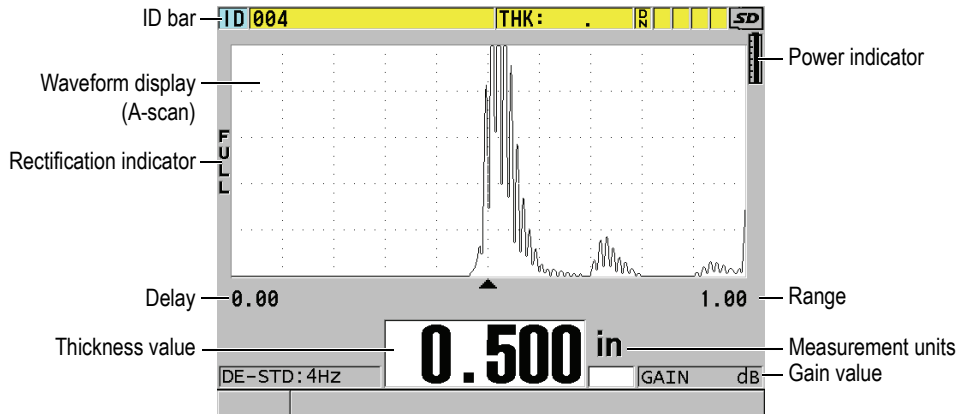


Figure 3-1 The main elements of the measurement screen

The waveform trace, called the A-scan, allows a skilled operator to verify that the signal used to make a thickness measurement is the correct back-wall echo and not noise, material anomaly, or the second multiple echo. The A-scan can also allow you to observe indications that may be too small to be measured by the instrument.

The ID bar, located at the top of the measurement screen, contains the ID for the actual thickness measurement location, the previously stored value, and comment notes indicators (see Figure 3-2 on page 34). The download indicator (R) appears when the previously stored thickness measurement comes from a file rather than from a newly acquired value.

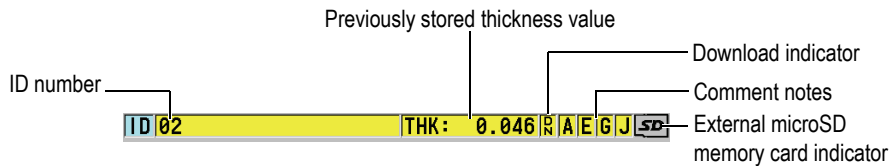


Figure 3-2 The ID bar

The external microSD memory card indicator appears in the top-right corner of the screen when a microSD memory card is inserted in its slot under the I/O door on the right side of the instrument (see Figure 1-5 on page 19). The 38DL PLUS recognizes an external microSD memory card when you start the instrument.

Depending on the context and on the available functions and options, various indicators and numeric values appear around the waveform display and around the main measurement value (see Figure 3-3 on page 35). A help text bar, at the bottom of the screen, indicates the keys that you can use to navigate and make a selection in the menu structure.

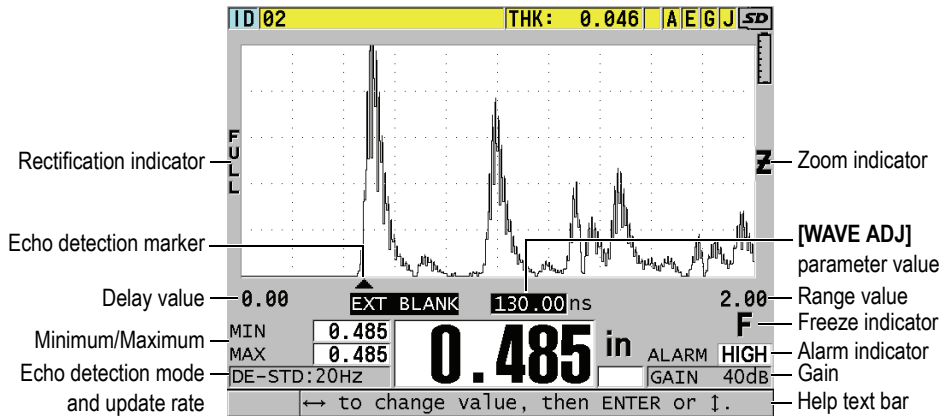


Figure 3-3 Example of other elements appearing on the measurement screen

The loss-of-signal (LOS) appears and the thickness value is cleared when the 38DL PLUS no longer detects ultrasonic echoes (see Figure 3-4 on page 35).

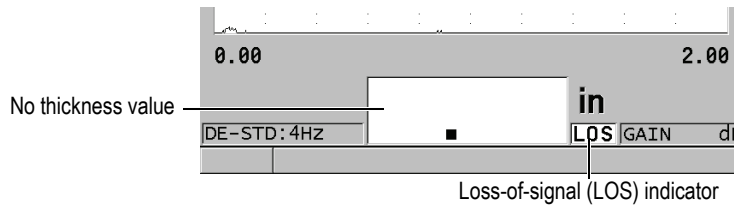


Figure 3-4 The loss-of-signal (LOS) indicator

3.2 About Menus and Submenus

The 38DL PLUS displays menus and submenus when you press some of the front panel keys. The menu appears at the top-left corner of the screen (see Figure 3-5 on page 36). If applicable, a submenu also appears, conveniently showing the parameters available for the highlighted menu command.

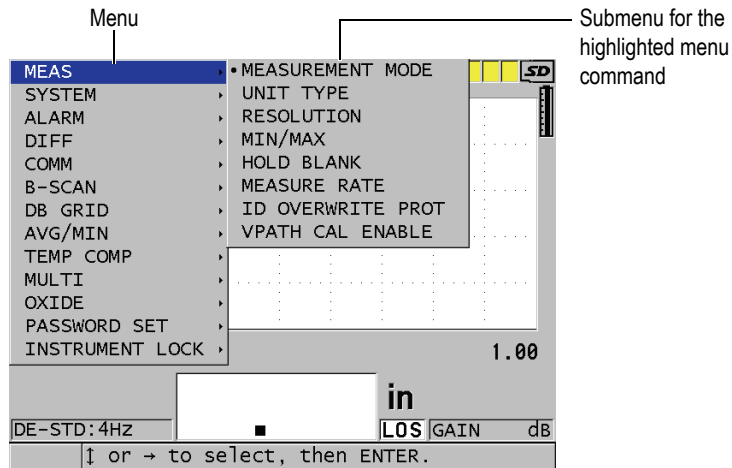


Figure 3-5 Menu and submenu example

To select a menu or a submenu command

1. Press one of the front panel keys to display a menu.
2. Use the [▲] and [▼] keys to highlight the desired menu command.
3. If applicable and needed, use the [▶] key to move the highlight to the submenu, and then use the [▲] and [▼] keys to highlight the desired submenu command.
4. Press [ENTER] to select the highlighted menu, or submenu command.

NOTE

In the remainder of this document, the above procedure is summarized by simply stating to select a specific menu or submenu command. For example: “In the menu, select **MEAS**.”

3.3 About Parameter Screens

The 38DL PLUS parameters are logically grouped in parameter screens that you access using front panel keys or menu commands. Figure 3-6 on page 37 shows the **MEAS** parameter screen as an example.

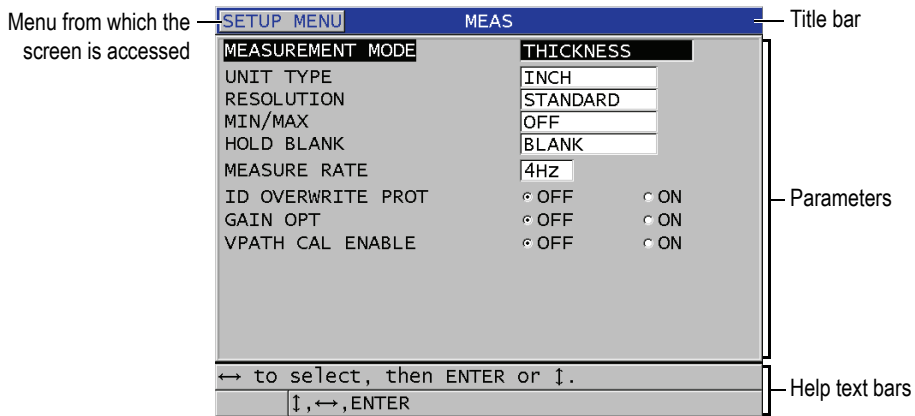


Figure 3-6 Parameter screen example

The title bar, located at the top of the parameter screen, indicates the parameter subject. When you access a parameter screen from a menu, a menu button appears on the left side of the title bar. You can select this menu button to easily return to the original menu. One or two help text bars, appearing at the bottom of the screen, indicate the keys to use to select a parameter and edit its value.

To select a parameter and edit its value

1. Use the [▲] and [▼] keys to highlight the desired parameter.
2. For parameters with predefined values, use the [▶] and [◀] keys to select the desired value.
3. In parameter screens containing lists or alphanumeric parameters:
 - In a list, use the [▲] and [▼] keys to highlight the desired list item.
 - For an alphanumeric parameter, use the [▲] and [▼] keys to enter the desired characters (see section 3.4 on page 38 for details).
 - Press [2nd F], [▼] or [2nd F], [▲] to leave a list or an alphanumeric parameter, and respectively go to the next or previous screen element.
4. To exit the parameter screen:
 - ◆ Press [MEAS] to return to the measurement screen.
 - OR
 - ◆ When a menu button appears in the left corner of the title bar, use the [▲] key to highlight the menu button, and then press [ENTER] to reopen the menu.

NOTE

In the remainder of this document, the above procedure is summarized by simply stating to select a specific parameter or list, and its value. For example: "In the **MEAS** screen, set **MEASUREMENT MODE** to **THICKNESS**."

3.4 Selecting the Text Edit Mode

The 38DL PLUS offers two methods to edit the value of alphanumeric parameters. You can either use the virtual keyboard or the traditional method. The virtual keyboard appears on the screen to show all the available characters that you can use (see section 3.4.1 on page 38 for details). With the traditional method, you select each character from a hidden list of standard sorted letters, numbers, and special characters (see section 3.4.2 on page 40 for details).

To select the text edit mode

1. From the measurement screen, press [SETUP MENU].
2. In the menu, select **SYSTEM**.
3. In the **SYSTEM** parameter screen, highlight **TEXT EDIT MODE**, and then select the desired mode (**VIRTUAL** or **TRADITIONAL**).
4. Press [MEAS] to return to the measurement screen.

3.4.1 Editing Text Parameters Using the Virtual Keyboard

When the text edit mode is set to **VIRTUAL**, the virtual keyboard appears when you select an alphanumeric parameter (see Figure 3-7 on page 39).



Figure 3-7 Example of the virtual keyboard

To edit an alphanumeric parameter value using the virtual keyboard

1. Select an alphanumeric parameter.
The virtual keyboard appears.
2. Use the [▲], [▼], [▶], and [◀] keys to highlight the character that you wish to enter, and then press [ENTER].
The selected character appears in the parameter value text box and the cursor moves to the next character position.
3. Repeat the previous step to enter other characters.
4. If you need to move the position of the cursor in the value text box, on the virtual keyboard, highlight either the left or right arrow button (below **DONE**), and then press [ENTER].
The cursor moves by one character position.
5. When you need to delete a character:
 - a) Move the cursor to the character you wish to delete.
 - b) On the virtual keyboard, highlight **DELETE**, and then press [ENTER].
6. When you need to insert a character:
 - a) Move the cursor to the character in front of which you wish to insert a character.
 - b) On the virtual keyboard, highlight **INSERT**, and then press [ENTER].
 - c) Enter the desired character in the inserted space.

7. If you want to cancel the editing operation and return to the original parameter value, on the virtual keyboard, highlight **CANCEL**, and then press **[ENTER]**.
8. To complete the editing of the parameter value, on the virtual keyboard, highlight **DONE**, and then press **[ENTER]**.

NOTE

When editing a multiple line parameter value, highlighting **DONE** and pressing **[ENTER]** moves the cursor to the next line. You can also press **[2nd F]**, **[▼]** to accept the text and move the cursor to the next line.

3.4.2 Editing Text Parameters Using the Traditional Method

When the text edit mode is set to **TRADITIONAL**, you select each character from a hidden circular list of standard sorted letters, numbers, and special characters (see Figure 3-8 on page 40). Only upper case letters are available.

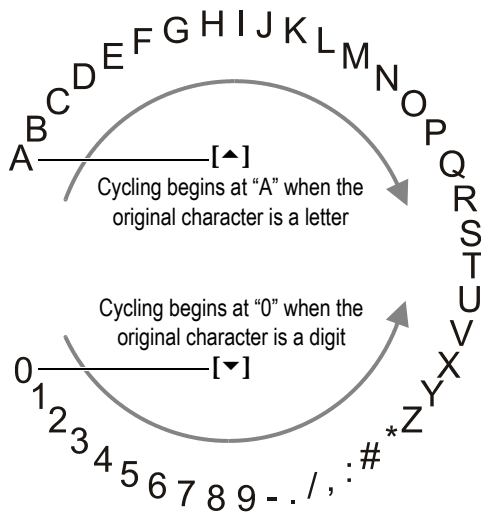


Figure 3-8 The character cycle of the traditional text edit method

To edit an alphanumeric parameter value using the traditional method

1. Select an alphanumeric parameter.
2. Use the [▲] and [▼] keys to select the character that you wish to enter. Hold down the key to quickly cycle through the letters, numbers, and special characters.
3. Use the [▶] keys to move to the next character.
4. Repeat the steps 2 and 3 to enter other characters.
5. If you need to move the position of the cursor in the value text box, use the [▶] or [◀] key.
6. To insert a character at the cursor position, press [CAL ZERO].
The character at the cursor and all those to the right moves one position to the right, making a space for a new character.
7. To delete the character at the cursor position, press [CAL VEL].
The character at the cursor is deleted and any characters to the right move to the left by one position.
8. Press [ENTER] to accept the character string and move to the next parameter.

4. Initial Setup

The following sections describe basic system configurations.

4.1 Setting the User Interface Language and Other System Options

You can configure the 38DL PLUS to present the user interface in the following languages: English, German, French, Spanish, Japanese, Chinese, Russian, Swedish, Italian, Norwegian, Portuguese, Czech, and a customized interface. You can also set the character delimiting the radix of a number.

The 38DL PLUS includes a beep tone generator to confirm when a key is pressed and to notify you of an alarm condition. You can set the beeper on or off.

To save battery while you do not use the instrument, you can enable the inactive time function so that the instrument automatically turns off when no key has been pressed and no measurement has been made within about six minutes.

To change the user interface language and other system options

1. Press [SETUP MENU].
2. In the menu, select **SYSTEM**.
3. In the **SYSTEM** screen (see Figure 4-1 on page 44):
 - a) Set **BEEPER** to **ON** or **OFF**.
 - b) Set **INACTIVE TIME** to **ON** or **OFF**.
 - c) Set **LANGUAGE** to the desired language.
 - d) Set **RADIX TYPE** to the desired character (period or comma) to separate the integer and the decimal digits.

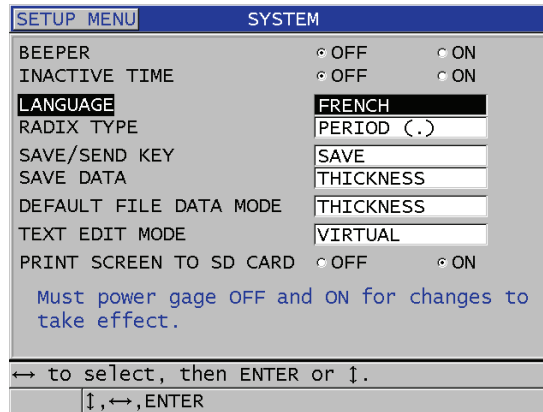


Figure 4-1 Selecting the user interface language

4. Press **[MEAS]** to return to the measurement screen.
5. Turn off the 38DL PLUS, and then turn it back on to activate the language change.

4.2 Selecting the Measurement Units

You can set the 38DL PLUS to show thickness measurements in inches or millimeters.

To set the measurement units

1. Press **[SETUP MENU]**.
2. In the menu, select **MEAS**.
3. In the **MEAS** screen, set **UNIT TYPE** to **INCH** or **MILLIMETER**.
4. Press **[MEAS]** to return to the measurement screen.

4.3 Setting the Clock

The 38DL PLUS has a built-in date and time clock. You can set the date and the time and select their format. The 38DL PLUS saves all measurements value with their acquisition date.

To set the clock

1. Press [2nd F], [SETUP MENU] (SP MENU).
2. In the menu, select **CLOCK**.
3. In the **CLOCK** screen (see Figure 4-2 on page 45):
 - a) Set parameters to the current date and time and to the desired date and hour modes.
 - b) Select **SET**.

The screenshot shows a menu titled 'SP MENU' and 'CLOCK'. The settings are as follows:

MONTH	2
DAY	24
YEAR	2010
DATE MODE	MM/DD/YYYY
HOUR	2 PM
MINUTE	35
HOUR MODE	12 HOUR

At the bottom of the screen, there are two buttons: 'SET' and 'CANCEL'. Below the main menu area, there is a help text: '↔ to change value, then ENTER or ↑.' and a key indicator: '↑, ↔, ENTER'.

Figure 4-2 Selecting clock parameters

4.4 Changing Display Settings

You can change the appearance of some display elements such as colors, brightness, waveform rectification, and waveform trace.

To change the display setting

1. From the measurement screen, press [DISPLAY].
2. In the **DISPLAY SETTINGS** screen (see Figure 4-3 on page 46), select the desired parameter and value for the following parameters:
 - **COLOR SCHEME** to either select the **INDOOR** or **OUTDOOR** optimized visibility (see section 4.4.1 on page 46 for details).

- **DISPLAY BRIGHTNESS** to select one of the predefined brightness levels (see section 4.4.2 on page 47 for details).
- **WAVEFORM RECTIFICATION** to select one of the rectification modes (see section 4.4.3 on page 48 for details).
- **WAVEFORM TRACE** to select one of the trace types (see section 4.4.4 on page 49 for details).
- **VGA OUTPUT** to turn **ON** or **OFF**, the VGA signal for the VGA output (see section 5.7 on page 80 for details).

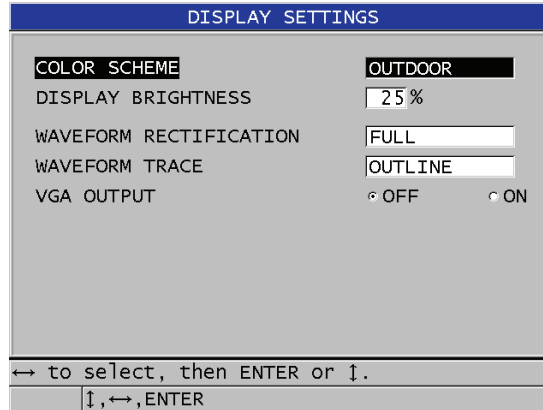


Figure 4-3 The **DISPLAY SETTINGS** screen

3. Press **[MEAS]** to return to the measurement screen.

4.4.1 About the Color Schemes

The 38DL PLUS offers two standard color schemes designed to provide best display visibility in indoor or outdoor lighting conditions (see Figure 4-4 on page 47). From the measurement screen, press **[DISPLAY]** to access the **COLOR SCHEME** parameter.

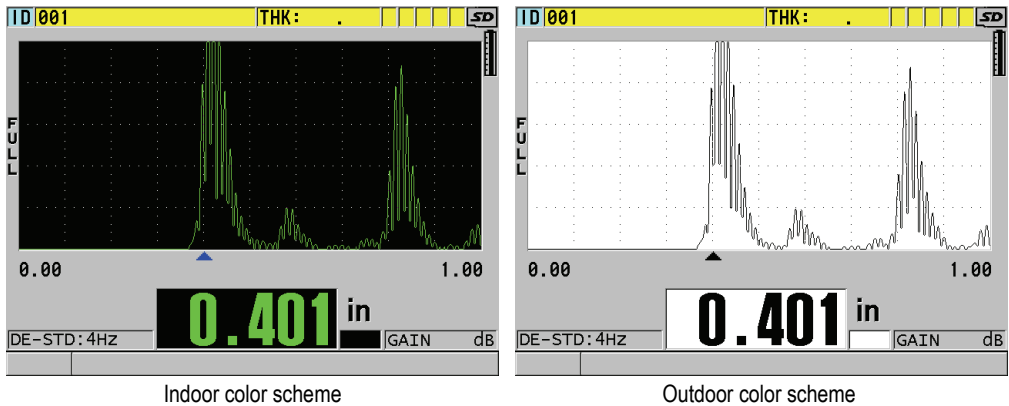


Figure 4-4 Example of the indoor and the outdoor color schemes

The indoor scheme gives the best visibility when you use the instrument indoors or in low lighting conditions. The indoor scheme presents green characters and waveform trace on a black background.

The outdoor scheme gives best visibility when you use the instrument in direct sunlight. The outdoor mode presents black characters and waveform trace on a white background. For best readability, in this document, most screen captures are shown with the outdoor color scheme.

NOTE

Colored measurement values corresponding to specific alarm conditions only appear when the indoor color scheme is selected.

4.4.2 About Display Brightness

You can adjust the 38DL PLUS display brightness by selecting the backlight intensity. The display brightness can be set at 0 %, 25 %, 50 %, 75 %, and 100 %. Choosing a high percentage increases the brightness of the display. By default, the display brightness is set to 25 %. From the measurement screen, press **[DISPLAY]** to access the **DISPLAY BRIGHTNESS** parameter.

The 38DL PLUS uses a transfective color display that reflects ambient light and becomes brighter in direct light. With brighter ambient conditions, you can set the display brightness to a lower percentage.

NOTE

Reducing the display brightness percentage increases the battery life. Battery life specifications are based on backlight brightness set to 50 %.

4.4.3 About Waveform Rectification

The rectification mode is the way in which the ultrasonic echoes are represented on the waveform display (see Figure 4-5 on page 48). The rectification mode does not affect the thickness measurement in any way. The rectification indicator (**FULL**, **POS**, **NEG**, or **RF**) appears on the left edge of the waveform display. From the measurement screen, press **[DISPLAY]** to access the **WAVEFORM RECTIFICATION** parameter.

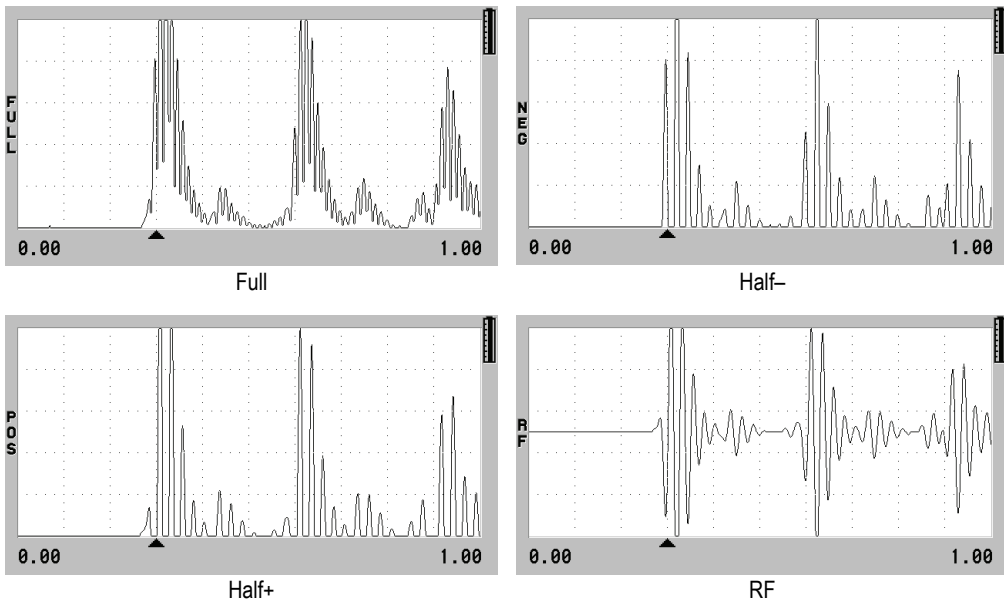


Figure 4-5 Examples of the rectification modes

The available rectification modes are:

FULL

Shows the negative portion of the echo folded around the baseline so that both positive and negative waveform lobes are displayed. Gives the best overall representation of position and magnitude for most thickness measurement applications. **FULL** is the default mode for dual element transducers.

HALF- (NEG indicator)

Shows negative waveform lobes as positive and does not show the positive lobes.

HALF+ (POS indicator)

Shows positive waveform lobes and does not show the negative waveform lobes.

RF

Shows negative and positive lobes on either side of the baseline. **RF** is the default mode for single element transducers.

4.4.4 About the Waveform Trace

The 38DL PLUS can display the waveform trace as a line (**OUTLINE**) or as a **FILLED** area (see Figure 4-6 on page 50). From the measurement screen, press **[DISPLAY]** to access the **WAVEFORM TRACE** parameter.

NOTE

A filled waveform trace is only possible when the waveform rectification is set to **FULL**, **HALF+**, or **HALF-**.

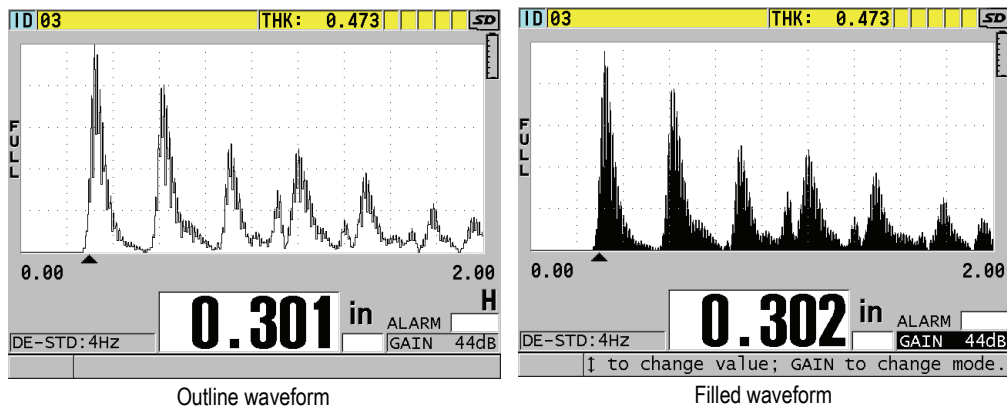


Figure 4-6 Examples of waveform trace modes

4.5 About the Range of the Waveform Display

The range of the waveform display is the distance spanned by the horizontal axis of the waveform display. The left end of the horizontal axis, the delay, is generally set to zero. You can manually adjust the delay value to change the starting point of the range (see section 4.5.2 on page 51) and select the end point of the range (see section 4.5.1 on page 51). You can also activate the zoom function to automatically set the delay and the range values to best see the echo (see section 4.5.3 on page 52).

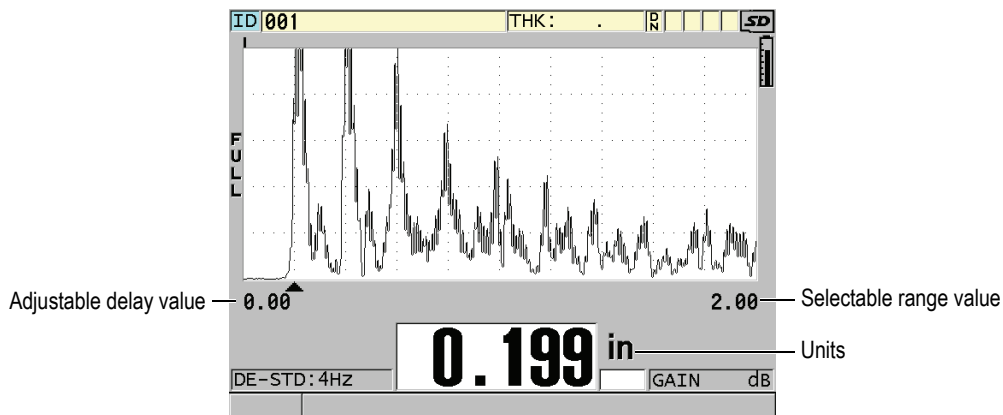


Figure 4-7 The range of the waveform display

4.5.1 Selecting the Range Value

There are fixed ranges available for each transducer frequency. The available ranges are also dependent on material sound velocity. These selectable ranges let you adjust the thickness span of the waveform display to only show the thickness range being measured and thus, obtain maximum waveform resolution for each application. The range setting affects the waveform display only. You can still make measurements even when the display range does not show the detected echo from which the thickness is measured. You cannot manually set the range while the zoom is active.

To select the range value

1. From the measurement screen, press **[RANGE]**.
The waveform range changes to the next higher available range.
2. Continue to press **[RANGE]** until you obtain the desired range.
The range value recycles to the minimum range value following the maximum value.

4.5.2 Adjusting the Delay Value

The delay of the waveform display adjusts the beginning of the horizontal span. You can adjust the delay to display the waveform of interest in the center of the waveform display. This function is very useful when using delay line or immersion transducers, or when measuring thick material so that the measured echoes can be seen in greater detail.

To adjust the delay value

1. Press **[2nd F], [RANGE] (DELAY)**.
2. Use the arrow keys to adjust the delay value.
3. Press **[2nd F], [RANGE] (DELAY)** again to stop editing the delay value.

TIP

Press and hold the **[RANGE]** key to reset the delay to zero.

4.5.3 Activating the Zoom Function

The zoom function automatically and dynamically sets the delay and the range values to optimally track and show the detected echo in the waveform display.

To activate the zoom function

1. From the measurement screen, press [ZOOM].

The zoom flag (**Z**) appears on the right side of the waveform display, below the power indicator.

2. Press [ZOOM] again to turn off the zoom function.

The resulting zoomed waveform depends on the current measurement mode. The zoom for D79X dual element transducers and mode 1 single element transducers centers the first back-wall echo on the screen (see Figure 4-8 on page 52).

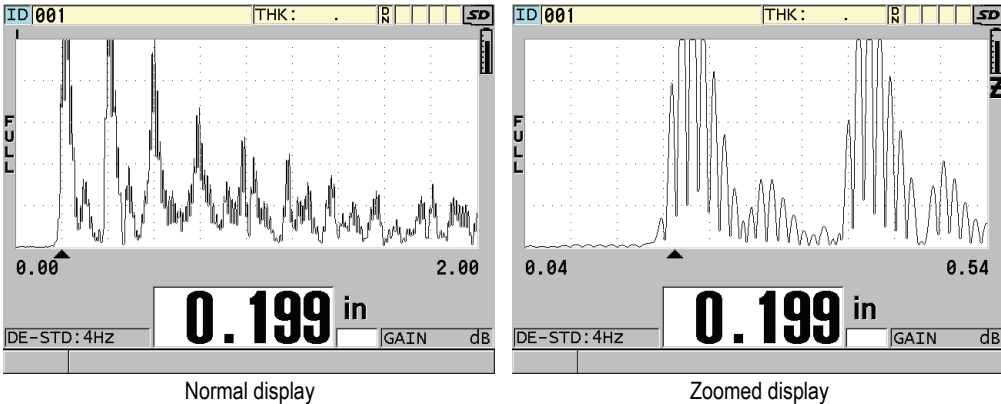


Figure 4-8 Comparing normal and zoomed display in mode 1

The zoom with single element transducers in mode 2 adjusts the waveform range and delay so that the interface echo and the first back-wall echo appear on the waveform display (see Figure 4-9 on page 53).

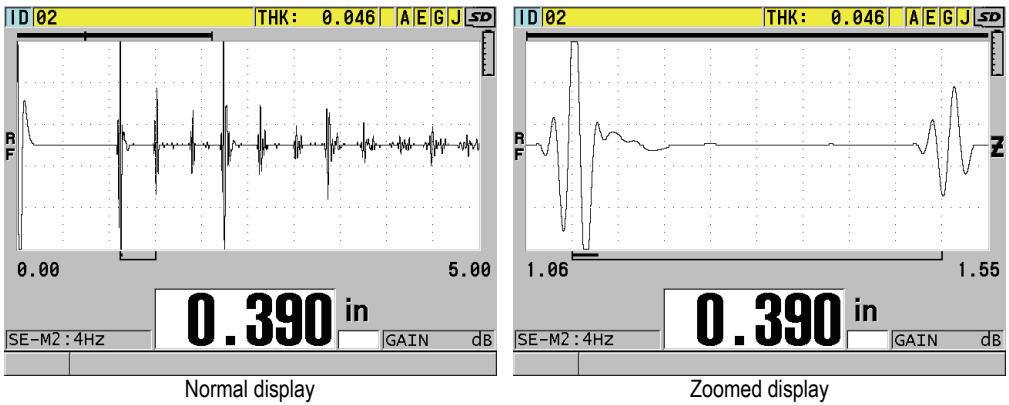


Figure 4-9 Comparing normal and zoomed display in mode 2

The zoom with single element transducers in mode 3 adjusts the waveform and delay so that the interface echo and the second measured back-wall echo appear on the waveform display (see Figure 4-10 on page 53).

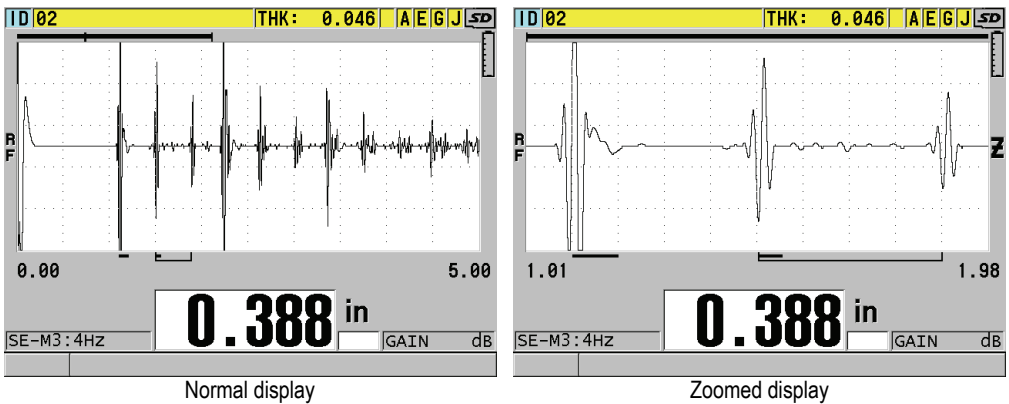


Figure 4-10 Comparing normal and zoomed display in mode 3

4.6 Adjusting the Measurement Update Rate

You can select a predefined measurement update rate (**4 Hz**, **8 Hz**, **16 Hz**, **20 Hz**, or **MAX**). The measurement update rate indicator is always present on the left of the thickness measurement (see Figure 4-11 on page 54).



Figure 4-11 The measurement update rate indicator

The **MAX** update rate is up to 30 Hz and is dependent on measurement type. This option is useful when making high temperature thickness measurements to help limit the transducer contact time or for applications where you scan the transducer over an area to find the minimum thickness.

NOTE

The 38DL PLUS automatically uses the fastest update rate when entering the **Minimum** or **Maximum** mode (see section 8.2 on page 112).

To adjust the measurement update rate

1. From the measurement screen, press [SETUP MENU].
2. In the menu, select **MEAS**.
3. In the **MEAS** screen, set the **MEASURE RATE** to the desired value.
4. Press [MEAS] to return to the measurement screen.

4.7 Changing the Thickness Resolution

You can change the thickness measurement resolution, meaning the number of digits shown to the right of the decimal point. The resolution selection affects all displays and data output of values with thickness units. This includes measured thickness,

differential reference value, and alarm set points. The highest thickness resolution with dual element transducer is 0.001 in. (0.01 mm). The velocity is always reported with full four-digit resolution.

You can reduce the resolution in some applications where the extra precision of the last digit is not required, or where extremely rough outside or inside surfaces make the last thickness display digit unreliable.

The high resolution software option (P/N: 38DLP-HR [U8147015]) allows to increase the resolution to 0.0001 in. or 0.001 mm. The high resolution is available for measured thickness smaller than 4 in. (102 mm). The high resolution is not active with low-frequency transducers and when the high penetration software option is activated.

To change the thickness measurement resolution

1. Press [**SETUP MENU**].
2. In the menu, select **MEAS**.
3. In the **MEAS** screen, set **RESOLUTION** to the desired option:
 - **STANDARD**: 0.001 in. or 0.01 mm (default)
 - **LOW**: 0.01 in. or 0.1 mm
 - Optional **HIGH**: 0.0001 in. or 0.001 mm
4. Press [**MEAS**] to return to the measurement screen.

5. Basic Operation

The following sections describe the basic operation for the 38DL PLUS ultrasonic thickness gage.

5.1 Setting Up the Transducer

The 38DL PLUS operates with a full line of single element and dual element transducers. The 38DL PLUS automatically recognizes standard D79X dual element transducers and automatically loads the appropriate predefined setup. The predefined setup contains ultrasonic velocity for the stainless steel step block supplied with the instrument. With dual element transducers, you need to perform a transducer zero compensation.

For a single element transducer, or other dual element transducers, you need to manually load an appropriate setup. The 38DL PLUS ships from the factory set up with default conditions for the purchased transducers using an approximate sound velocity for the stainless steel test block provided with the instrument. The default conditions are selected to facilitate instrument usage for your applications.

To set up the transducer

1. Plug the transducer into the transducer connector(s) at the top of the 38DL PLUS case (see Figure 5-1 on page 58). Use T/R 1 for a single element transducer.

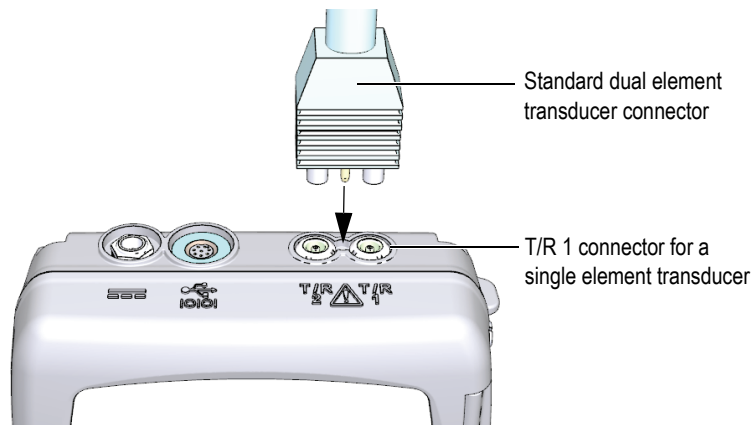


Figure 5-1 Plugging the transducer

2. Press [ON/OFF] to start the instrument. The measurement screen appears. With a standard D79X dual element transducer, the “Do--” message appears in the measurement screen (see Figure 5-2 on page 58).


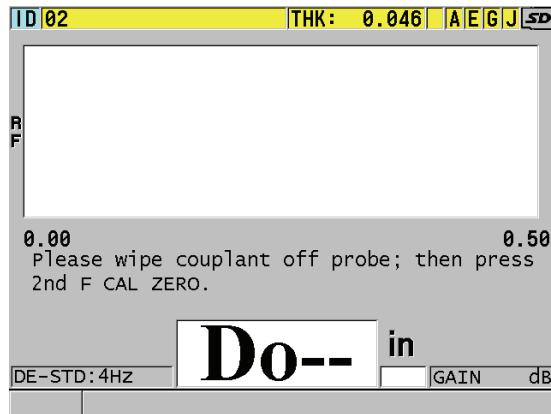


Figure 5-2 Initial screen with a standard D79X dual element transducer

3. For dual element transducers, perform the transducer zero compensation:
 - a) Wipe couplant off the tip of the transducer.

- b) Press **[2nd F]**, **[CAL ZERO]** (**Do ZERO**).
4. For a single element transducer, or other dual element transducers, load an appropriate setup:
 - a) Press **[XDCR RECALL]**.
 - b) In the menu, select the default choice for the probe type that you use (ex.: **DEFAULT SINGLE ELEMENT**).
 - c) In the **DEFAULT** screen for the type of probe that you are using (see the example shown in Figure 5-3 on page 59), in the list of available default setups, highlight the setup for the transducer that you are using.

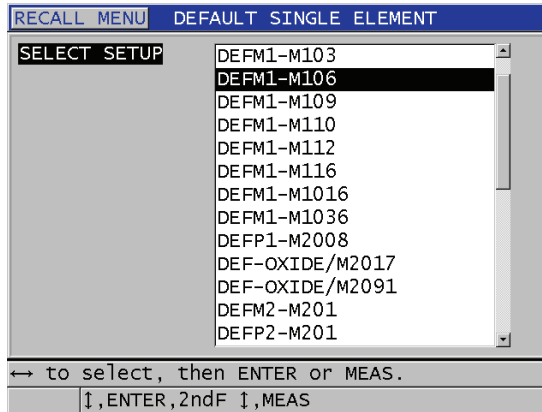

Default setup naming convention:

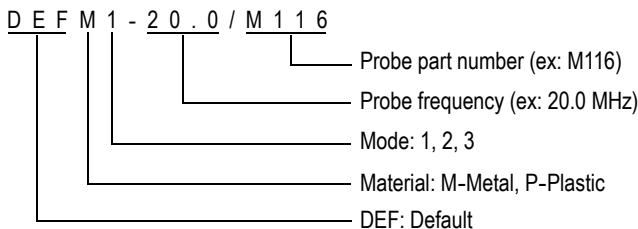


Figure 5-3 Selecting a default single element transducer setup

NOTE

You can rename the setups listed as USER-1 through USER-35 for special applications. Refer to chapter 13 on page 219 for more details on setups.

- d) Press **[MEAS]** to automatically recall the setup parameters for the chosen setup and return to the measurement screen.

5.2 About the Calibration

The calibration is the process of adjusting the instrument to accurately measure on a particular material, using a known transducer at a given temperature. Calibrating the instrument is always necessary before inspecting a specific material. The measurement accuracy is only as good as the calibration that you perform.

You need to perform the following three calibration types:

Transducer zero compensation (**[Do ZERO]**)

For dual element transducer only, calibrate for the sound transit time in each of the dual transducer delay lines. This compensation varies in each transducer unit and with temperature. You must perform the transducer zero compensation procedure when the unit is powered on, when the transducer is changed, and when the transducer temperature changes significantly (see section 5.1 on page 57 and section 5.2.3 on page 64).

Material sound velocity calibration (**[CAL VEL]**)

Perform a velocity calibration using a thick test block of the measured material with known thickness or by manually entering a previously determined material sound velocity. You must perform this procedure for each new measured material (see section 5.2.1 on page 61 and section 5.2.4 on page 65).

Zero Calibration (**[CAL ZERO]**)

Perform a zero calibration using a thin test block of the measured material with known thickness. Unlike the transducer zero compensation and the material sound velocity calibration, this procedure is not required unless you need the best absolute accuracy (better than ± 0.004 in. or ± 0.10 mm). You only need to do it once for each new transducer and material combination. You do not have to repeat the zero calibration when the transducer temperature changes; Transducer

zero compensation is responsible for that task (see section 5.2.1 on page 61 and section 5.2.4 on page 65).

5.2.1 Calibrating the Instrument

When you want to make accurate measurements, you need to perform the following calibrations:

- Material sound velocity calibration
- Zero calibration

You must perform the calibrations using a thick and a thin sample of precisely known thicknesses. The sample must be made of the same material as the parts to be inspected (see section 5.2.2 on page 64 for details on test blocks).

The following procedure is illustrated using a dual element probe and a 5-step test block. Refer to section 5.2 on page 60 for more details on the calibration process.

To calibrate the instrument

1. To perform the material sound velocity calibration (see Figure 5-4 on page 62):
 - a) Place a drop of couplant on the surface of the thick part of the test block.
 - b) Couple the transducer to the thick part of the test block using moderate to firm pressure.
The waveform and the thickness reading appear on the screen.
 - c) Press **[CAL VEL]**.
 - d) When the thickness reading is stable, press **[ENTER]**.
 - e) Using the arrow keys, edit the thickness value to match the known thick thickness of the test block.

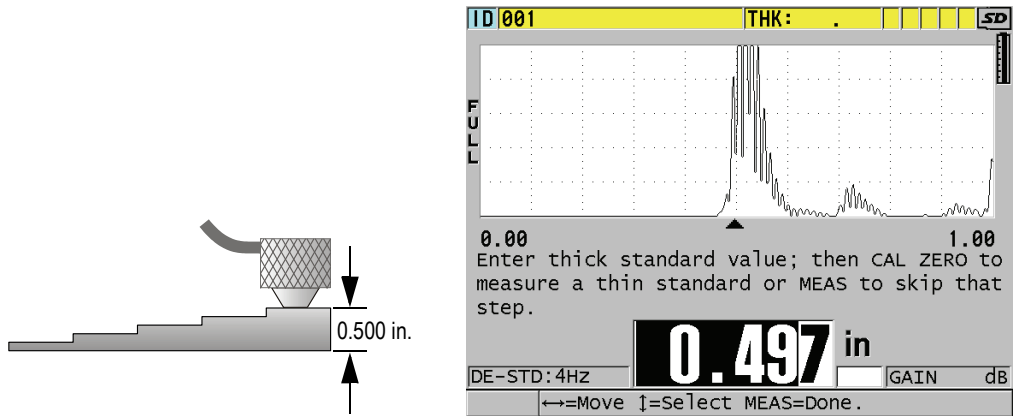


Figure 5-4 Performing the material sound velocity calibration on a 5-step test block

2. To perform the zero calibration (see Figure 5-5 on page 63):
 - a) Place a drop of couplant on the surface of the thin part of the test block.
 - b) Couple the transducer to the thin part of the test block, and then press **[CAL ZERO]**.
 - c) When the thickness reading is stable, press **[ENTER]**.
 - d) Using the arrow keys, edit the thickness value to match the known thin thickness of the test block.

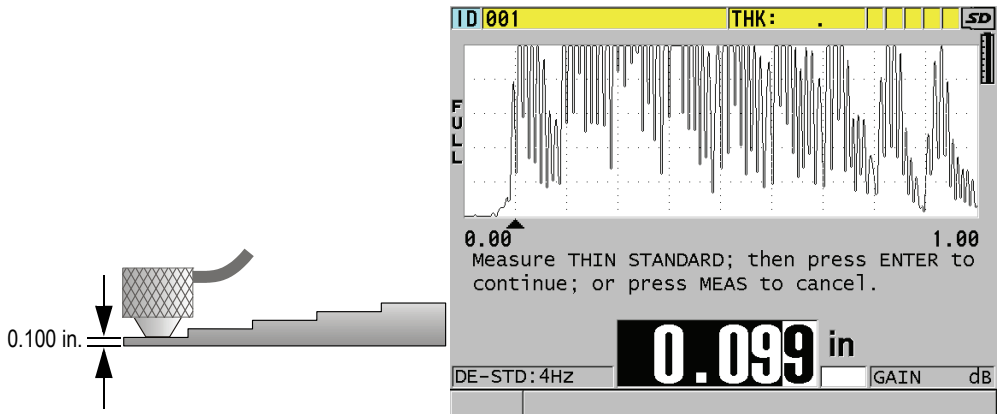


Figure 5-5 Performing the zero calibration on a 5-step test block

3. Press **[MEAS]** to complete the calibration and return to the measurement screen.



IMPORTANT

If you turn off the instrument before pressing **[MEAS]**, the velocity is not updated to the new value; instead the instrument retains the previous value.

NOTE

When the 38DL PLUS detects an error in the calibration procedure, it successively displays the following messages in the help text bar before returning to the measurement screen:

“Potential wrong echo detected!”

“Invalid calibration results!”

In this case, the velocity is not changed. The probable case is that an incorrect thickness value was entered.

5.2.2 About Test Blocks

The 38DL PLUS comes with a cylindrical stainless steel test block with two thicknesses. You can use the two precisely known test block thicknesses to perform the material sound velocity and the zero calibrations.

Precision step test blocks are also often used when more than two known thicknesses are needed (see Figure 5-6 on page 64).



Figure 5-6 Example of a 5-step test block

When performing the material sound velocity and zero calibration, you must use a test block with the following characteristics:

- Made from the same material as the parts to be tested.
- Have two or more precisely known thicknesses
- Have one part as thin as the thinnest section of the parts to be tested to perform the zero calibration. The surface condition should be similar to that of the tested parts. Rough surfaces generally reduce the accuracy of measurements, but simulating actual surface conditions on the calibration block can help to improve results.
- Have one part as thick as the thickest section of the parts to be tested, to perform the material sound velocity calibration. The front and back surfaces should be smooth and parallel.
- Be at the same temperature as the samples to be measured.

5.2.3 About the Transducer Zero Compensation

Perform a transducer zero compensation by pressing **[2nd F]**, **[CAL ZERO]** (**Do ZERO**) whenever the message “Do—” or the zero indicator appear. You should also perform this procedure when the dual element transducer temperature has changed.

The frequency at which you perform a transducer zero compensation procedure depends on the rate of change of the internal temperature of the dual element transducer. This is related to the material surface temperature, frequency of transducer application, length of time the transducer is held in contact with the material, and the accuracy that you want to obtain.

NOTE

When measurements are made on surfaces that are significantly above room temperature, the zero should be recalibrated on a regular basis. This is less important for transducers part numbers D790-SM, D791-RM, D797-SM, and D798 than for other transducers that have various types of resin delay lines.

For high temperature measurements, Olympus recommends that you develop a transducer zero compensation schedule that takes these factors into account. For example, use the D790-SM, D791-RM, or D797-SM for high temperature applications, minimizing the frequency of the zero compensation. You can also use the D790-SM and D791-RM for general purpose applications.

5.2.4 About the Material Sound Velocity and the Zero Calibrations

The 38DL PLUS performs a material gain optimization during the velocity calibration procedure when this feature is activated (see section 9.1 on page 123).

For dual element transducers, the material gain optimization (**GAIN OPT** in the **MEAS** screen) evaluates the signal from the test block and automatically sets a starting default gain based on the transducer sensitivity and material noise levels. When the default gain required is outside of the allowable range, a message appears, specifying that the transducer may not be functioning correctly.

The 38DL PLUS performs a calibration doubling verification to help prevent mis-calibrating on thin samples. Doubling occurs when the instrument measures the time to the second back-wall echo rather than detecting the first back-wall echo. The 38DL PLUS compares the measured time of flight to the expected time of flight based on the current sound velocity. The 38DL PLUS displays a warning message if doubling is suspected. Doubling can occur when measuring a thickness that is below the minimum range of the transducer, or when a transducer is worn or low in sensitivity.

NOTE

You can also achieve a material sound velocity and zero calibration procedure by performing the operations in the reverse order, starting with the zero calibration, followed by the material sound velocity calibration.

5.2.5 Entering a Known Material Sound Velocity

When preparing to measure thicknesses on parts made of a different material, if you know the sound velocity for the material, you can directly enter the velocity without performing a material sound velocity calibration procedure.

To enter a known material sound velocity

1. From the measurement screen, press [2nd F], [CAL VEL] (VEL).
2. In the **VELOCITY** screen (see Figure 5-7 on page 66), use the arrow keys to edit the velocity to the known value.

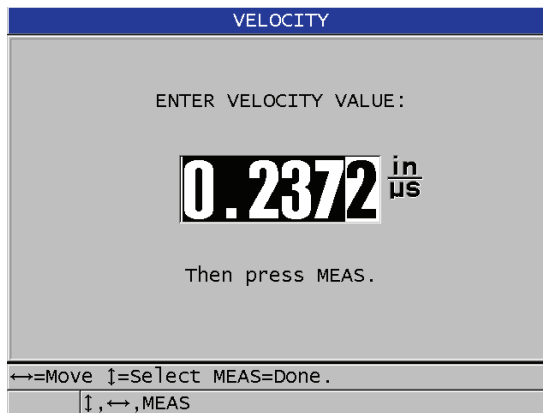


Figure 5-7 Entering a known material sound velocity

3. Press [MEAS] to return to the measurement screen.

5.2.6 About Locked Calibrations

The 38DL PLUS includes a password-protected locking function to prevent changes to setups and prevent access to some functions. A change to the calibration is one action that you can lock. When this is the case, the message shown in Figure 5-8 on page 67 appears momentarily on the help text bar (see section 8.5 on page 119 for details).



Figure 5-8 The calibration lock message

5.2.7 Factors Affecting the Performance and the Accuracy

The following factors affect the performance of the instrument and the accuracy of the thickness measurements.

Calibration

The accuracy of any ultrasonic measurement is only as good as the accuracy and care with which you calibrate the instrument. The 38DL PLUS ships from the factory with standard setups for a number of transducers and applications. In some cases, it may be desirable to optimize these setups for specific measurement situations. In all cases, it is essential that you perform the velocity and zero calibrations whenever the test material or transducer is changed. Periodic checks with samples of known thickness are recommended to verify that the gage is operating properly.

Surface roughness of the test piece

The best measurement accuracy is obtained when both the front and back surfaces of the test piece are smooth. When the contact surface is rough, the minimum thickness that can be measured will be increased because of sound reverberating in the increased thickness of the couplant layer. Additionally, when the two test piece surfaces are rough, the slightly different multiple sound paths seen by the transducer may cause distortion in the returning echo, resulting in measurement inaccuracies.

Coupling technique

In mode 1 (contact transducer) measurements, the couplant layer thickness is part of the measurement and is compensated by a portion of the zero offset. If

maximum accuracy is to be achieved, then the coupling technique must be consistent. In order to accomplish consistent measurements, use a couplant of reasonably low viscosity; employ only enough couplant to achieve a reasonable reading; and apply the transducer with uniform pressure. Practice will show the degree of moderate to firm pressure that produces repeatable readings. In general, smaller diameter transducers require less coupling force to squeeze out the excess couplant than larger diameter transducers. In all modes, tilting the transducer distorts echoes and causes inaccurate readings, as noted below.

Curvature of the test piece

A related issue to this section involves the alignment of the transducer with respect to the test piece. When measuring on curved surfaces, it is important that the transducer be placed approximately on the centerline of the part and held as steadily to the surface as possible. In some cases, a spring-loaded V-block holder may be helpful for maintaining this alignment. In general, as the radius of curvature decreases, the size of the transducer should be reduced, and the more critical transducer alignment will become. For very small radii, an immersion approach is necessary. In some cases it may be useful to observe the waveform display as an aid in maintaining optimum alignment. Practice the best way to hold a transducer with the aid of a waveform display. On curved surfaces, it is important to use only enough couplant to obtain a reading. Excess couplant forms a fillet between the transducer and the test surface where sound reverberates and possibly creates spurious signals that may trigger false readings.

Taper or eccentricity

If the contact surface or back surface of the test piece is tapered or eccentric with respect to the other, the return echo is distorted due to the variation in sound path across the width of the beam. The accuracy of the measurement is reduced. In severe cases, no measurement is possible.

Acoustic properties of the test material

There are several conditions found in certain engineering materials that can potentially limit the accuracy and range of ultrasonic thickness measurements:

- Sound scattering:
In materials such as cast stainless steel, cast iron, fiberglass, and composites, sound energy scatters from individual crystallites in the casting or boundaries of dissimilar materials within the fiberglass or composite. Porosity in any material can have the same effect. Adjust the instrument sensitivity to prevent detection of these spurious scatter echoes. This compensation can in turn limit the ability to discriminate a valid return echo from the back wall of the material, thereby restricting measurement range.

- **Sound attenuation or absorption:**
In many organic materials such as low density plastics and rubbers, sound energy is attenuated very rapidly at the frequencies used for ultrasonic gaging. This attenuation typically increases with temperature. The maximum thickness that can be measured in these materials will often be limited by attenuation.
- **Velocity variations:**
An ultrasonic thickness measurement is accurate only to the degree that material sound velocity is consistent with the instrument calibration. Some materials exhibit significant variations in sound velocity from point to point. This happens in certain cast metals due to the changes in grain structure that result from varied cooling rates, and the anisotropy of sound velocity with respect to grain structure. Fiberglass can show localized velocity variations due to changes in the resin/fiber ratio. Many plastics and rubbers show a rapid change in sound velocity with temperature, requiring that velocity calibration be performed at the temperature where measurements are made.

Phase reversal or phase distortion

The phase or polarity of a returning echo is determined by the relative acoustic impedances (density \times velocity) of the boundary materials. The 38DL PLUS assumes the customary situation where the test piece is backed by air or a liquid, both of which have a lower acoustic impedance than metals, ceramics, or plastics. However, in some specialized cases, such as measurement of glass or plastic liners over metal, or copper cladding over steel, this impedance relationship is reversed and the echo appears phase reversed. In these cases, it is necessary to change the appropriate echo detection polarity in order to maintain accuracy (see section 13.8.1 on page 233). A more complex situation can occur in anisotropic or in homogeneous materials such as coarse-grain metal castings or certain composites, where material conditions result in the existence of multiple sound paths within the beam area. In these cases, phase distortion can create an echo that is neither cleanly positive nor negative. Careful experimentation with reference standards is necessary in these cases to determine effects on measurement accuracy.

5.3 Measuring Thicknesses

You can start measuring thicknesses once a transducer is connected (see section 5.1 on page 57) and once the instrument is calibrated (see section 5.2.1 on page 61).

To measure thicknesses

1. Apply couplant to the test block or tested part at the measuring spot.

NOTE

In general, use a thinner couplant such as propylene glycol, glycerin, or water for smooth material surfaces. Rough surfaces require a more viscous couplant such as gel or grease. Special couplants are required for high temperature applications.

2. Using moderate to firm pressure, couple the tip of the transducer to the surface of the test material, and keep the transducer as flat as possible on the material surface (see Figure 5-9 on page 70).

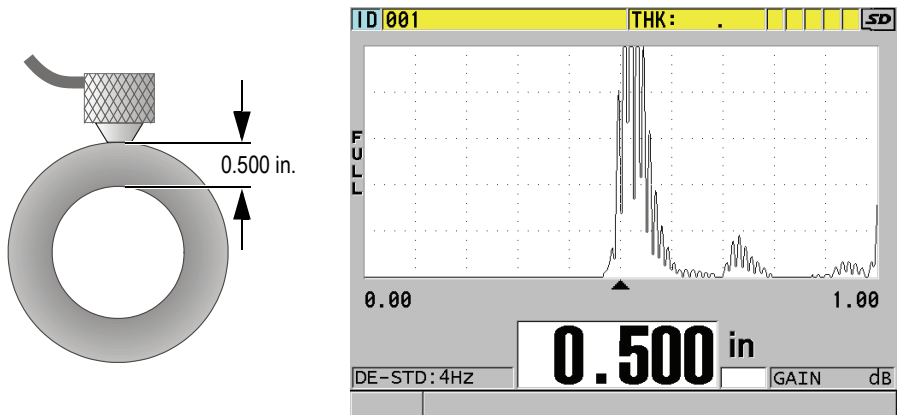


Figure 5-9 Coupling dual element transducer and reading the measured thickness

3. Read the measured thickness value for the tested part.

5.4 Saving Data

The 38DL PLUS datalogger is a file based system where one file is opened at a time. The active file stores a measurement at a thickness measurement location ID. Each time you press [SAVE/SEND], the displayed value is saved to the active file at the

current ID. The ID is automatically incremented for the next measurement. When you press [FILE], the name of the active file appears in the ID bar above the menu (see Figure 5-10 on page 71).

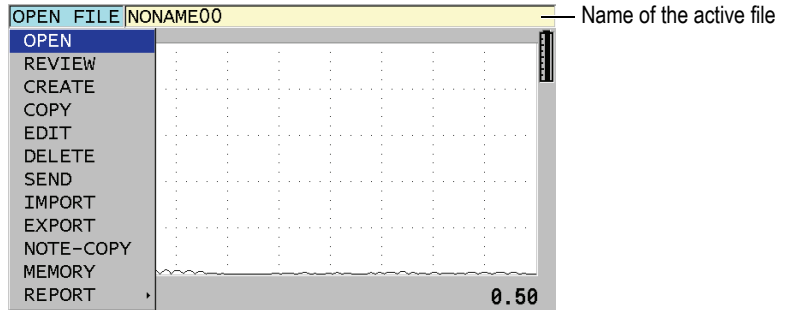


Figure 5-10 The active file name appearing in the ID bar

The NONAME00 increment type file, starting with the 001 ID, is the active file by default when you first use the 38DL PLUS or after resetting the instrument memory. You can create various types of files and define IDs to represent various 1-D, 2-D, or 3-D thickness measurement locations. When restarting, the instrument automatically opens the last file that was used.

The following special cases may occur:

- When the thickness value is blank, “— —” is saved rather than a value.
- When a measurement is already stored at the current ID, the new value overwrites the old thickness reading unless the overwrite protection is enabled (see section 11.5 on page 194).
- When the ID increment reaches the end of a sequence and cannot be updated, **Last ID** appears on the help text bar, a long beep sound is emitted (when the beeper is active), and the ID on the display remains unchanged.

Refer to chapter 11 on page 157 for more information on the datalogger.

To save data at the current ID in the active file

- ◆ While the desired thickness value and waveform are displayed, press [SAVE/SEND] to save the measured thickness value.
OR

- ◆ Press **[2nd F]**, **[SAVE/SEND]** (**WAVEFORM**) to save the measured thickness value and the waveform.

TIP

If you want to always save both the thickness and the waveform when you press **[SAVE/SEND]**, in the **SYSTEM** screen, set **SAVE DATA** to **THK+WF** (see section 9.2 on page 126).

5.5 Measurements with THRU-COAT D7906 and D7908 Transducers

THRU-COAT is a function that measures the true metal thickness of coated or painted parts. This function only requires a single back-wall echo and is recommended for heavy corrosion applications where the outside of the material is coated or painted. If needed, you can also calibrate the measurement of the coating/paint layer to precisely measure the thickness of the coating/paint.

5.5.1 Enabling the THRU-COAT Function

The THRU-COAT function is only available when you connect a THRU-COAT transducer (P/N: D7906 [U8450005] or D7908 [U8450008]) to the 38DL PLUS.

To enable the THRU-COAT function

1. Connect a THRU-COAT transducer to the 38DL PLUS.
2. Start the instrument.
3. Wipe the couplant off the transducer tip.
4. Press **[2nd F]**, **[CAL ZERO]** (**Do ZERO**).



Figure 5-11 Opening the THRU COAT SETUP dialog box

5. Select **YES** to answer the **Enable THRU COAT?** prompt.

5.5.2 Performing a THRU-COAT Calibration

The calibration procedure for a THRU-COAT probe is similar to the procedure for other probes. As for a normal calibration, you need two uncoated samples with accurately known thin and thick thicknesses to perform the following calibration procedure. The difference is that towards the end of the procedure, you can press **[CAL VEL]** a second time to calibrate the coating thickness measurement on a sample with an accurately known coating thickness.

To perform a THRU-COAT calibration

1. Ensure that the THRU-COAT function is enabled (see section 5.5.1 on page 72).
2. Couple the transducer to the thick sample.
3. Press **[CAL VEL]**.
4. When the reading is stable, press **[ENTER]**.
5. Using the arrow keys, edit the thickness value to match the known thickness of the sample.
6. Couple the transducer to the thin sample.
7. Press **[CAL ZERO]**.
8. When the reading is stable, press **[ENTER]**.
9. Using the arrow keys, edit the thickness value to match the known thickness of the sample.
10. If the coating thickness measurement accuracy is important for your application, perform the following actions (omitting this step does not affect the accuracy of the metal thickness measurement):
 - a) Press **[CAL VEL]** again.
 - b) Couple the transducer to the coated sample.
 - c) When the reading is stable, press **[ENTER]**.
 - d) Using the arrow keys, edit the thickness value to match the known coating thickness of the coated sample.
11. Press **[MEAS]** to complete the calibration.

NOTE

Pressing [2nd F], [CAL VEL] (VEL) opens the VELOCITY screen where you can see and edit the calibrated metal sound velocity. Pressing [2nd F], [CAL VEL] (VEL) again opens the VELOCITY screen for the calibrated sound velocity through the coating.

5.6 About Echo Detection Modes with Dual Element Transducers

With dual element transducers, the 38DL PLUS offers three echo detection modes allowing you to measure thicknesses in various material conditions. A description of each of the three echo detection modes (STANDARD, AUTO E-TO-E, and MANUAL E-TO-E) follows:

STANDARD

The standard echo detection mode measures the thickness based on the time of flight between the main bang to the first back-wall echo. Use this mode for uncoated materials with good echo waveforms.

The DE-STD indicator appears to the left of the thickness reading and a triangular echo detection marker appears at the back-wall echo below the waveform display (see Figure 5-12 on page 74).

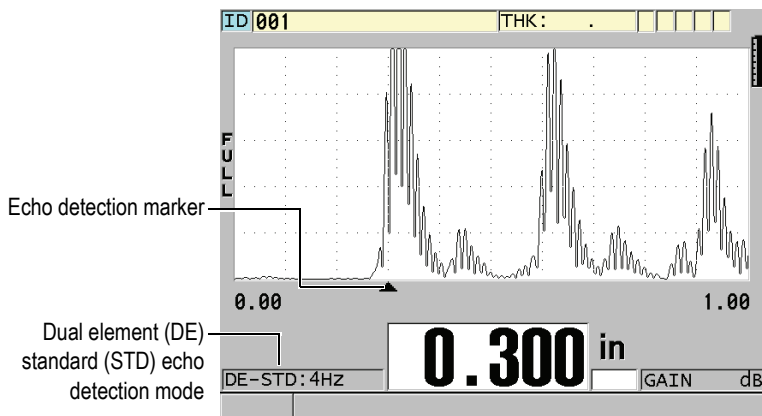


Figure 5-12 Measuring with the standard echo detection mode

AUTO E-TO-E

The automatic echo-to-echo detection mode measures the thickness using the time of flight between two consecutive back-wall echoes. Use this mode for painted or coated materials since the time interval between consecutive back-wall echoes excludes the time of flight through a paint, resin, or coating layer. The **DE-AEtoE** indicator appears to the left of the thickness reading. The triangular marker is replaced by an echo-to-echo detection bar to indicate the exact pair of back-wall echoes used to determine the thickness (see Figure 5-13 on page 75). The echo height is automatically adjusted to a preset level.

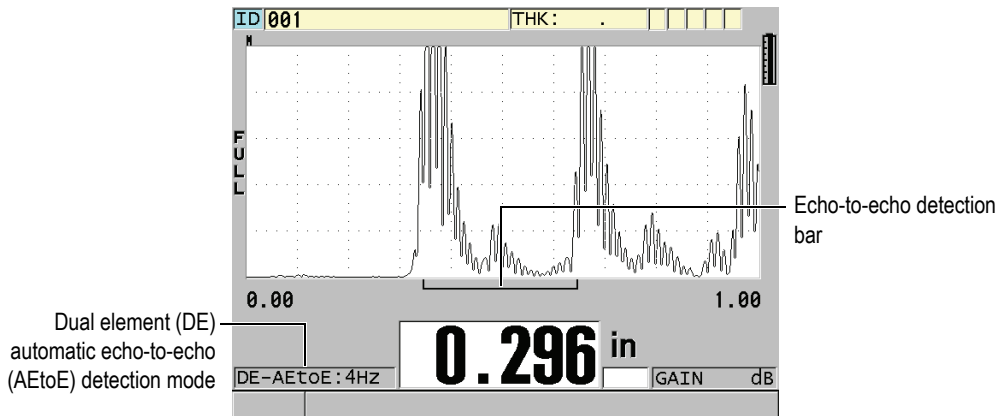


Figure 5-13 Measuring with the automatic echo-to-echo detection mode

MANUAL E-TO-E

The manual echo-to-echo detection mode also measures the thickness using the time of flight between two consecutive back-wall echoes. In this mode, you can however also manually adjust the gain and the blanking parameters. Use this mode when material conditions produce noisy signals where the automatic mode may be less effective.

The **DE-MEtoE** indicator appears to the left of the thickness reading. The echo-to-echo detection bar is similar to the automatic echo-to-echo mode but includes the adjustable E1 blank bar that indicates the area to exclude for echo detection (see Figure 5-14 on page 76). Following the E1 blank, the instrument detects the next echo with an amplitude of at least 20 % of the waveform display height. In this mode, press **[WAVE ADJ]**, and then use the arrow keys to adjust the **EXT BLANK**, the **E1 BLANK**, and the **GAIN** parameters.

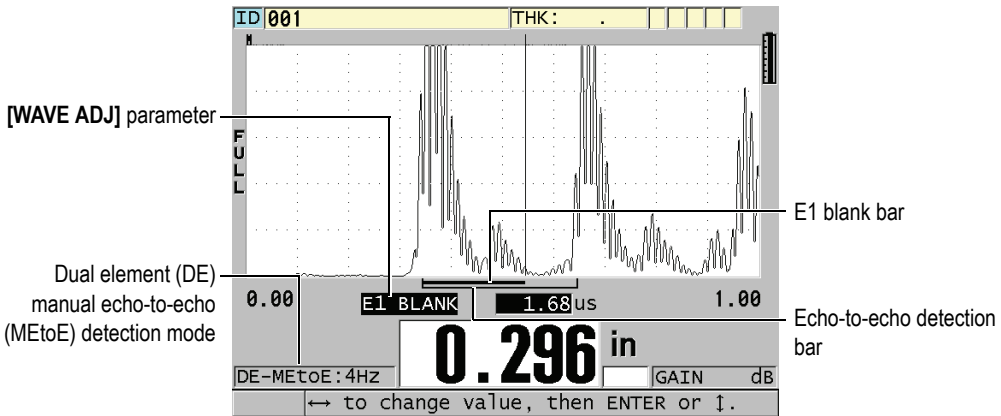


Figure 5-14 Measuring with the manual echo-to-echo detection mode

NOTE

In severe corrosion situations where valid multiple echoes are not present, you must use the standard mode to be able to measure thicknesses.

You can use dual element transducers in all three modes. You can use all measurement, display, and datalogger functions with the echo-to-echo modes. The internal datalogger recognizes and saves all necessary echo-to-echo information to upload and download thickness, waveform, and setup data.

TIP

You do not have to switch between echo detection modes when measuring both coated and uncoated areas because you can measure uncoated wall thicknesses using an echo-to-echo mode.

To change the echo detection mode

1. Press [2nd F], [ZOOM] (E-TO-E).

2. In the menu, select the desired echo detection mode (**STANDARD**, **AUTO E-TO-E**, or **MANUAL E-TO-E**).
3. To perform the zero calibration again:
 - a) Place a drop of couplant on the surface of the thin part of the test block.
 - b) Couple the transducer to the thin part of the test block, and then press **[CAL ZERO]**.
 - c) When the thickness reading is stable, press **[ENTER]**.
 - d) Using the arrow keys, edit the thickness value to match the known thin thickness of the test block.

5.6.1 Blanking Adjustments in Manual Echo-to-Echo Detection Mode

The 38DL PLUS offers two blanking functions to help detect valid echoes in situations where material conditions generate unwanted signals:

EXT BLANK

The extended blank creates a blanked zone that begins at the left edge of the waveform display and in which no signals are detected. In situations where the second or third pair of back-wall echoes are stronger or cleaner than the first pair, use the extended blank to control which pair of echoes to use for measurement.

E1 BLANK

The echo 1 (E1) blank runs for a selected interval following the first detected echo. Use the E1 blank to exclude any unwanted peaks occurring between the first and the second back-wall echoes. Unwanted peaks may be trailing edges of a large first echo, or shear wave reflections on thick test pieces. The E1 blank parameter is only available in the manual echo-to-echo detection mode.

To adjust the extended and the E1 blank parameters

1. Select the manual echo-to-echo mode:
 - a) Press **[2nd F]**, **[ZOOM]** (**E-TO-E**).
 - b) In the menu, select **MANUAL E-TO-E**.
2. Press **[WAVE ADJ]**.

The wave adjustment parameter appears (see Figure 5-15 on page 78).

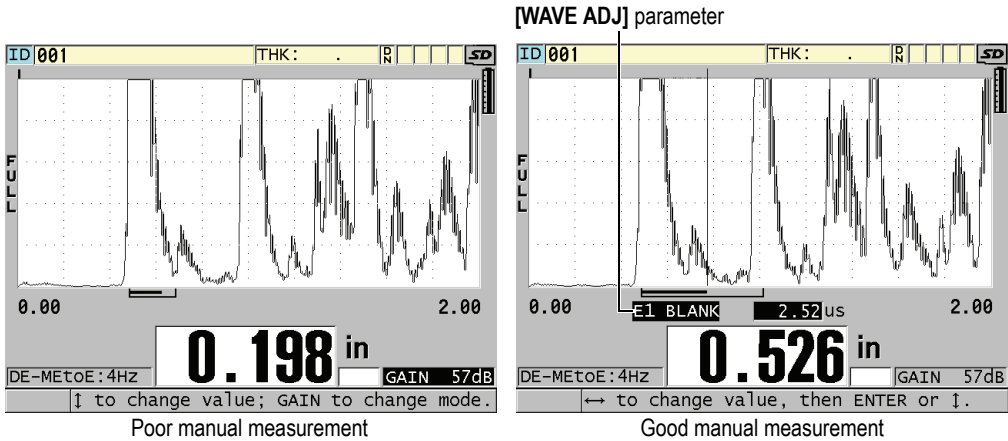


Figure 5-15 Comparing manual measurements

3. Use the [▲] and [▼] keys to select either the EXT BLANK or the E1 BLANK parameter.
4. Use the [▶] and [◀] keys to adjust the value to exclude unwanted peaks and detect the desired echoes.

5.6.2 Dual Element Transducer Selection in Echo-to-Echo Modes

Although the echo-to-echo modes work with all of the 38DL PLUS dual element transducers, Olympus recommends using particular transducers for specific thickness ranges in steel parts (see Table 3 on page 79).

Table 3 Recommended transducers for various steel thickness ranges

Transducer type	Thickness range ^a
D798	0.060 in. to 0.300 in. (1.5 mm to 7.6 mm)
D790/791	0.100 in. to 2.00 in. (2.5 mm to 51 mm)
D797	0.500 in. to 5.00 in. (12.7 mm to 127 mm)
D7906	0.100 in. to 2.00 in. (2.5 mm to 51 mm)

a. Thickness ranges are dependent on transducer type, material conditions and temperature.

In some cases, an error can occur if you are using a D790 transducer to measure thicknesses above 0.7 in. (18 mm). Typically, this error is due to a mode-converted shear-wave echo that may appear before the second back-wall echo. If this unwanted echo is larger than the second back-wall echo, the gage measures to it, which produces a thinner reading.

You can usually distinguish the unwanted shear-wave echo from the correct back-wall echo by examining the waveform display. The distance between the first and the second back-wall echoes is the same as the distance between the zero thickness point and the first back-wall echo. If there is an echo between the first two back-wall echoes, it is probably a mode-converted shear-wave echo. Use the manual echo-to-echo detection mode techniques and manually adjust the E1 blank to eliminate this error (see section 5.6.1 on page 77). Using the D797 transducer beyond 0.7 in. (18 mm) helps to eliminate the possibility of this error.

In some cases, the second or third back-wall echo is smaller in amplitude than subsequent echoes. This causes the instrument to give a double or triple reading. If you are using a D790 transducer, this effect may occur around 0.2 in. (5 mm) on flat smooth steel samples. If this occurs, it is clearly visible on the waveform display and you can work around it using the manual echo-to-echo detection mode, or moving the extended blank beyond the previously detected first echo.

When the 38DL PLUS cannot make an echo-to-echo reading, the **LOS** flag appears on the screen. In this case, the waveform display shows that either no echoes are large enough to be detected or that only one echo is detectable. In this last case, the echo-to-echo detection bar begins at the detected echo but extends indefinitely to the right. Increase the gain value to make a good echo-to-echo reading. If this does not help, you can still obtain an approximate measurement by returning to the standard echo detection mode.

5.6.3 Echo-to-Echo Mode Datalogger Flags

The following flags are used in the echo-to-echo modes in the first flag field of the uploaded thickness table and in the comment note box at the top right corner of the measurement screen:

- **E**: Automatic echo-to-echo detection mode
- **e**: Manual echo-to-echo detection mode
- **M**: Standard detection mode
- **I**: LOS in automatic echo-to-echo detection mode
- **n**: LOS in manual echo-to-echo detection mode
- **L**: LOS in standard echo detection mode

5.7 Using the VGA Output

You can connect the 38DL PLUS to an external screen or projector to more easily show the content of the 38DL PLUS screen to other people. This feature is particularly useful when you need to train other 38DL PLUS users.

When you activate the VGA output, the 38DL PLUS screen becomes blank and its contents appears only on the connected external screen. The VGA output is always turned off when you restart the 38DL PLUS.

To use the VGA output

1. Turn off the 38DL PLUS.
2. Connect the optional VGA output cable (P/N: EPLTC-C-VGA-6 [U8840035]) to the VGA output connector, located under the I/O door on the right side of the 38DL PLUS (see Figure 1-5 on page 19).
3. Connect the other end of the VGA output cable to the external screen or projector.
4. Turn on the 38DL PLUS.
5. Turn on the external screen or projector.
6. Press **[DISPLAY]**.
7. In the **DISPLAY SETTINGS** screen (see Figure 4-3 on page 46), set **VGA OUTPUT** to **ON**.
The 38DL PLUS screen becomes blank and the 38DL PLUS screen contents appears on the external screen.

8. Turn the instrument off and then back on if you need to restore the contents on the 38DL PLUS screen.

6. Using EMAT Transducers

This section provides background information regarding EMAT transducers and how to make basic thickness measurements using the 38DL PLUS and the E110-SB transducer.

An electromagnetic acoustic transducer (EMAT) uses the magnetostrictive principle to generate shear wave sound energy in ferrous metals that are externally coated with high temperature oxide scale. The E110-SB [U8471001] transducer does not work on nonferrous metal or in cases where the external surface is not coated with oxide scale. The EMAT transducer uses the external scale to generate shear wave sound energy and does not require the use of ultrasonic couplant. When the scale is not fully bonded to the surface of the steel, the shear wave sound energy is not transmitted to the steel.

The EMAT transducer is an effective way to estimate the remaining thickness of steel boiler tubes since you do not have to remove the external scale to perform the measurement. The EMAT transducer creates a nonfocused signal and is designed to give a good estimate of the remaining (± 0.010 in. or ± 0.25 mm) wall thickness. Because of the nonfocused nature of the transducer, it is relatively insensitive to small internal pits. The minimum thickness measurement capability of the 38DL PLUS and EMAT transducer is approximately 0.080 in. (2.0 mm) depending on material properties.

NOTE

Remove the external oxide and use a standard single or dual element transducer for a more accurate thickness measurement of remaining metal. Focused dual element transducers are also more sensitive to any internal pitting.

6.1 Connecting the E110-SB EMAT Transducer

You can use the E110-SB [U8471001] EMAT transducer with the 38DL PLUS. You need to use the EMAT 1/2XA/E110 [U8767104] filter adaptor and a standard LEMO-to-BNC cable (P/N: LCB-74-4 [U8800320]) as shown in Figure 6-1 on page 84.

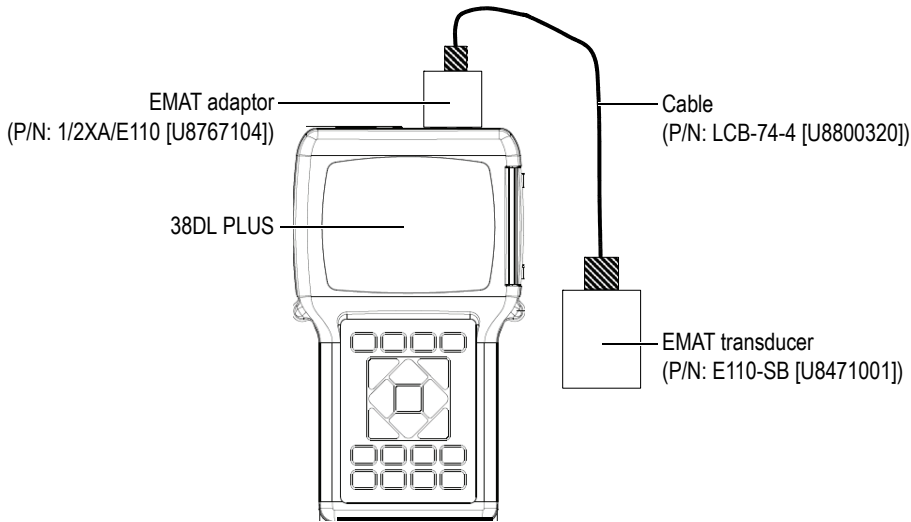


Figure 6-1 EMAT transducer and filter adaptor connection

The 38DL PLUS automatically detects the E110-SB and 1/2XA/E110 filter adaptor and automatically recalls the default **DEF-EMAT/E110** setup from the **DEFAULT SINGLE ELEMENT** transducer list. Like for standard transducers, you may need to adjust the gain and the extended blank to make proper thickness measurements. Experienced technicians familiar with the basic theory of ultrasonic gaging and the interpretation of ultrasonic waveforms can also press [**WAVE ADJ**] to adjust other transducer parameters.

6.2 Calibrating with the E110-SB EMAT Transducer

Calibration is the adjustment of the gage so that it measures accurately on a particular material. The default velocity and zero offset for the E110-SB EMAT transducer are designed to provide a good estimate of the ferrous metal thickness underneath an external oxide scale coating.

To achieve the best accuracy, use calibration samples with external oxide scale made from the material to be tested. These samples should have a metal of known thickness (not including external oxide scale) and should represent the minimum and maximum thickness of your measurement range.

The calibration procedure is the same as for a standard transducer except that you do not need to use couplant to couple the transducer to the material. Refer to section 5.2.1 on page 61 for the calibration procedure.

NOTE

The EMAT transducer generates shear wave sound energy. Consequently, the velocity calculated by the gage is the shear sound velocity of the material.

7. Software Options

You can increase the capability of the already versatile 38DL PLUS using the available software options (see Table 4 on page 87).

Table 4 38DL PLUS software options

Option	Description
HIGH RESOLUTION (see section 7.2 on page 89)	Increases the thickness resolution to 0.0001 in. or 0.001 mm for single element transducers with a frequency ≥ 2.25 MHz.
OXIDE LAYER (see section 7.3 on page 89)	Allows the 38DL PLUS to measure the thickness of both the boiler tube and its internal oxide.
MULTI-MEASUREMENT (see section 7.4 on page 95)	Allows the 38DL PLUS to measure and display up to four different layer thicknesses at the same time using single element transducers.
HIGH PENETRATION (see section 7.6 on page 107)	Allows the 38DL PLUS to use low-frequency single element transducers (as low as 0.5 MHz) for thickness measurement in attenuating and sound scattering materials.

When you purchase a software option with the original 38DL PLUS order, the option is already activated. You can also purchase software options later. You can activate the software options without having to return the instrument to the factory, by entering an activation code in the instrument (see section 7.1 on page 88).

Contact your local Olympus representative for more information regarding ordering software options. Refer to Table 42 on page 283 for the software option part numbers.

7.1 Activating Software Options

Each 38DL PLUS has a unique serial number code. An option key provided for a specific 38DL PLUS activates the purchased software options only on that specific 38DL PLUS unit. A single option key can activate one, several, or all software options.

To activate a software option

1. Press [2nd F], [SETUP MENU] (SP MENU).
2. In the menu, select **OPTIONS**.
3. In the **OPTIONS** screen (see Figure 7-1 on page 88), note the 16-digit alphanumeric serial number appearing in the **S/N** field.
The **OPTION** list indicates the actual status of the software options where **Licensed** means that the option is activated.

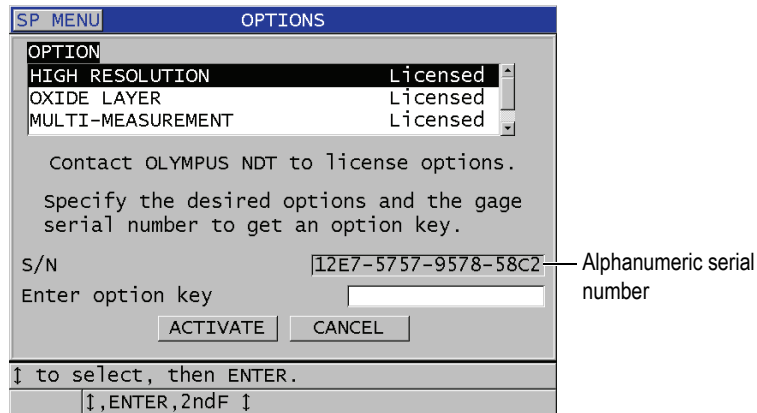


Figure 7-1 The OPTIONS screen to activate software options

4. Contact your local Olympus representative to purchase one or more software options and provide the alphanumeric serial number.
Your Olympus representative will provide you the corresponding option key.
5. In the **OPTIONS** screen (see Figure 7-1 on page 88):
 - a) In **Enter option key**, enter the option key that you received from the Olympus representative.
 - b) Select **ACTIVATE**.

- Restart the instrument to complete the activation.

7.2 High Resolution Software Option

The 38DL PLUS has the ability to display thickness values with its standard resolution of 0.001 in. (0.01 mm) and low resolution of 0.01 in. (0.1 mm). These resolutions are adequate for most ultrasonic thickness measurement applications.

For single element transducers, the high resolution software option adds the ability to display thickness readings with a high resolution of 0.0001 in. (0.001 mm). High resolution is not available for all transducers or measurement screens and is also limited by maximum thickness. Even though the 38DL PLUS has the ability to display thickness readings in high resolution, the measurement accuracy is highly dependent on material, geometry, surface condition, temperature, and needs to be determined on a case-by-case sample evaluation.

High resolution is available for the following transducers and measurement conditions:

- Single element transducer in the frequency range of 2.25 MHz to 30.0 MHz
- Thickness measurement below 4.00 in. (100 mm)

High resolution is not available for the following transducer or measurement conditions:

- Dual element transducers
- Low-frequency transducers with frequency below 2.25 MHz
- Thickness ranges over 4.00 in. (100 mm)

Once activated the high resolution selection appears in the resolution selection list (see section 4.7 on page 54).

7.3 Oxide Layer Software Option

 
The oxide layer software option allows the 38DL PLUS to measure the thickness of both the boiler tube and its internal oxide at the same time. When the oxide layer option is activated, the **OXIDE** item appears in the menu when you press **[SETUP MENU]**. Table 5 on page 90 indicates the transducer to use when using the oxide layer software option.

Table 5 Oxide layer transducers

Transducer	Minimum internal scale thickness
M2017 [U8415002]	0.010 in. (0.254 mm)
M2091 [U8415018] normal incident shear	0.006 in. (0.152 mm)

7.3.1 About Steam Boiler Tube Scale

The very high temperatures found inside steam boilers (over 1,000 °F or 500 °C) can cause the formation of magnetite (a specific type of hard and brittle iron oxide), on the inside and outside surfaces of steel boiler tubes. At very high temperatures, water vapor reacts with the iron in the steel to form magnetite and hydrogen, according to the following formula:



The speed of this reaction increases with temperature. Oxygen atoms diffuse inward through the magnetite layer, and iron atoms diffuse outward, so that scale continues to grow even after the tube surface is completely covered.

Magnetite scale acts as a thermal insulation on the pipe, since the thermal conductivity of the scale is approximately 3 % of that of steel. When heat no longer radiates efficiently from the flame through the tube and into the steam within, the tube wall heats to temperatures beyond intended operating range. Long term exposure to overly high temperatures, combined with the very high pressure inside the tube, leads to intergranular micro-cracking in the metal and to creep deformation (slow swelling or bulging of the metal). This eventually leads to tube failure.

The growth of magnetite scale and associated metal damage are primary limiting factors for boiler tube service life. The process begins slowly and then accelerates. As the scale grows thicker, the tube wall becomes hotter, which in turn increases the rate of both scale growth and metal damage. Studies in the power generation industry indicate that the effect of scale is relatively insignificant up to thicknesses of approximately 0.012 in. (0.3 mm). Beyond that thickness, the negative effects of scale increase rapidly. Measurement of scale thickness allows a plant operator to estimate remaining tube service life and to identify and replace tubes that are approaching the failure point. Ultrasonic testing with the 38DL PLUS provides a quick and nondestructive method for measuring scale.

7.3.2 Setting Up for Oxide Layer Measurement

You need to connect an appropriate transducer, select the corresponding default setup, and configure the oxide and material measurement parameters.

To set up for oxide layer measurement

1. Connect the M2017 or M2091 transducer to an LCM-74-4 cable.
2. Connect the cable to the T/R 1 single-element transducer connector at the top of the 38DL PLUS.
3. Press **[ON/OFF]** to start the instrument.
4. While in the measurement screen, press **[XDCR RECALL]**.
5. In the **DEFAULT SINGLE ELEMENT** screen, highlight **DEF-OXIDE/M2017** or **DEF-OXIDE/M2091** depending on which transducer you are using.
6. Press **[MEAS]**.
7. Press **[SETUP MENU]**.
8. In the menu, select **OXIDE**.
9. In the **OXIDE** screen (see Figure 7-2 on page 91):
 - a) In **OXIDE MEAS TYPE**, select the type of measurement for the oxide layer (**THICKNESS** or **TIME OF FLIGHT**).
 - b) In **MATERIAL MEAS TYPE**, select the type of measurement for the material layer.

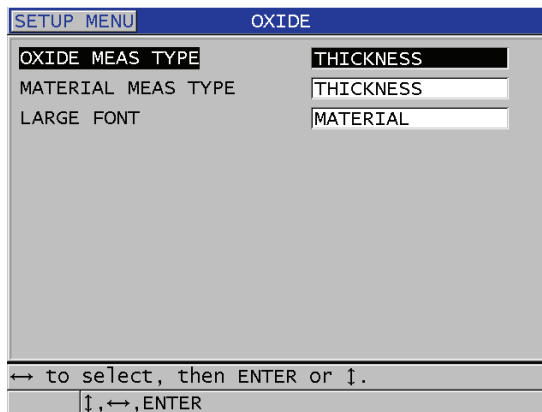


Figure 7-2 The OXIDE screen

- c) In **LARGE FONT**, select which measurement appears in the larger font in the measurement screen (see Figure 7-3 on page 92).

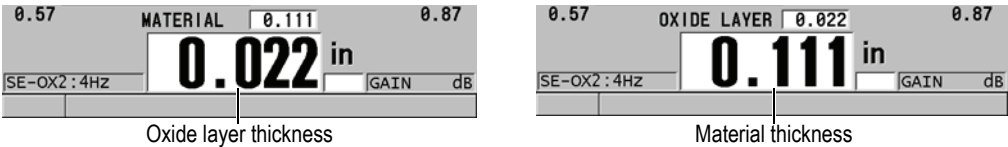


Figure 7-3 Selecting which measurement appears with the larger font

10. Press **[MEAS]** to return to the measurement screen that is now showing both the **MATERIAL** and the **OXIDE LAYER** measurements.

7.3.3 Calibrating for Oxide Layer Measurement

For the best accuracy, perform the material sound velocity and zero calibrations on oxide-free samples with known boiler tube thickness and on a sample with known internal oxide scale thickness.

To calibrate for oxide layer measurements

1. Couple the transducer to the thick oxide-free boiler tube sample.

NOTE

When using the M2091 normal incident shear transducer, you must use shear wave couplant (SWC) between the delay line and the surface of the material

2. Press **[CAL VEL]**.
 3. When the reading is stable, press **[ENTER]**.
 4. Using the arrow keys, edit the thickness value to match the known thickness of the thick sample.
 5. Couple the transducer to the thin oxide-free boiler tube sample.
 6. Press **[CAL ZERO]**.
 7. When the reading is stable, press **[ENTER]**.
 8. Using the arrow keys, edit the thickness value to match the known thickness of the thin sample.
-

9. Press [CAL VEL] again.
10. Couple the transducer to the sample with known internal oxide thickness.
11. When the reading is stable, press [ENTER].
12. Using the arrow keys, edit the thickness value to match the known internal oxide thickness.
13. Press [MEAS] to complete the calibration.

7.3.4 Measuring Boiler Tube and Oxide Layer Thicknesses

With the oxide layer software option, the 38DL PLUS simultaneously measures the thickness of the boiler tube metal and the thickness of oxide scale that has built up inside the tube.

Figure 7-4 on page 93 shows the correct ultrasonic signals using the single element transducer default setup DEF-OXIDE/M2017. The 38DL PLUS makes a standard mode 2 measurement from the delay line echo (surface of the boiler tube) to the echo from the inside of the oxide layer (total back-wall echo). The instrument centers the data window on the detected total back-wall echo and then searches for the steel/oxide interface echo in the data window. An oxide echo marker indicates the detected steel/oxide interface echo.

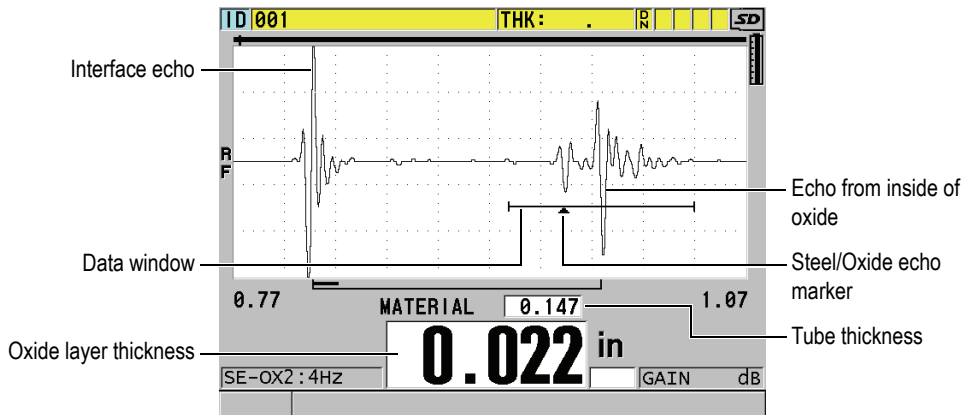


Figure 7-4 Measurement screen with the oxide layer software option

NOTE

To achieve accurate boiler tube and internal oxide scale thickness readings, remove any oxide scale or coating from the external surface of the boiler tube.

The minimum internal oxide thickness that the 38DL PLUS can measure depends on the material sound velocity but is approximately 0.010 in. (0.254 mm) with the M2017 transducer or 0.006 in. (0.152 mm) with the M2091 transducer. The 38DL PLUS only displays the thickness of the steel boiler tube when the internal oxide scale thickness is below the minimum measurement capability or when it is exfoliated (disbonded) from the inside of the boiler tube.

Figure 7-5 on page 94 shows a waveform from a sample in which the internal oxide layer is disbonded from the boiler tube. Because the oxide is disbonded, sound energy does not travel into the internal oxide layer, and only a single reflected echo from the inside of the boiler tube appears. When the internal oxide is thinner than 0.010 in. (0.25 mm), the waveform looks almost identical. The steel/oxide interface is so close in time to the echo from the inside of the oxide that it cannot be separated from the total back-wall echo and will produce a single echo.

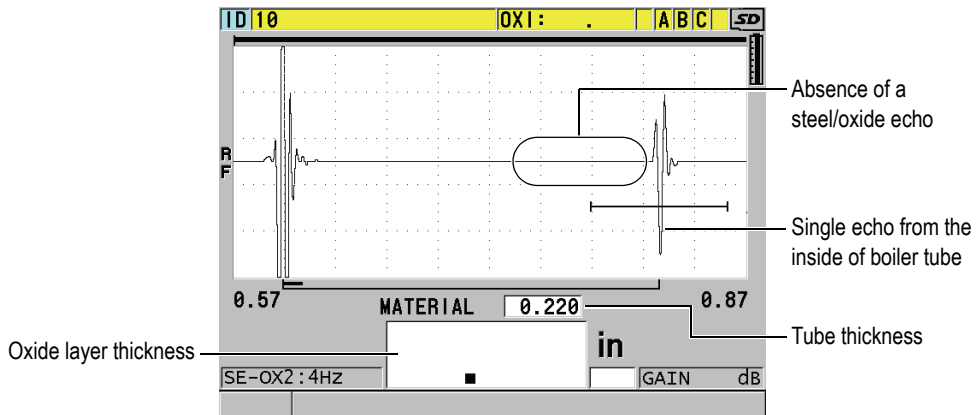


Figure 7-5 Measurement screen for a disbonded oxide layer

7.4 Multi-Measurement Software Option

The multi-measurement software option allows the 38DL PLUS to measure and display the individual thickness of up to four layers of multilayer materials. You can combine this function with the barrier layer thickness mode to measure the thickness of barrier layers in multilayer plastic containers. You can save the measured values to the internal datalogger or send them to a computer.

Multi-measurement common applications are:

- Multilayer plastic fuel tanks
- Multilayer plastic bottle preforms
- Multilayer aircraft windows
- Contact lenses: radius of curvature and thickness calculation
- Co-extruded plastic
- Two-layer hot tubs and spas

The 38DL PLUS has three different multi-measurement modes:

NORMAL

Measures and displays up to four different thickness layers or three layers and the sum of any selected layers.

SOFT CONTACT

Displays sagittal height and lens thickness, and calculates the radius of curvature of soft contact lenses. This mode is designed specifically for the measurement of soft contact lenses.

% TOTAL THK

Displays the thickness of any layer as a percentage of the total thickness. Use this mode for barrier layer measurement applications.



IMPORTANT

Before you can use the multi-measurement function with the **NORMAL** and the **% TOTAL THK** modes, you must create and save a custom setup for each thickness layer that you want to include in the multi-measurement. Refer to chapter 12 on page 209 for information about creating custom setups. All custom setups included in the multi-measurement configuration must use the same **PROBE TYPE**.

7.4.1 About the Active Measurement

With the multi-measurement, one of the displayed measurement is the active measurement. The value of the active measurement is highlighted and is repeated at the bottom of the screen. The corresponding waveform appears in the waveform display (see Figure 7-6 on page 96).

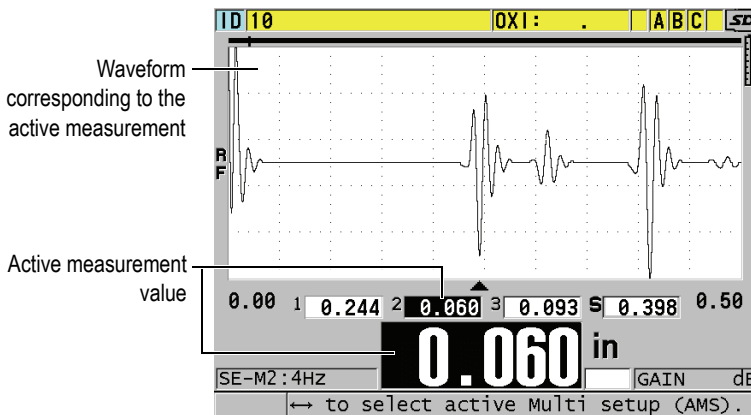


Figure 7-6 Waveform display screen

To change the active measurement

1. Enable the multi-measurement mode (see section 7.4.3 on page 99).
2. Use the arrows keys to change the active measurement.

7.4.2 Using the Multi-Measurement Normal Mode

Use the multi-measurement normal mode unless you want to show thickness values as a percentage of the total thickness or when you want to inspect soft contact lenses.

To use the multi-measurement normal mode

1. Create and store a custom setup to measure the thickness of each individual layer (see section 12 on page 209).
2. Ensure that the multi-measurement software option is activated (see section 7.1 on page 88).
3. Press [SETUP MENU].
4. In the menu, select **MULTI**.
5. In the **MULTI** screen (see Figure 7-7 on page 97):
 - a) Set **MULTI ENABLE** to **ON**.

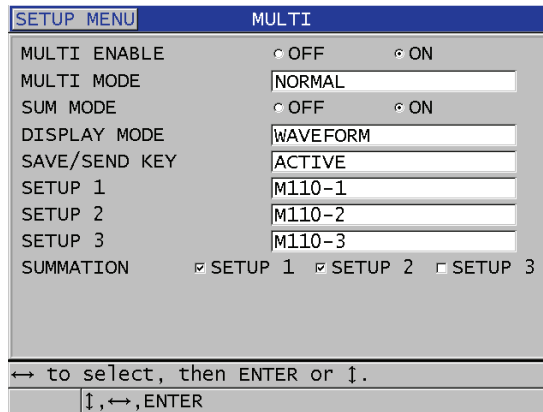


Figure 7-7 Setting multi-measurement parameters in the normal mode

- b) Set **MULTI MODE** to **NORMAL**.
- c) Set **SUM MODE** to one of the following options:
 - **ON**: Measures and displays up to three individual layer thicknesses and calculates and displays the sum of thicknesses for selected layers.
 - **OFF**: Measures and displays up to four individual layer thicknesses.
- d) Set **DISPLAY MODE** to (see Figure 7-8 on page 98):

- **WAVEFORM** to display the multiple measurements horizontally below the waveform display.
- **LARGE FONT** to display the multiple measurements vertically using large fonts.

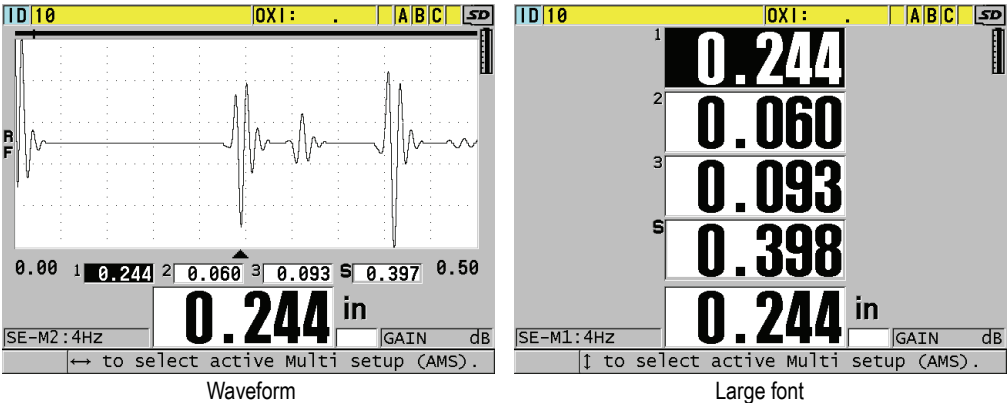


Figure 7-8 Multi-measurement display modes with three layers and the sum

- e) Set **SAVE/SEND KEY** to one of the following options to determine the operation when you press [**SAVE/SEND**]:
- **ACTIVE**: Saves only the active measurement (the highlighted thickness) to the datalogger.
 - **AUTO-INCR ACTIVE**: Saves the active measurement to the datalogger, and then changes the active setup to the next setup in the multi-measurement list. This option allows you to easily save all multilayer measurement by repeatedly pressing [**SAVE/SEND**].
- f) For **SETUP 1**, **SETUP 2**, **SETUP 3**, and **SETUP 4**, select the custom setups that you created in step 1 for each of the layers. Selecting **NONE** shows no thickness at the location.
- g) When **SUM MODE** is set to **ON**, in **SUMMATION**, select the setups for which you want to sum the thickness measurements.
- h) Press [**MEAS**] to return to the measurement screen with the multi-measurement function active in the normal mode.

7.4.3 Using the Multi-Measurement with the Soft Contact Mode

Before you can use the multi-measurement function, you must create and save custom setups for the sagittal height and the lens thickness measurement. The 38DL PLUS calculates the radius of curvature using the sagittal height value and the diameter of the pedestal that you enter.

To use the multi-measurement with the soft contact mode

1. Create and store custom setups for the sagittal height and lens thickness measurements (see chapter 12.2 on page 210).
2. Ensure that the multi-measurement software option is activated (see section 7.1 on page 88).
3. Press **[SETUP MENU]**.
4. In the menu, select **MULTI**.
5. In the **MULTI** screen (see Figure 7-9 on page 100):
 - a) Set **MULTI ENABLE** to **ON**.
 - b) Set **MULTI MODE** to **SOFT CONTACT**.
 - c) Set **DISPLAY MODE** to **WAVEFORM** or **LARGE FONT** (see Figure 7-8 on page 98).
 - d) Set **SAVE/SEND KEY** to one of the following options to determine the operation when you press **[SAVE/SEND]**:
 - **ACTIVE**: Saves only the active measurement (the highlighted thickness) to the datalogger.
 - **AUTO-INCR ACTIVE**: Saves the active measurement to the datalogger, and then changes the active setup to the next setup in the multi-measurement list. This option allows you to easily save all multilayer measurement by repeatedly pressing **[SAVE/SEND]**.
 - e) In **SGTTL HT**, select the custom setup for the sagittal height measurement.
 - f) In **LENS THK**, select the custom setup for the lens thickness measurement.
 - g) In **PDSTL DIA**, enter the diameter of the pedestal being used.
 - h) Press **[MEAS]** to return to the measurement screen with the multi-measurement function active in the soft contact mode.

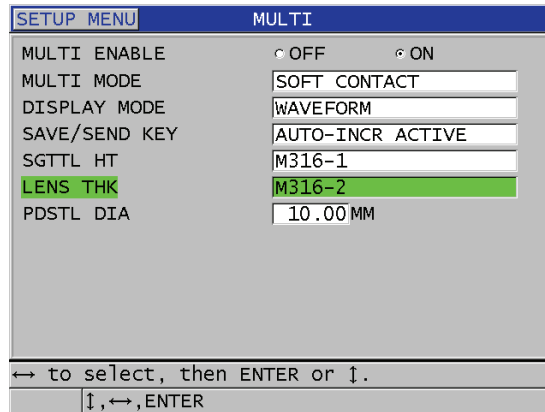


Figure 7-9 Setting multi-measurement parameters in the soft contact mode

7.4.4 Using the Multi-Measurement % Total Thickness Mode

The multi-measurement % total thickness mode is very similar to the normal mode. The difference is that it can measure the thickness of up to three layers and show the thickness of one layer as a percentage of the sum of selected layers.

To use the multi-measurement % total thickness mode

1. Follow the procedure to use the multi-measurement normal mode (see section 7.4.2 on page 97) except that you set **MULTI MODE** to **% TOTAL THICKNESS**.
2. In the **MULTI** screen (Figure 7-10 on page 101):
 - a) In **TOTAL**, select the setups for which you want to sum the thickness measurements.
 - b) In **SHOW TOTAL**, select **YES** to show the calculated total thickness on the display while the multi-measurement is active.
 - c) In **SHOW AS %**, select the setups for which you want to show the thickness measurement as a percentage of the total thickness.
 - d) Press **[MEAS]** to return to the measurement screen with the multi-measurement function active in the % total thickness mode.

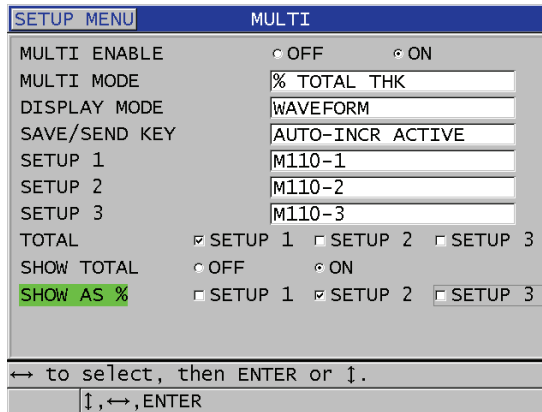


Figure 7-10 Setting multi-measurement parameters in the % total thickness mode

7.5 Encoded B-Scan Option

The 38DL PLUS standard software has the capability to save non-encoded B-scans. Non-encoded B-scans run at a fixed rate, and do not capture the distance traveled information with the scan. The Encoded B-Scan software option allows the 38DL PLUS to be connected to a linear encoder so that an encoded B-scan can be generated that captures the thickness and distance traveled in a linear B-scan. B-scans can be saved to the internal data logger, and uploaded to the GageView interface program.

The Encoded B-Scan option is designed to work with the Olympus B-Scan Encoder Buggy (part number EP4/ENC [U8780018]), but it can be connected to other linear encoders. Please contact Olympus for more information about connecting the 38DL PLUS encoded B-Scan to other encoders.

A maximum of 10,000 thickness readings with distance traveled (DT) can be saved in a single B-scan. The B-scan also captures the minimum thickness location, in addition to the associated waveform for the minimum thickness. Saved B-scans can be reviewed on the 38DL PLUS, or transferred to the GageView interface program for review. The thickness and distance traveled data can be exported to Excel. The maximum number of B-scans that can be stored in the 38DL PLUS's internal memory is approximately 47 (10,000 readings per scan).

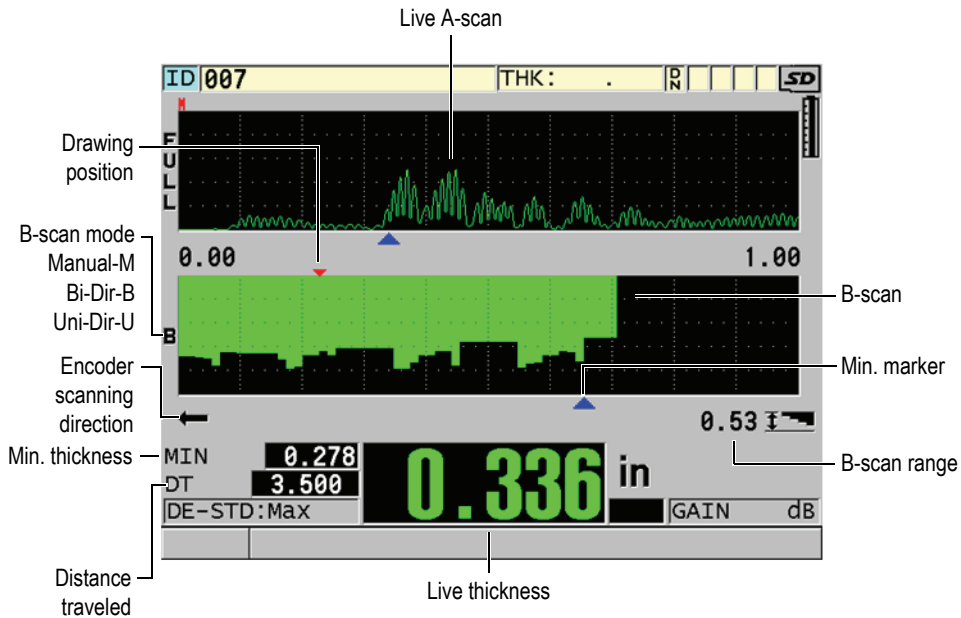


Figure 7-11 Encoded B-scan main screen

The optional B-scan feature can be activated using a software key. Please contact Olympus to purchase the encoded B-scan feature.

In order to use the encoded B-scan feature you will need the following:

1. Encoded B-Scan software code (P/N: 38DLP-EBSCAN [U8147018])
2. B-Scan Encoder Buggy (P/N: EP4/ENC [U8780018])

NOTE

The EP4/ENC is designed to work with the D790 and D790-SM dual element transducers when the bell housing is not in place.

The D790 and D790-SM are not included with the EP4/ENC.

3. D790 or D790-SM transducer. Please contact Olympus for pricing on longer cables for the D790-SM transducer.

4. Encoder cable; this cable connects the EP4/ENC B-Scan Encoder Buggy to the combination 11 pin USB/RS-232/B-scan connector located on the top of the 38DL PLUS.

Select one of the following:

- 10-foot encoder cable (P/N: 38DLP-ENC-CBL-10 [U8840168])
- 25-foot encoder cable (P/N: 38DLP-ENC-CBL-25 [U8840169])
- 50-foot encoder cable (P/N: 38DLP-ENC-CBL-50 [U8840170])
- 100-foot encoder cable (P/N: 38DLP-ENC-CBL-100 [U8840171])

The Encoded B-scan can be activated and configured from the **B-SCAN** screen (see Figure 7-12 on page 103) by pressing **[SETUP MENU]**, and then selecting **B-SCAN** in the menu. Most of the controls for the encoded B-scan are the same as those for the standard non-encoded B-scan. Please refer to section 10.3 on page 137 for more information concerning B-scan configuration.

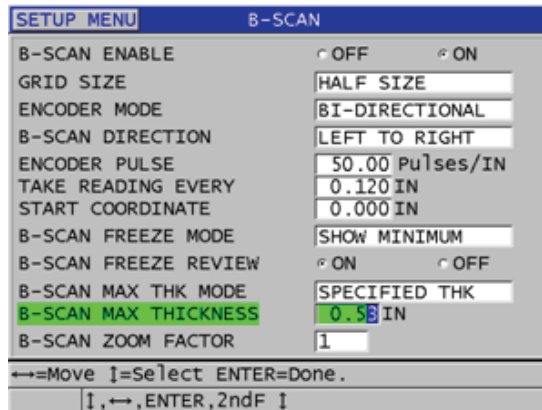


Figure 7-12 Changing B-scan parameters

Additional configuration parameters for the Encoded B-Scan option are listed below.

ENCODER MODE

MANUAL: Time based no encoder.

B-DIRECTIONAL: The B-scan moves forward or backward with the encoder.

UNI-DIRECTIONAL: The B-scan moves forward only, regardless of whether the encoder moves forward or backward.

ENCODER PULSE

The encoder pulse must be set in accordance with the encoder being used and its specifications. The Olympus EP4/ENC Encoder Buggy is always set to 50 pulses/in. or 1.97 pulses/mm.

TAKE READING EVERY

This indicates the spacing between measurements. There is fixed spacing based on the number of pulses per inch or per millimeter of the encoder.

NOTE

The smaller the spacing, the slower the maximum scan speed. Maximum scanning speed can be calculated as follows:

$$\text{Maximum scan speed} = 20 \times \text{Reading spacing}$$

Table 6 on page 104 provides sample scan-speed calculations.

Table 6 Sample scan-speed calculations^a

Spacing (in.)	Max. scan speed (in./sec)	Spacing (mm)	Max. scan rate (mm/sec)
0.040 (min. spacing)	0.80	1.016 (min. spacing)	20
0.100	2.00	1.524	30
0.200	4.00	2.032	40
0.500	10.00	12.70	254

a. Maximum reading spacing is 25 in. (595.38 mm)

Maximum B-scan distance is also dependent on the reading spacing setting. The maximum B-scan length can be calculated as follows:

$$\text{Maximum scan distance} = \text{Reading spacing} \times 10,000$$

Table 7 on page 105 provides sample maximum-distance calculations.

Table 7 Sample maximum-distance calculations

Spacing (in.)	Max. scan distance (ft.)	Spacing (mm)	Max. scan distance (m)
0.040 (min. spacing)	33.3	1.016 (min. spacing)	10.1
0.060	50	1.524	15.2
0.100	83	2.032	20.3
0.200	166.6	2.540	25.4
0.500	416.6	12.70	127.0

START COORDINATES

Used to set the starting point for the distance traveled by the scan. This is generally set to 0.00, but can be used to define the start point for multiple B-scans.

ZOOM FACTOR

Used to set the number of vertical lines on the B-scan representing a single thickness reading.

A zoom factor of 1 indicated that every vertical line in the B-scan represents a single thickness reading. Setting the zoom factor to 1 yields a very compressed B-scan image (see Figure 7-13 on page 106).

A zoom factor of 10 indicates that 10 vertical lines in the B-scan represent a thickness reading. Setting the zoom factor to 10 yields an expanded B-scan (see Figure 7-14 on page 106 and Figure 7-15 on page 107).

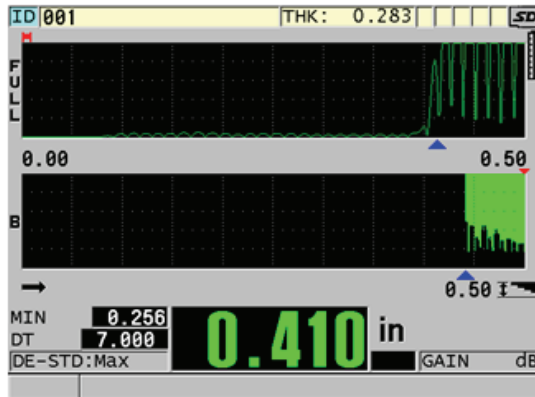


Figure 7-13 7 inch scan zoom set to 1

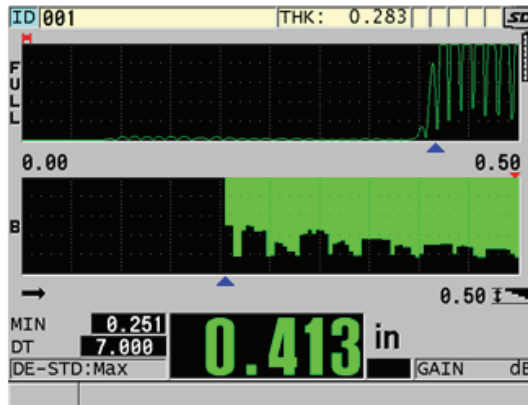


Figure 7-14 7 inch scan zoom set to 5

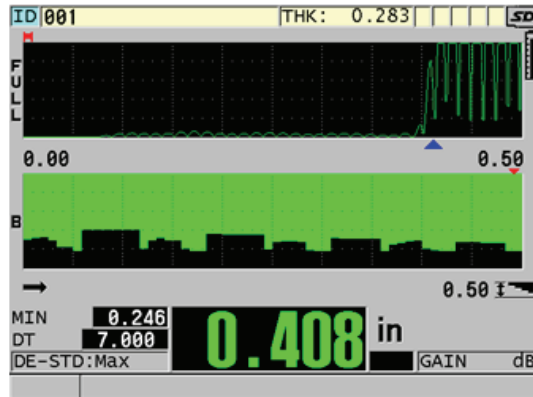


Figure 7-15 7 inch scan zoom set to 10

7.6 High Penetration Software Option

The 38DL PLUS high penetration software option coupled with low-frequency single element transducers (down to 0.5 MHz) allows you to make thickness, material sound velocity, and time of flight measurements, on materials such as composites, fiberglass, plastic, rubber, and cast metals that are difficult or impossible to measure using standard ultrasonic instruments. The M2008 [U8415001] transducer is a special low-frequency transducer used to measure the thickness of thick fiber reinforced polymer (FRP) and composite materials.

NOTE

With a M2008 transducer only, press **[2nd F]**, **[CAL ZERO]** (**Do ZERO**) at any time to auto-adjust the zero offset and compensate for temperature changes in the delay line.

To use the high penetration software option with the M2008 transducer

1. Ensure that the high penetration software option is activated (see section 7.1 on page 88 for details).
2. Connect the M2008 transducer to the T/R 1 and T/R 2 connectors at the top of the 38DL PLUS.

3. Press [**XDCR RECALL**].
4. In the menu, select **DEFAULT HP SINGLE ELEMENT**.
5. In the **DEFAULT HP SINGLE ELEMENT** screen, highlight the default transducer setup for the M2008 (**DEFP1-0.5-M2008**) or any custom setup that uses the M2008 transducer.
6. Press [**MEAS**] to return to the measurement screen with the recalled transducer setup.
7. Wipe couplant off the transducer tip.
8. Press [**2nd F**], [**CAL ZERO**] (**Do ZERO**).
9. Perform the material sound velocity and zero calibration (see section 5.2.1 on page 61).

8. Using Special Functions

This chapter describes how to use special 38DL PLUS functions and modes. The 38DL PLUS has many thickness measurement features. Although the features outlined in this section are not required for basic thickness operation, they can make the gage a more versatile instrument.

Topics are as follows:

- Activating and Configuring a Differential Mode (see section 8.1 on page 109)
- Using the Minimum, Maximum, or Min/Max Thickness Mode (see section 8.2 on page 112)
- Preventing False Minimum/Maximum Thickness Readings (see section 8.3 on page 113)
- Using Alarms (see section 8.4 on page 114)
- Locking the Instrument (see section 8.5 on page 119)
- Freezing Waveforms (see section 8.6 on page 121)

8.1 Activating and Configuring a Differential Mode

The 38DL PLUS includes differential modes to easily compare the actual measurement with a reference value that you enter. The actual thickness measurement appears on the thickness display and the differential value appears in the differential display area (see Figure 8-1 on page 110).

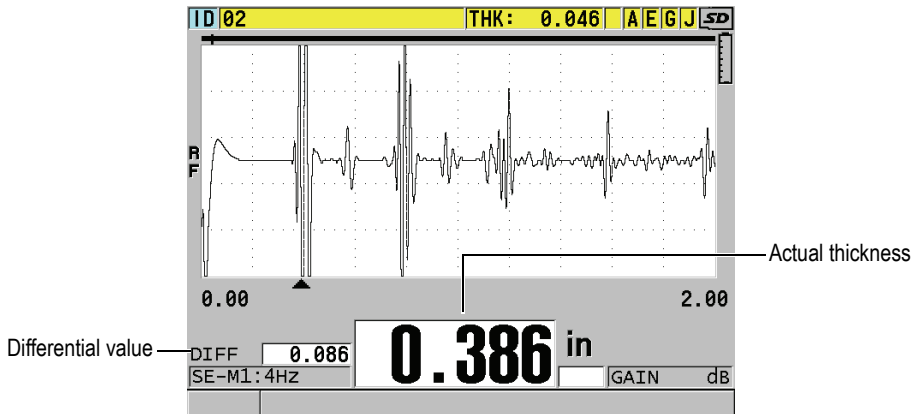


Figure 8-1 Normal differential mode

The units and resolution of the differential thickness are the same as those selected for the thickness measurement.

When you press [SAVE/SEND] while in **NORMAL** or **% RATIO** differential modes, the 38DL PLUS saves the actual thickness value along with the “D” flag, indicating that the **Differential** mode is active.

To activate and configure a differential mode

1. While in the measurement screen, press [SETUP MENU].
2. In the menu, select **DIFF**.
3. In the **DIFF** screen (see Figure 8-2 on page 111):
 - a) Set **DIFF ENABLE** to **ON** to activate the differential function.
 - b) In **DIFF MODE**, select one of the three differential modes:
 - **NORMAL**: Shows the actual thickness along with the difference between the actual thickness measurement and the **REF VALUE** that you entered.

$$\text{Differential}_{\text{Normal}} = \text{Current thickness} - \text{Reference value}$$

- **% RATIO**: Shows the actual thickness along with the percent difference from the **REF VALUE** that you entered.

$$\text{Differential \% Ratio} = \frac{\text{Current thickness} - \text{Reference value}}{\text{Reference value}} \times 100$$

- **REDUCTION RT:** Shows the actual thickness as well as the percent difference between the actual thickness and the former value. The former value is the thickness of the metal prior to the bending process. Use this mode for metal bending or other application in which you need to track the percentage of wall thinning.
- c) When **DIFF MODE** is set to **NORMAL** or **% RATIO**, in **REF VALUE**, enter the reference value.

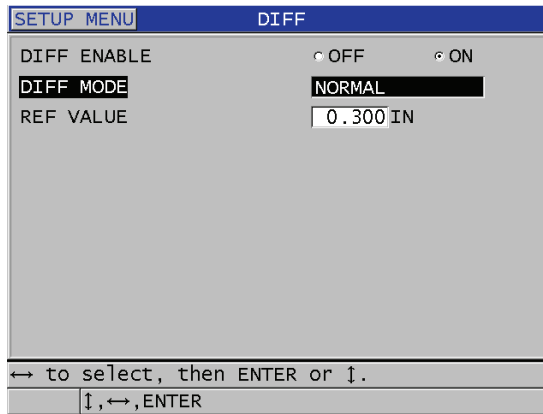


Figure 8-2 The DIFF screen

When **DIFF MODE** is set to **REDUCTION RT** only:

- d) In **FORMER THICKNESS**, enter the original thickness value, as measured before bending the metal.
 - e) In **LARGE FONT**, select which measurement appears at the bottom of the measurement screen with the large font (**THICKNESS** or **REDUCTION RT**).
4. Press **[MEAS]** to return to the measurement screen with the displayed differential value.

8.2 Using the Minimum, Maximum, or Min/Max Thickness Mode

You can activate the minimum, maximum, or min/max thickness mode to also display retained minimum and/or maximum thickness values. The **MIN** and/or **MAX** values appear on the left side of the main thickness reading (see Figure 8-3 on page 112). The minimum or maximum thickness value replaces the main thickness display when the transducer is uncoupled or when a loss-of-signal (LOS) occurs. The replacing value appears with outlined digits.

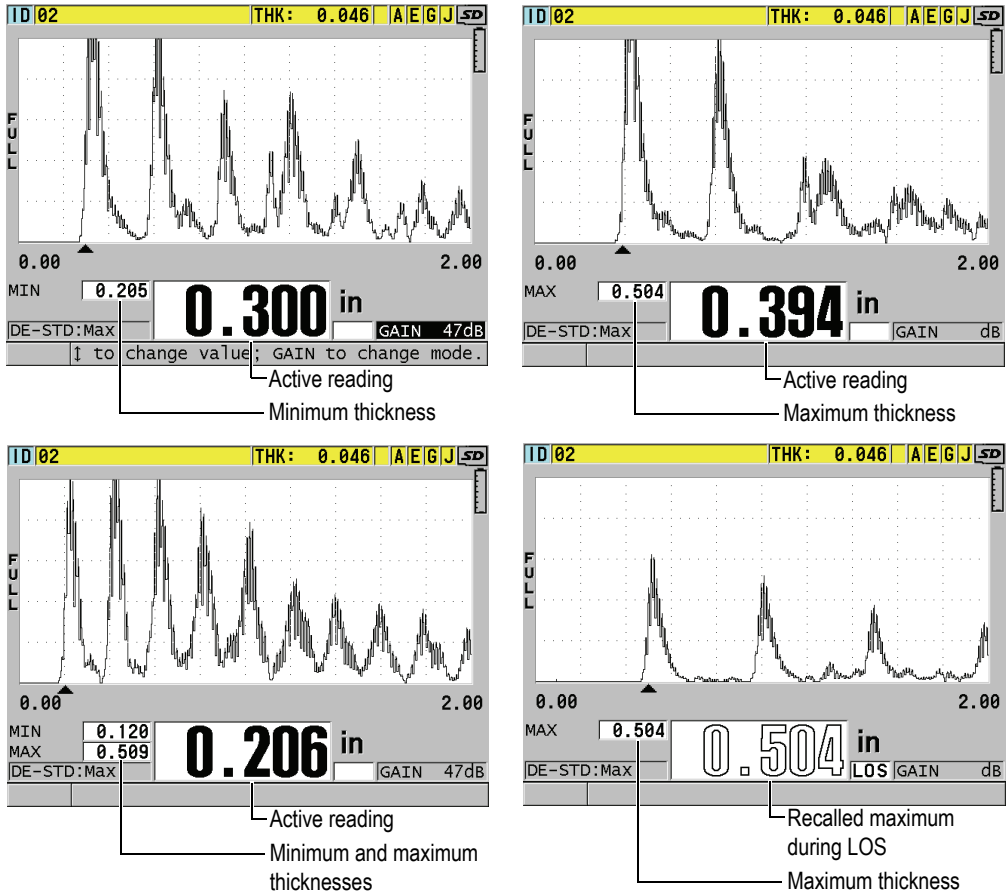


Figure 8-3 Displaying the minimum and/or maximum thickness

NOTE

The fastest display update rate is automatically activated when entering the minimum or maximum thickness mode. When leaving the mode, the display update rate is restored to its previous state.

The minimum and maximum thickness modes respectively display the smallest and largest thickness measured value from the time you activate the minimum mode or from the time you reset it. The modes are useful when it is important to determine the thinnest/thickest reading obtained while making a series of readings on a test piece.

To activate the minimum, maximum, or min/max mode

1. From the measurement screen, press **[SETUP MENU]**.
2. In the menu, select **MEAS**.
3. In the **MEAS** screen, set **MIN/MAX** to the desired mode (**OFF**, **MIN**, **MAX**, or **BOTH**).
4. Press **[MEAS]** to return to the measurement screen.
5. In the measurement screen, press **[MEAS]** again to reset the held minimum, maximum, or min/max values.
The thickness display will blank indicating that the old **MIN/MAX** value is reset. Saving or sending a **MIN/MAX** reading also resets the value.

8.3 Preventing False Minimum/Maximum Thickness Readings

A false minimum or maximum reading can occur when you lift the transducer from the test piece. This is due to excess couplant, particularly on smooth surfaces, which causes the instrument to read the thickness of a couplant drop when you lift the transducer.

To prevent false minimum/maximum thickness readings

1. Activate the minimum or maximum thickness mode (see section 8.2 on page 112).
2. Before uncoupling the transducer, press **[FREEZE]** to freeze the waveform.
3. Once the transducer is uncoupled, press **[FREEZE]** again to unfreeze the display and recall the minimum thickness and waveform.

8.4 Using Alarms

You can activate one of the 38DL PLUS alarm modes to help you identify when the actual thickness measurement is above or below editable reference values.

When an alarm condition occurs, the 38DL PLUS warns you as follows:

- The **HIGH** or **LOW** alarm indicator flashes with a red background at the bottom right corner of the measurement screen (see Figure 8-4 on page 114).
- The thickness value appears in red.
- When the beeper is active (see section 4.1 on page 43), the 38DL PLUS emits a long beep.

NOTE

The thickness value and alarm indicator appear in color only when the indoor color scheme is active (see section 4.4.1 on page 46 to change the color scheme).

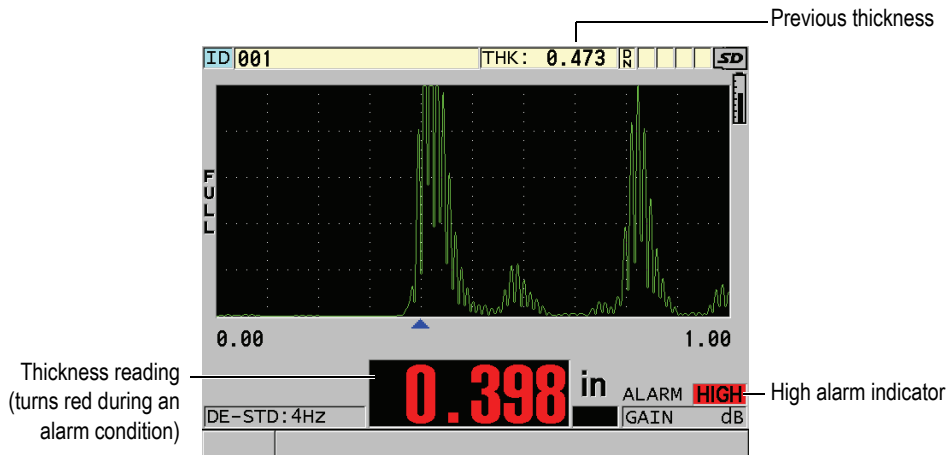


Figure 8-4 Example of a HIGH alarm indicator

The datalogger records an alarm condition in the second status box for all stored measurements. An **A** indicates the alarm mode, an **L** indicates a low alarm condition, and an **H** indicates a high alarm condition.

There are four different alarm modes (**STANDARD**, **PREVIOUS THK**, **B-SCAN**, and **REDUCTION RT**):

STANDARD

The standard alarm warns you when the actual measured thickness is below a low reference value or above a high reference value. The reference values are thickness set points using the current instrument units and resolution.

PREVIOUS THK

To use this function, you must first open a previously stored inspection file. The alarm uses the previous thickness value as its reference when determining if the actual thickness is in a high or low alarm condition. The previous thickness alarm warns you when the actual measured thickness is outside the alarm reference values when compared to the previous thickness value at each ID location within the file.

You can choose the **ABSOLUTE DIFF** (differential) mode to set the following parameters:

- When the thickness differential is smaller than or equal to the **ABSOLUTE LOSS** value, a low alarm is indicated.
- When the thickness differential is greater than the **ABSOLUTE GROWTH** value, a high alarm is indicated.

Table 8 on page 115 shows the result for an example where both **ABSOLUTE LOSS** and **ABSOLUTE GROWTH** are set to **0.05 in.**

Table 8 Alarm calculation example with the ABSOLUTE DIFF mode

Previous Values	Actual Thickness	Low Alarm	High Alarm	Calculations
0.300 in.	0.239 in.	Yes	No	$0.300 - 0.239 > 0.050$ in.
0.300 in.	0.316 in.	No	Yes	$0.316 - 0.300 > 0.005$ in.
0.300 in.	0.285 in.	No	No	$0.300 - 0.285 < 0.050$ in.
0.300 in.	0.302 in.	No	No	$0.302 - 0.300 < 0.005$ in.

You can also choose the **% DIFF** (differential) mode to set the following parameters:

- When the thickness differential is smaller than or equal to the **% LOSS** value, a low alarm is indicated.
- When the thickness differential is greater than the **% GROWTH** value, a high alarm is indicated.

Table 9 on page 116 shows the result for an example where both % LOSS is set to 20 % and % GROWTH is set to 5 %.

Table 9 Alarm calculation example with the % DIFF mode

Previous Values	Actual Thickness	Low Alarm	High Alarm	Calculations
0.300 in.	0.239 in.	Yes	No	$\frac{0,300 - 0,239}{0,300} \times 100 > 20\%$
0.300 in.	0.316 in.	No	Yes	$\frac{0,316 - 0,300}{0,300} \times 100 > 5\%$
0.300 in.	0.285 in.	No	No	$\frac{0,300 - 0,285}{0,300} \times 100 < 20\%$
0.300 in.	0.302 in.	No	No	$\frac{0,302 - (0,300)}{0,300} \times 100 < 5\%$

B-SCAN

The B-scan alarm mode is similar to the standard alarm mode except that in the B-scan alarm mode, lines are shown in the B-scan grid when the reference values fall within the B-scan thickness range (see Figure 8-5 on page 116). In addition, the alarms are operational as you review B-scan thicknesses in B-scan freeze review mode.

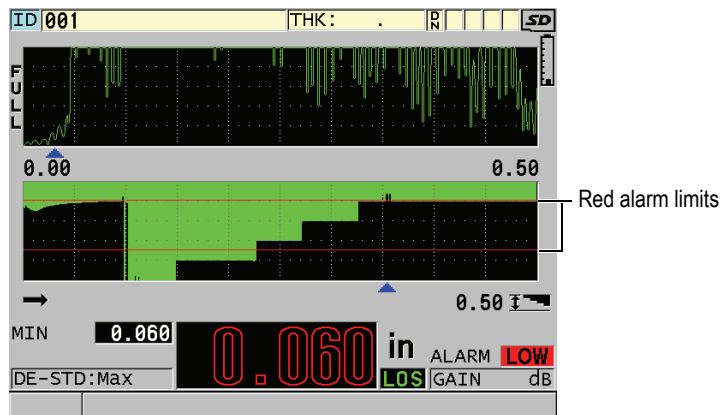


Figure 8-5 Example of a B-scan alarm mode

NOTE

The thickness value and the alarm indicator appear in color only when the indoor color scheme is active (see section 4.4.1 on page 46 to change the color scheme).

REDUCTION RT

The **REDUCTION RT** option appears only when the active file is configured with **FILE DATA MODE** set to **REDUCTION RT**. You set the reduction percentage for a low (**YELLOW ALARM**) and high (**RED ALARM**) limits, and the instrument displays (see Figure 8-6 on page 117):

- The **RED** indicator for reduction rates that are greater than or equal to the **RED ALARM** value.
- The **YEL** indicator for reduction rates that are between the **YELLOW ALARM** and the **RED ALARM** values.
- The **GRN** indicator for reduction rates that are below the **YELLOW ALARM** value.

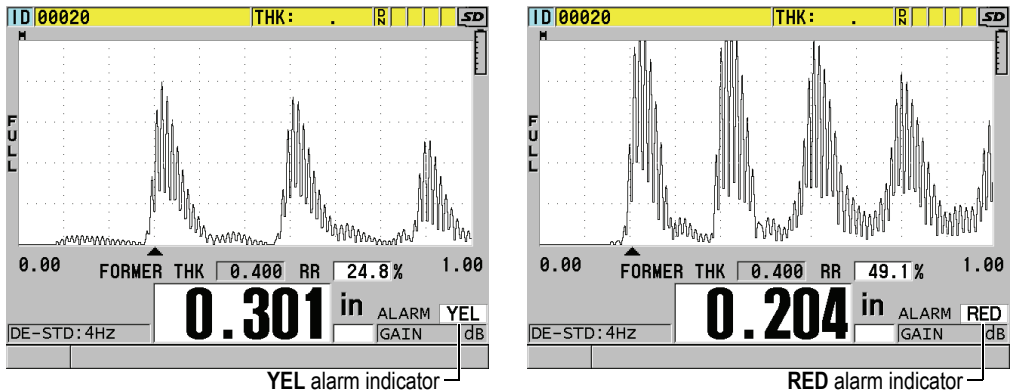


Figure 8-6 YEL (yellow) and RED alarm indicators

To set the alarm

1. From the measurement screen, press [SETUP MENU].
2. In the menu, select **ALARM**.

3. In the **ALARM** screen (see Figure 8-7 on page 118):
 - a) Set **ALARM ENABLE** to **ON** to activate the alarm function.
 - b) In **ALARM MODE**, select the desired alarm mode (**STANDARD**, **PREVIOUS THK** [previous thickness], **B-SCAN**, or **REDUCTION RT** [reduction rate]).
The other parameters vary depending on the alarm mode selection.

NOTE

The **B-SCAN** option appears only when the B-scan mode is active (see section 10.3.1 on page 142).

The **REDUCTION RT** option appears only when the active file is configured with the **FILE DATA MODE** parameter set to **REDUCTION RT** (see section 11.2.2 on page 180).

SETUP MENU	ALARM
ALARM ENABLE	<input checked="" type="radio"/> OFF <input type="radio"/> ON
ALARM MODE	STANDARD
LOW ALARM	0.000 IN
HIGH ALARM	25.000 IN
↔ to select, then ENTER or ↓.	
↓, ↔, ENTER	

Figure 8-7 Setting up the STANDARD alarm

4. When **ALARM MODE** is set to **STANDARD** or **B-SCAN**, set the **LOW ALARM** and the **HIGH ALARM** values.

OR

When **ALARM MODE** is set to **PREVIOUS THK**:

- a) With **PREVIOUS THK MODE** set to **ABSOLUTE DIFF** [absolute differential], set the **ABSOLUTE LOSS** and the **ABSOLUTE GROWTH** values.

- b) With **PREVIOUS THK MODE** set to **% DIFF** [percent differential], set the **% LOSS** and the **% GROWTH** values.

OR

When **ALARM MODE** is set to **REDUCTION RT**, set the **YELLOW ALARM** and the **RED ALARM** values.

5. Press **[MEAS]** to return to the measurement screen.

NOTE

Alarm reference values that were entered in one unit system are displayed as the equivalent value when the alternate units are selected.

8.5 Locking the Instrument

The 38DL PLUS offers an instrument lock allowing a supervisor to restrict access to selected functions. The supervisor can also enter a password to prevent other users from unlocking the functions. Once a password has been set, you must reenter the password before you can lock or unlock any function.

You can lock the following functions:

- Calibration with **[CAL VEL]** and **[CAL ZERO]** (**[2nd F]**, **[CAL ZERO]** (**Do ZERO**) still available)
- Setup menus accessed with **[SETUP MENU]** and **[SP MENU]**
- Transducer setup recall with **[XDCR RECALL]**
- Datalogger operations (except **[SAVE/SEND]**)
- Gain adjustment with **[GAIN]**
- Waveform adjustment with **[WAVE ADJ]**

Locking the calibration prevents changes to calibration values so that no parameters can affect the value of the measurement; these include material velocity and test block zero calibration. However, you can still view these values, use the measurement screen, and use the datalogger functions.

Anytime a user attempts to use a locked function, a message appears in the help bar to indicate that the function is locked (see Figure 8-8 on page 120).



Figure 8-8 Example of a locked function message in the help bar

To set the password

1. From the measurement screen, press **[SETUP MENU]**.
2. In the menu, select **PASSWORD SET**.
3. In the **PASSWORD SET** screen, in **INSTRUMENT PASSWORD**, enter your password using up to eight alphanumeric characters.



IMPORTANT

If you forget the password, you can unlock the instrument and deactivate the password by entering the master password "OLY38DLP".

When you want to change the password, you must first use the master password to deactivate the password, and then set a new password.

-
4. Select **SET** to set the password and return to the measurement screen.

To lock and unlock instrument functions

1. From the measurement screen, press **[SETUP MENU]**.
2. In the menu, select **INSTRUMENT LOCK**.
3. In the **INSTRUMENT LOCK** screen (see Figure 8-9 on page 121):
 - a) If a password was set, enter the password in **PASSWORD**.
 - b) Set the functions you want to lock to **ON** and the ones you want to unlock to **OFF**.
 - c) Select **SET** to activate the instrument lock and return to the measurement screen.

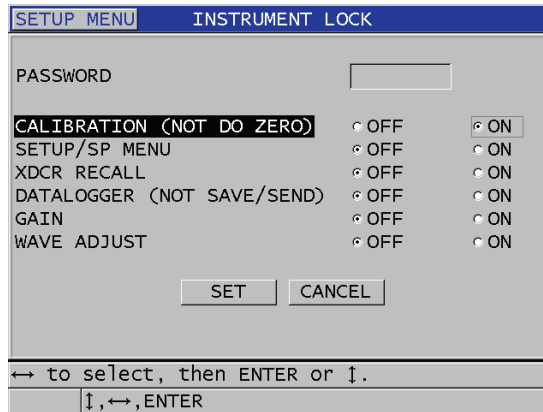


Figure 8-9 The INSTRUMENT LOCK screen

8.6 Freezing Waveforms

Pressing **[FREEZE]** stops updating the displayed waveform and keeps the waveform and thickness on the display even if you move or uncouple the transducer. The freeze indicator (**F**) appears on the right side of the waveform display when the freeze function is active.

The freeze function is convenient to easily set the gain parameters, review a B-scan, or perform a high temperature measurement, without having to maintain the transducer coupled to the test piece.

You may also want to use the freeze function to pause measurements before uncoupling the transducer from the test piece, to prevent recording wrong minimum or maximum values.

To freeze the waveform and thickness display

1. Press **[FREEZE]** while making a measurement.
2. Press **[FREEZE]** again to unfreeze the waveform and thickness display.

NOTE

Pressing [MEAS] or [SAVE/SEND] also unfreezes the display.

9. Configuring the Instrument

This chapter describes how to configure various instrument parameters.

Topics are as follows:

- Configuring Measurement Parameters (see section 9.1 on page 123)
- Configuring System Parameters (see section 9.2 on page 126)
- Configuring Communications (see section 9.3 on page 127)

9.1 Configuring Measurement Parameters

The **MEAS** setup is the most commonly used setup menu screen where you access global parameters concerning the instrument measurement features.

To configure measurement parameters

1. From the measurement screen, press **[SETUP MENU]**.
2. In the menu, select **MEAS**.
The **MEAS** screen appears. The last parameters differ depending if a single or dual element transducer is connected (see Figure 9-1 on page 124).

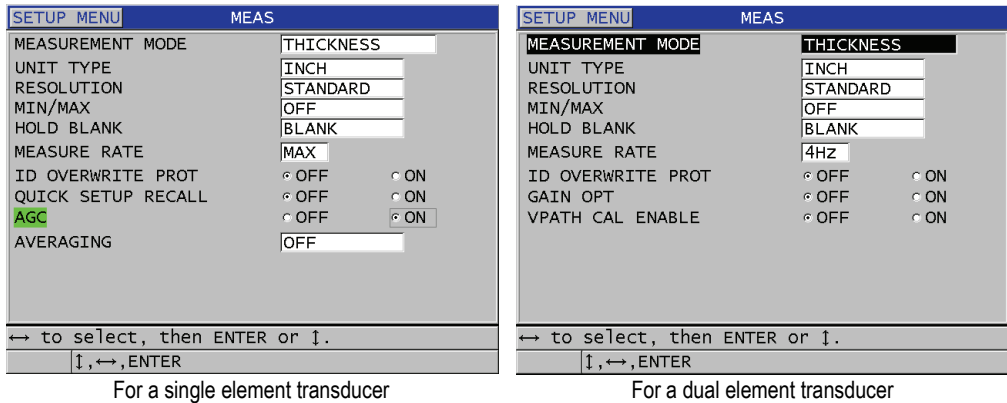


Figure 9-1 The MEAS screen

- In **MEASUREMENT MODE**, select what the instrument measures and displays among the following options:
 - **THICKNESS**: the thickness of the inspected part
 - **VELOCIMETER**: the sound velocity in the material of the inspected part
 - **TIME OF FLIGHT**: the round trip time-of-flight (TOF) of the sound in the inspected part
- In **UNIT TYPE**, select between the **INCH** (English) or **MILLIMETER** (metric) units.
Time-of-flight measurements are always expressed in microseconds.
- In **RESOLUTION**, select between **STANDARD**, **LOW**, or **HIGH** (see section 4.7 on page 54 for details).
- In **MIN/MAX**, select to activate either the **MIN** (minimum), **MAX** (maximum), or **BOTH** modes (see section 8.2 on page 112 for details).
- In **HOLD BLANK**, configure the instrument to either continue to show (**HOLD**) or not hold (**BLANK**) the last measured thickness and waveform while a loss-of-signal (LOS) occurs.

NOTE

The **MIN/MAX** and **HOLD BLANK** functions are mutually exclusive. You must set **MIN/MAX** to **OFF** to be able to change the **HOLD BLANK** function. Similarly, you must set **HOLD BLANK** to **BLANK** to be able to change the **MIN/MAX** function.

8. In **MEASURE RATE**, adjust the measurement update rate (see section 4.6 on page 54 for details).
 9. Set **ID OVERWRITE PROT** to **ON** if you want to see a confirmation message in the help bar when attempting to save a measurement reading in an ID that already contains a value (see section 11.5 on page 194 for details).
 10. For single element transducers only, set **QUICK SETUP RECALL** to **ON** to activate the quick recall of the first four custom setups using the combination of **[2nd F]** and the arrow keys (see section 13.10 on page 238 for details).
 11. For single element transducers only, set **AGC** to **ON** to set the automatic gain control (AGC) function to automatically bring all measured back-wall echoes to the same amplitude.
-

TIP

The **AGC** function works well for most standard thickness gage applications and is by default turned on. In some thickness applications, the receiver gain is set at or near its maximum value. In such cases, turn off the AGC function to prevent reading instability.

12. For single element transducers only, set **AVERAGING** to **OFF** to turn thickness averaging off, set **AVERAGING** to **ON** to perform a running average of the last 5 thickness readings, or set **AVERAGING** to **On-QBar** to display a quality measurement Q-bar below the measurement screen indicating the stability of the averaged reading.
 13. For dual element transducers only, set **GAIN OPT** to **ON** to activate the gain optimization during the zero and material velocity calibrations (see section 5.2.4 on page 65 for details).
 14. For dual element transducers only, set **VPATH CAL ENABLE** to **ON** to activate the V-Path calibration option when you press **[CAL VEL]** (see section 12.4.2 on page 214 for details).
 15. Press **[MEAS]** to return to the measurement screen.
-

9.2 Configuring System Parameters

The **SYSTEM** screen, allows you to configure many 38DL PLUS system parameters.

To configure system parameters

1. From the measurement screen, press **[SETUP MENU]**.
2. In the menu, select **SYSTEM**.
The **SYSTEM** screen appears (see Figure 9-2 on page 126).

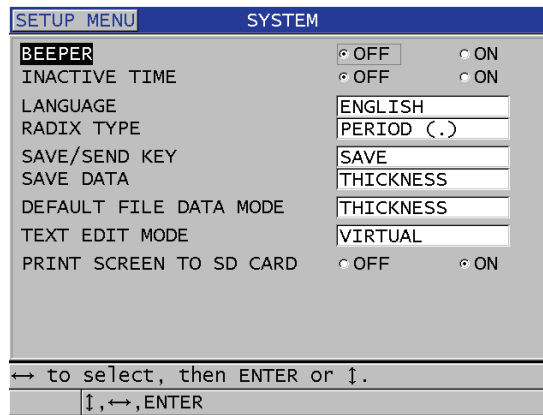


Figure 9-2 The **SYSTEM** screen

3. Set **BEEPER** to **ON** or **OFF** (see section 4.1 on page 43 for details).
4. Set **INACTIVE TIME** to **ON** or **OFF** (see section 4.1 on page 43 for details).
5. In **LANGUAGE**, select the desired user interface language (see section 4.1 on page 43 for details).
6. Set **RADIX TYPE** to the desired character (period or comma) to separate the integer and the decimal numbers.
7. Set **SAVE/SEND KEY** to configure what happens to the actual data (as set in **SAVE DATA**) when you press **[SAVE/SEND]**. The options are:
 - **SAVE**: saves the actual data to the internal datalogger.
 - **SEND**: sends the actual data to the RS-232 port (see section 14.3 on page 243 for details on RS-232 data communication).

NOTE

The **SAVE/SEND KEY** parameter also affects the save/send operation triggered using the optional foot switch. The 38DL PLUS cannot send a single thickness value through the USB communication port.

8. Set **SAVE DATA** to save only the thickness measurement (**THICKNESS**) or both the thickness and the waveform (**THK+WF**).
-

NOTE

The calibration and setup parameters are also always saved/sent along with the thickness measurement.

9. Set **DEFAULT FILE DATA MODE** to the desired default file data mode when you create a file (see section 11.2.2 on page 180 for details).
10. Set **TEXT EDIT MODE** to choose how to enter alphanumeric values using either the virtual keyboard (**VIRTUAL**) or the legacy character wheel selection (**TRADITIONAL**) [see section 3.4 on page 38 for details].
11. Set **PRINT SCREEN TO SD CARD** to **ON** to enable the 38DL PLUS to create a BMP image file on the external microSD card for the actual screen shot, when you press [**2nd F**], [**DISPLAY**] (see section 14.5.2 on page 255 for details).
12. Press [**MEAS**] to return to the measurement screen.

9.3 Configuring Communications

The 38DL PLUS features a RS-232 and a USB port allowing you to connect the instrument to a computer, a printer, or optional accessories such as a bar code reader or a caliper. When connected to a computer, the 38DL PLUS can send and receive data, or can be remotely controlled by the computer.

The instrument is set to use USB communication by default. You can select which type of communication you wish to use along with other communication parameters.

To configure the communication parameters

1. From the measurement screen, press [**SETUP MENU**].
-

2. In the menu, select **COMM**.
3. In the **COMM** screen (see Figure 9-3 on page 128):

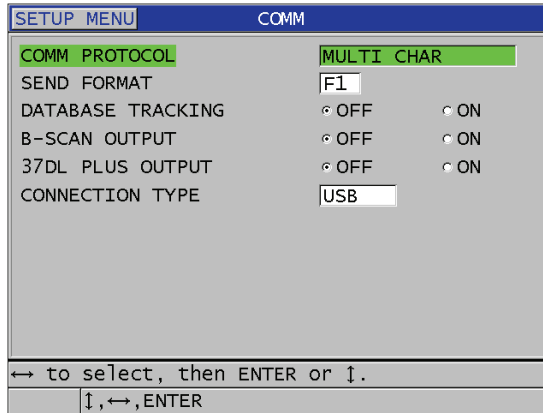


Figure 9-3 Changing the communication parameters

- a) In **COMM PROTOCOL**, select which remote command set the instrument uses for communication:
 - **MULTI CHAR**: Multi character commands used for communication with a computer running the GageView interface program.
 - **SINGLE CHAR**: Single character command normally used when an external program is controlling the instrument by remotely sending commands to mimic keystroke.
- b) In **OUTPUT FORMAT**, select the format of the data being output (**F1, F2, F3,...F10**). Refer to Table 24 on page 256 and Table 25 on page 257 for the description of available output formats.

NOTE

Contact Olympus for more information on the following communication parameters:

- Multi and single character remote commands.
- Send formats (F1, F2, F3, F4, F5, F6, F7, F8, F9, and F10).

- c) Set **DATABASE TRACKING** to **ON** to allow the instrument to track the measurement parameters (calibration settings, transducer type, gain etc.) that were used in a previous inspection. In order for this feature to be implemented, you must load the previous inspected file to the 38DL PLUS and overwrite the old readings with the new inspection data. When database tracking is selected, the following measurement related parameters are automatically adjusted to match those stored at the current ID number:

- Alarm mode (on/off)
- Alarm set points
- Differential mode (on/off)
- Differential reference value
- Min/max mode (min/max/off)
- Extended blank value
- Resolution
- Units
- Gain
- Velocity
- Transducer type (user prompt only)

When database tracking is selected and a waveform is stored at the current ID number, the following additional waveform related parameters are automatically adjusted to match those stored with that waveform:

- Range
- Zoom (on/off)
- Extended blank position
- Rectification mode (full wave, half wave negative, half wave positive, RF)

If the database does not have any data stored at the current ID number, then the setup remains unchanged.

NOTE

Even if database tracking is activated, you can override the settings for the current ID number by manually changing any setup parameter.

- d) Set **B-SCAN OUTPUT** to **ON** to output the B-scan data when communicating with the GageView interface program. Set it to **OFF** when communicating

with other interface programs that do not support the B-scan data. This parameter only applies to files that have stored B-scan images.

- e) Set **37DL PLUS OUTPUT** to **ON** to have the 38DL PLUS send data in the same format as the 37DL PLUS to communicate with external software programs that were written for the 37DL PLUS.
- f) In **CONNECTION TYPE**, choose which communication format the instrument uses:
 - **USB**: Universal serial bus used to communicate with a computer running the GageView interface program (default) [see section 14.2 on page 242].
 - **RS-232**: Used for communication with serial port printers, digital calipers, bar code readers, and other RS-232 communication devices.

The following parameters only appear when **CONNECTION TYPE** is set to **RS-232** (see section 14.3 on page 243):

- g) In **RS-232 DEVICE**, select what type of device the 38DL PLUS communicates with:
 - **PRINTER**: for communicating with serial port printers.
 - **TERMINAL**: for communicating with computers.
 - **BAR CODE**: to receive ID number information from the optional bar code reader.
 - **CALIPER**: to receive reference thickness data from the optional digital caliper.
 - **FISHER**: to receive data from a Fisher coating instrument.
- h) In **BAUD RATE**, set the RS-232 data transfer rate to match that of the device with which the 38DL PLUS communicates.
- i) In **CONTINUOUS OUTPUT**, select the rate at which the 38DL PLUS sends measurement data through the RS-232 communication port:
 - **OFF**: No continuous output.
 - **ON**: The output rate is controlled by the **MEASURE RATE** setting in the **MEAS** setup menu (see section 4.6 on page 54).
 - **5 SEC AVERAGE**: Outputs one averaged thickness reading every 5 seconds.
 - **10 SEC AVERAGE**: Outputs one averaged thickness reading every 10 seconds.

NOTE

The other RS-232 parameters are fixed (Word length = 8, Stop bits = 1, Parity = None).

4. Press **[MEAS]** to return to the measurement screen.

10. Using Advanced Gaging Features

The 38DL PLUS has many advanced thickness measurement features that assist in making the gage a more versatile instrument. This chapter describes how to use these advanced features.

Topics are as follows:

- Adjusting the Gain with Dual Element and E110 EMAT Transducers (see section 10.1 on page 133)
- Adjusting the Extended Blank with Dual Element Transducers (see section 10.2 on page 135)
- About the B-Scan (see section 10.3 on page 137)
- About the DB Grid (see section 10.4 on page 145)
- Configuring AVG/MIN Measurements (see section 10.5 on page 151)
- Making AVG/MIN Measurements (see section 10.6 on page 152)
- Using Temperature Compensation (see section 10.7 on page 154)

10.1 Adjusting the Gain with Dual Element and E110 EMAT Transducers

By default, the 38DL PLUS automatically sets the gain to an optimum value to obtain the most accurate measurement. This works well for most corrosion measurement applications.

In special circumstances, you may need to manually adjust the gain to get a correct thickness measurement. For example, in high temperature measurements, increasing the gain is generally recommended.

NOTE

Olympus recommends to manually adjust the gain only when you are an experienced operator who can analyze and understand the waveform display.

With D79X series dual element and E110 EMAT transducers, you can manually adjust the gain by pressing [GAIN]. The gain value, expressed in decibels (dB), appears near the lower-right corner of the display (see Figure 10-1 on page 134).

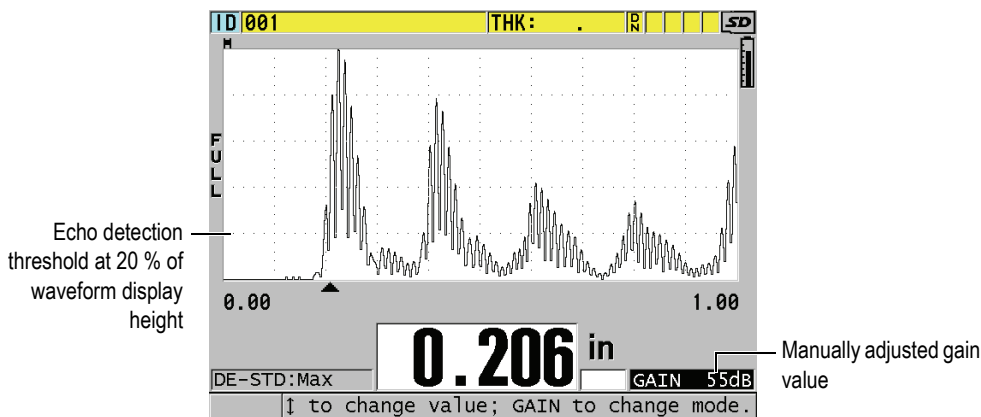


Figure 10-1 Manually adjusting the gain

When activated, the manual gain adjustment also modifies the way in which echoes are shown on the waveform display. With the default automatic gain, the measured echo peak is visible on the display so that you can readily observe the measured echo position, independently of its strength or of the gain. When you manually adjust the gain, the displayed echo height changes to be proportional to the actual echo amplitude at the receiver output, allowing you to readily observe gain changes.

The peak detection threshold for thickness calculation is at 20 % of the waveform display height, the first graticule line above the baseline in Figure 10-1 on page 134. The peak amplitude of measured echoes must be at or above the threshold to be processed for thickness calculation.

To view, restore, or change the gain value

1. Press [GAIN] to view the current automatic gain value.
The gain value appears near the lower-right corner of the display. The waveform display changes to the amplitude proportional to gain mode.
2. Press [▲] or [▼] to adjust the gain in steps of ± 1 dB.
The gain value and the height of the echoes change accordingly.
 - Increase the gain value when the peak amplitude of the echo that should be detected is below 20 % of the waveform display height.
This prevents the gage from reading a too high value when skipping one back-wall echo, measuring twice the correct thickness (doubling).
 - Reduce the gain value when noise peaks are above 20 % of the waveform display height.
This prevents the gage from detecting a noise peak rather than the correct back-wall echo.
3. Press [GAIN] again to restore the last previously set gain.
4. Press [GAIN] again to return to the automatically adjusted echo height mode.
The default automatic gain mode is indicated by a blank **Gain** field.

10.2 Adjusting the Extended Blank with Dual Element Transducers



CAUTION

Olympus recommends using the extended blank parameter only when you are an experienced operator who thoroughly understands the acoustic properties of the material being measured. Incorrect use of the extended blank can cause the gage to misread areas of thin material.

Normally, the 38DL PLUS searches for echoes down to nearly zero thickness. However, some special circumstances such as a high degree of near surface corrosion, aluminum material, enclosed flaws, or laminations can generate echoes that the instrument may falsely detect as the low thickness. When these echoes are larger than the sought after back-wall echo, the manual gain adjustment (see section 10.1 on page 133) cannot prevent this false detection. However, the extended blank parameter allows you to define an early period in which the 38DL PLUS will not perform echo detection, and therefore, prevent erroneous measurements.

To use the extended blank

1. Press **[WAVE ADJ]**.
The waveform adjustment parameter and its value appear on the measurement screen (see Figure 10-2 on page 136).
2. If needed, use the **[▲]** and **[▼]** keys to select **EXT BLANK**.
The extended blank becomes active, but initially, its value is zero. The gage remains in the measurement screen.
3. Use the **[▶]** or **[◀]** keys to respectively increase or decrease the blank value until you exclude early unwanted echoes from detection.
The extended blank horizontal bar just above the waveform display indicates the extended blank length (see Figure 10-2 on page 136).

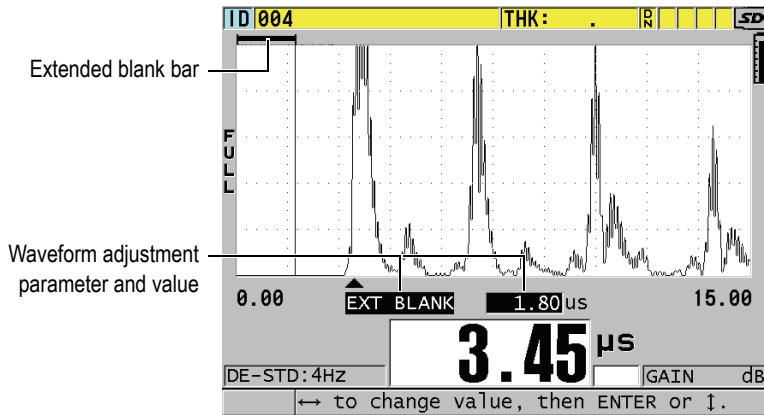


Figure 10-2 Adjusting the extended blank length

4. To turn off the extended blank, use the **[◀]** key to decrease the extended blank value back to zero.

NOTE

If the measurement point changes when the extended blank is moved, echoes can change in height. This is because in the normal waveform display mode, the 38DL PLUS attempts to adjust the height.

The instrument also attempts to make the most accurate measurement by identifying the beginning of an echo. When the extended blank is positioned within an echo instead of to its left, the gage is unable to make an accurate detection.

10.3 About the B-Scan

A B-scan is a cross-sectional image of thickness readings. The 38DL PLUS can acquire and display B-scan data (see Figure 10-3 on page 137). When you activate the B-scan, the thickness reading profile builds up and scrolls on the screen. Once a B-scan is acquired, you can freeze the screen and review the recorded thickness values.

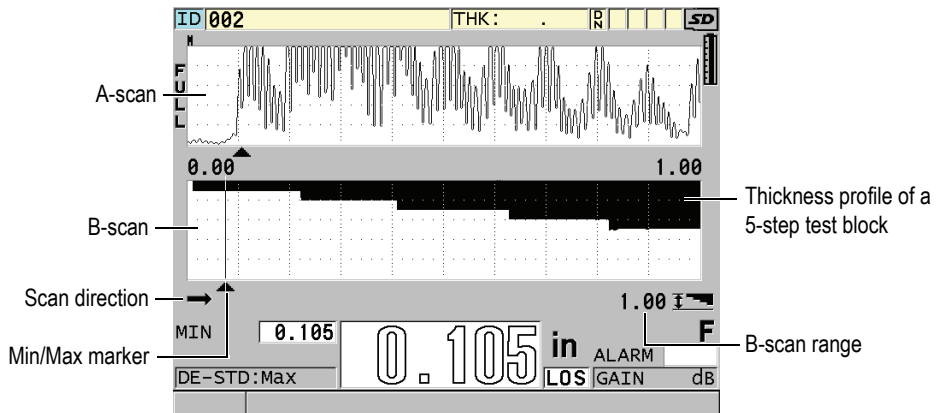


Figure 10-3 B-scan example for a 5-step test block

While the B-scan is running, you can save individual thickness readings, save the current B-scan screen (with all thickness values), or the entire scan (up to 10,000 readings) [see section 10.3.3 on page 143].

You can activate and configure the B-scan from the **B-SCAN** screen (see Figure 10-4 on page 138), accessible by pressing [SETUP MENU], and then selecting **B-SCAN** in the menu.

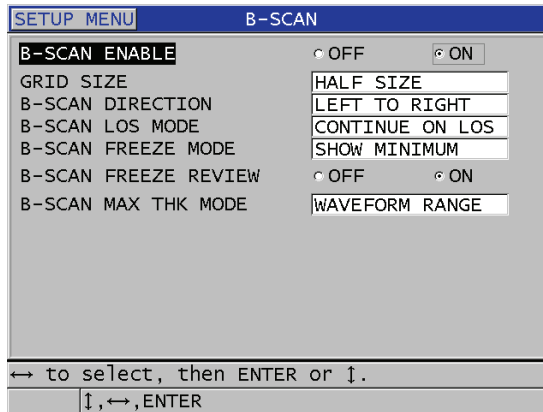


Figure 10-4 Changing B-scan parameters

The **B-SCAN** screen contains the following parameters:

GRID SIZE

Determines the size of the B-scan with the following two options (see Figure 10-5 on page 139):

HALF SIZE

Displays a half-height A-scan waveform and a half-height B-scan.

FULL SIZE

Displays the B-scan over the entire waveform display area.

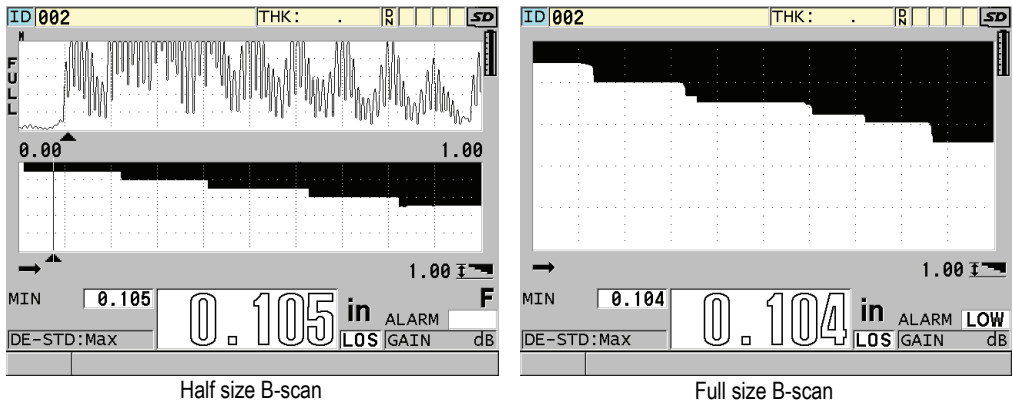


Figure 10-5 The half-size and full-size B-scans

B-SCAN DIRECTION:

Choose the B-scan direction to match the direction of transducer movement. A scan direction arrow appears below the left corner of the B-scan display to indicate the transducer scan direction (see Figure 10-6 on page 139). The data starts appearing on the screen in the opposite direction.

LEFT TO RIGHT

The transducer scans the part from left to right and the data starts appearing at the right of the screen and scrolls to the left.

RIGHT TO LEFT

The transducer scans the part from right to left and the data starts appearing at the left of the screen and scrolls to the right.

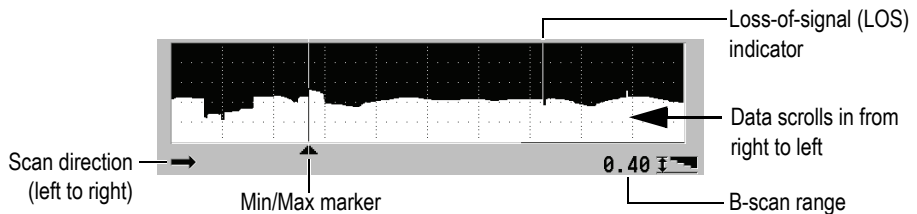


Figure 10-6 B-scan elements

B-SCAN LOS MODE

Determines how the B-scan behaves when a loss-of-signal (LOS) occurs.

STOP ON LOS

The B-scan stops scrolling when a LOS occurs. When the instrument regains measurements, a thin blank vertical line is inserted into the B-scan as a marker showing that a LOS has occurred (see Figure 10-6 on page 139).

CONTINUE ON LOS

The B-scan continues scrolling when a LOS occurs.

B-SCAN FREEZE MODE

Determines which A-scan waveform and thickness reading are displayed when you press **[FREEZE]** while a B-scan is active.

SHOW MINIMUM

Displays the waveform and thickness reading for the minimum reading collected during the scan.

SHOW MAXIMUM

Displays the waveform and thickness reading for the maximum reading collected during the scan.

SHOW CURRENT

Displays the last thickness reading made before pressing **[FREEZE]**.

B-SCAN FREEZE REVIEW

When this feature is enabled and a B-scan is active, pressing **[FREEZE]** freezes the B-scan image in review mode. In this mode, a vertical line, the review marker, appears to indicate the location of the displayed thickness (see Figure 10-7 on page 141). The displayed thickness is either the minimum, maximum, or current thickness depending on which **B-SCAN FREEZE MODE** option is selected. The 38DL PLUS displays both the thickness value and the corresponding waveform. Use the **[◀]** and **[▶]** keys to move the review marker and read the thickness at the review marker location.

TIP

If the minimum or maximum value moves off the B-scan screen, press **[FREEZE]** to center the B-scan and the review marker on the minimum or maximum thickness.

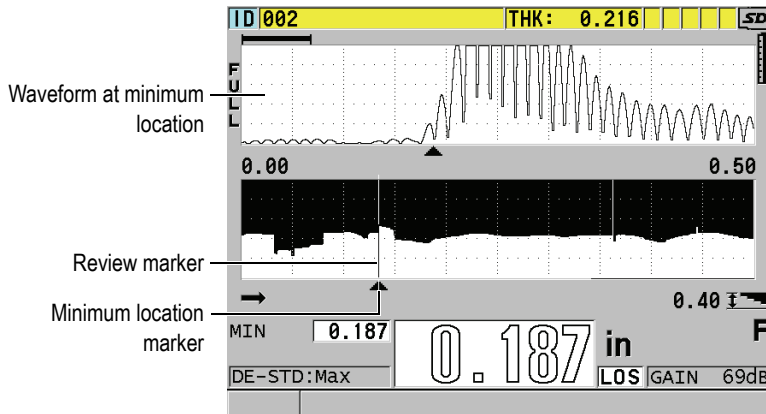


Figure 10-7 B-scan freeze review elements

B-SCAN MAX THK MODE:

Determines the vertical scale of the B-scan with the following two options:

A-SCAN RANGE

The top and bottom of the vertical scale correspond to the start and end of the A-scan display range.

SPECIFIED THK

The top of the vertical scale represents the zero value and the bottom of the scale is the value that you enter in the **B-SCAN MAX THICKNESS** parameter that appears. The allowed range is 0.000 in. to 25.000 in. (0.00 mm to 635.00 mm).

NOTE

Olympus does not recommend using the A-scan zoom feature when **B-SCAN MAX THICKNESS** is set to **A-SCAN RANGE**. The zoom constantly adjusts the start and the end points of the A-scan range, resulting in a B-scan image where the scale changes as the thickness changes.

10.3.1 Using the B-Scan

The following procedure describes how to activate and use the B-scan.

To use the B-scan

1. While in the measurement screen, press **[SETUP MENU]**.
2. In the menu, select **B-SCAN**.
3. In the **B-SCAN** screen, set **B-SCAN ENABLE** to **ON**, and configure the other B-scan parameter as desired (see section 10.3 on page 137).
4. Press **[MEAS]** to return to measurement screen with the B-scan active.
The B-scan begins drawing the cross section of the material as soon as the first non-LOS reading is collected.
5. To stop the collection of B-scan data:
Press **[FREEZE]**.
OR
With **B-SCAN LOS MODE** set to **STOP ON LOS**, simply uncouple the transducer from the test material.
6. While the B-scan is frozen, if **B-SCAN FREEZE REVIEW** is set to **ON**, use the **[◀]** and **[▶]** keys to move the review marker and read the thickness value corresponding to the marker position.
7. Press **[MEAS]** again to reset the B-scan and begin a new B-scan.
8. Refer to section 10.3.3 on page 143 for details on how to save B-scan data.

10.3.2 Using the B-Scan Alarm Mode

You can specify B-scan low and high alarm reference values and turn the visual and audible alarm functions **ON** and **OFF**. The B-scan alarm mode is similar to the standard alarm mode (see section 8.4 on page 114) except that the alarm lines are shown in the B-scan grid, as long as the alarm reference values fall within the B-scan thickness range. The alarms are also operational as you review B-scan thicknesses in review mode, in a frozen B-scan.

To use the B-scan alarm mode

1. Activate and configure the B-scan (see section 10.3.1 on page 142).
2. While in the measurement screen, press **[SETUP MENU]**.
3. In the menu, select **ALARM**.

4. In the **ALARM** screen:
 - a) Set **ALARM ENABLE** to **ON**.
 - b) Set **ALARM MODE** to **B-SCAN**.
 - c) Enter the desired **LOW ALARM** and **HIGH ALARM** values.
5. Press **[MEAS]** to return to the measurement screen.
6. The horizontal red alarm lines appear on the B-scan (see Figure 8-5 on page 116).

10.3.3 Saving B-Scans, A-Scans, or Thickness Readings

The 38DL PLUS can do the following tasks while using the B-scan:

- Save a live thickness reading while the B-scan is running.
- Save any reviewed thickness reading on a frozen B-scan.
- Save all thickness readings for one B-scan screen (600 readings) along with the minimum or maximum thickness readings for a held B-scan.
- Save all thickness readings for one B-scan screen (600 readings), the minimum or maximum thickness reading and waveform for a held B-scan.
- Save an entire B-scan history up to 10,000 thickness readings, the minimum or maximum thickness readings and waveform, and the held B-scan.

To save a live thickness reading while the B-scan is running

- ◆ Press **[SAVE/SEND]**.

To save any reviewed thickness reading on a frozen B-scan

1. While the B-scan is running, press **[FREEZE]** to enter the review mode.
2. Use the **[◀]** and **[▶]** keys to review any thickness on the frozen B-scan.
3. Press **[SAVE/SEND]** to save to the datalogger, the thickness value for the review marker position.

To save the minimum or maximum thickness reading for a frozen B-scan

1. Set **B-SCAN FREEZE MODE** to **SHOW MINIMUM** or **SHOW MAXIMUM**.
The gage displays the minimum or maximum thickness reading with the corresponding waveform.
2. While the B-scan is running, press **[FREEZE]** to enter the review mode.

3. Press **[SAVE/SEND]** while the minimum or maximum thickness reading is displayed.

To save the minimum or maximum A-scan along with the frozen B-scan

1. Set **B-SCAN FREEZE MODE** to **SHOW MINIMUM** or **SHOW MAXIMUM**. The gage displays the minimum or maximum thickness reading with the corresponding waveform.
2. While the B-scan is running, press **[FREEZE]** to enter the review mode.
3. Press **[2nd F]**, **[SAVE/SEND]** (**WAVEFORM**) while the minimum or maximum thickness reading is displayed.

To save the entire B-scan (B-scan history)

1. While the B-scan is running or when it is frozen, press **[2nd F]**, **[SAVE/SEND]** (**WAVEFORM**).

The **Save B-Scan history?** message appears on the help text bar.

2. Select **Yes** or **No**:

Yes

Saves the entire B-scan history including the Minimum or Maximum thickness with corresponding waveforms.

No

Saves the current B-scan screen and the waveform.

NOTE

When a B-scan screen is saved to the datalogger, the gage saves the thickness values for the 600 data points appearing on the display. All thickness values on a saved B-scan can be reviewed during ID Review. Recall the saved B-scan and use the **[◀]** and **[▶]** keys to review each thickness reading.

NOTE

You can save a maximum of 10,000 thickness readings to a B-scan. When the maximum number of thickness points reaches 10,000, the gage prompts you to save the B-scan history or to reset the B-scan without saving.

10.4 About the DB Grid

The database grid (DB grid) is a table representation of 2-D data. This representation gives you the ability to move freely in any direction on a grid rather than follow a preset list of IDs. Instead of automatically incrementing to the next ID location, you can use the arrow keys to move to a location that is more convenient. You can simultaneously display the A-scan, the DB grid, and the thickness reading (see Figure 10-8 on page 145). You can configure the grid cells to show a data cell flag and a background color corresponding to the range in which their thickness reading falls.

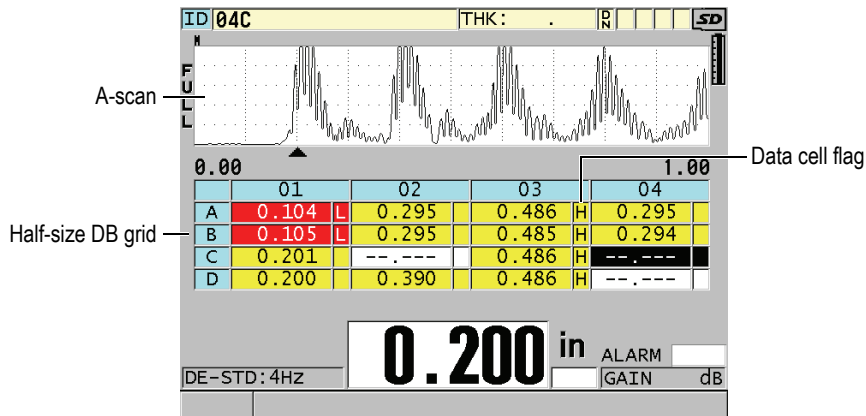


Figure 10-8 Example of the half-size DB grid

10.4.1 Activating and Configuring the DB Grid

You activate and configure the DB grid options from the **DB GRID** screen.

To activate and configure the DB grid

1. From the measurement screen, press **[SETUP MENU]**.
2. In the menu, select **DB GRID**.
3. In the **DB GRID** screen (see Figure 10-9 on page 146), perform the following steps.

SETUP MENU		DB GRID	
DB GRID ENABLE	<input type="radio"/> OFF	<input checked="" type="radio"/> ON	
GRID SIZE	<input type="text" value="HALF SIZE"/>		
TRANSPOSE GRID	<input type="radio"/> OFF	<input type="radio"/> ON	
LINEARIZE GRID	<input type="radio"/> OFF	<input type="radio"/> ON	
DATA CELL FLAG	<input type="text" value="NONE"/>		
GRID COLOR OPTION	<input type="radio"/> OFF	<input checked="" type="radio"/> ON	
LO RANGE COLOR	<input type="text" value="RED"/>		
LO RANGE VALUE	<input type="text" value="0.000"/>		
MID RANGE COLOR	<input type="text" value="YELLOW"/>		
HI RANGE COLOR	<input type="text" value="GREEN"/>		
HI RANGE VALUE	<input type="text" value="0.000"/>		
↔ to select, then ENTER or ↓.			
↑, ↔, ENTER			

Figure 10-9 Changing DB grid parameters

4. Set **DB GRID ENABLE** to **ON** to activate the DB grid.
5. Set **GRID SIZE** to one of the desired database grid size options (see Figure 10-10 on page 147):

HALF SIZE

Displays a half-screen A-scan waveform and a half-screen database grid. Up to five grid rows are shown.

FULL SIZE

Displays the database grid on the entire screen. Up to 11 grid rows are shown.

NOTE

With both options, the number of grid columns shown varies, depending on the length of column labels and whether or not a database flag is displayed with each data cell.

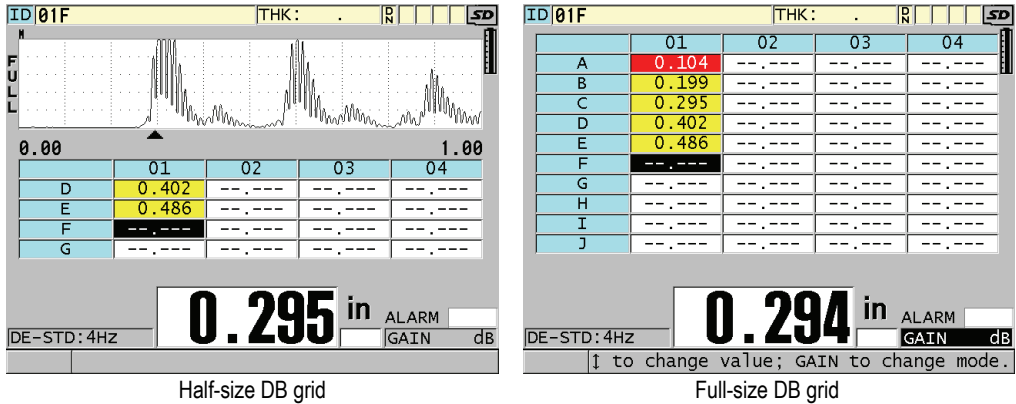


Figure 10-10 Example of half-size and full-size DB grids

6. Set **TRANSPOSE GRID** to **ON** to interchange the rows and columns in a grid (see Figure 10-11 on page 147).

TRANSPOSE GRID set to OFF					TRANSPOSE GRID set to ON				
	A	B	C	D		01	02	03	04
01	---	---	---	---	A	---	---	---	---
02	---	---	---	---	B	---	---	---	---
03	---	---	---	---	C	---	---	---	---
04	---	---	---	---	D	---	---	---	---

Figure 10-11 Grid transposition example

NOTE

The ID number increments in the order assigned when the file was originally set up independently of the **TRANSPOSE GRID** value.

7. Set **LINEARIZE GRID** to **ON** to display the grid IDs in the linear form (see Figure 10-12 on page 148).

ID	THICKNESS
A01	-- .---
A02	-- .---
A03	-- .---
A04	-- .---

Figure 10-12 Example of a linearized DB grid

8. Set **DATA CELL FLAG** to one of the available options to display a single data flag with each data cell in the DB grid. The data cell flag is a letter that appears in a small box to the right of the thickness value in the data cell (see Figure 10-8 on page 145). The available options are:

NONE

No data cell flag appears.

MIN/MAX

“m” indicates a minimum thickness.

“M” indicates a maximum thickness.

ALARM

“L” indicates any kind of low alarm condition including a standard low alarm condition or a previous thickness alarm.

“H” indicates any high alarm condition.

A-SCAN

“W” indicates that a waveform is stored with the thickness.

9. Set **GRID COLOR OPTION** to **ON** to activate usage of low, mid, and high range colors for the grid cell background.
10. Set **LO RANGE COLOR** to the desired cell background color (**RED**, **YELLOW**, or **GREEN**) when the cell thickness value is smaller than the **LO RANGE VALUE**.
11. Set **MID RANGE COLOR** to the desired cell background color (**RED**, **YELLOW**, or **GREEN**) when the cell thickness value is between the **LO RANGE VALUE** and the **HI RANGE VALUE**.
12. Set **HI RANGE VALUE** to the desired cell background color (**RED**, **YELLOW**, or **GREEN**) when the cell thickness value is higher than the **HI RANGE VALUE**.

10.4.2 Changing the Highlighted Cell in the DB Grid

You can easily move the selected cell in the DB grid using the arrow keys.

To change the highlighted cell in the DB grid

1. Activate and configure the DB grid (see section 10.4.1 on page 145).
2. From the measurement screen, press **[ID#]**.
3. In the ID review screen (see Figure 10-13 on page 149):
 - a) Use the **[▲]**, **[▼]**, **[◀]**, and **[▶]** keys to highlight the desired grid cell.
 - b) Press **[2nd F]**, **[▲]** to jump to the last ID location in the file.
 - c) Press **[2nd F]**, **[▼]** to jump to the first ID location in the file.
 - d) Press **[ID#]** at any time to edit the displayed ID location.

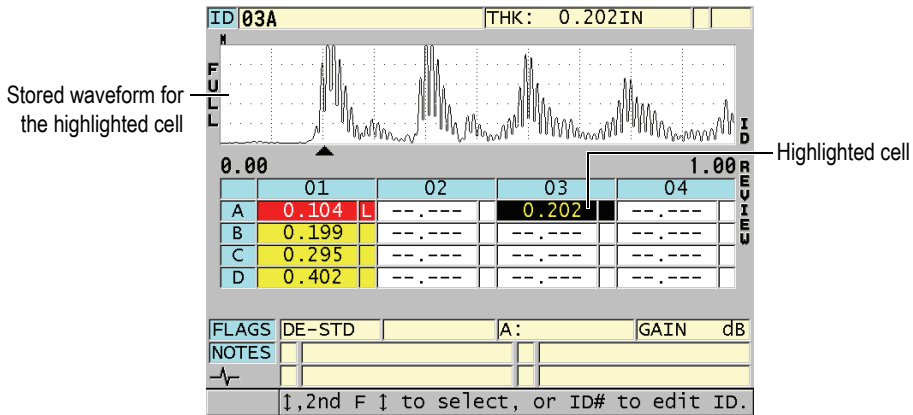


Figure 10-13 The highlighted DB grid cell in the ID review screen

4. Press **[MEAS]** to return to the measurement screen with the current ID number changed to the ID location selected in the ID review screen.

OR

Press **[2nd F]**, **[MEAS]** to return to measurement screen with the current ID number unchanged. The current ID location is the last active ID location in the measurement screen.

10.4.3 Saving Thickness Readings in the DB Grid

To save thickness readings in the DB grid

1. Activate and configure the DB grid (see section 10.4.1 on page 145).

2. Move to the desired DB grid cell (see section 10.4.2 on page 148).
3. In the measurement screen, while the thickness value is displayed, press **[SAVE/SEND]** to save the thickness.

OR

Press **[2nd F]**, **[SAVE/SEND]** (**WAVEFORM**) to save the thickness and the waveform.

The displayed thickness value and setup information are stored at the current ID location identified by the highlighted cell in the grid. If the thickness display is blank when you press **[SAVE/SEND]**, then “---” is saved in place of a value.

The ID number is automatically updated to the next ID number in the sequence. The new ID number is indicated on the ID bar and its cell is highlighted in the grid. If the ID number cannot be updated, a long beep sound is emitted and the instrument displays a message pertaining to the reason the ID was unable to update. In this case, the ID number on the display remains unchanged.

10.4.4 Viewing an Inserted or an Appended Cell in the DB Grid

You can insert or append a cell in the DB grid. To maintain the format of the grid, the inserted or appended cell does not appear in the grid. However, the cell after which it is inserted or to which it is appended appears shaded with a grey background (see Figure 10-14 on page 150).

	01	02	03	04
A	0.104	---	0.202	---
B	0.199	---	---	---
C	0.295	---	---	---
D	0.402	---	---	---

Cell with an inserted or appended cell

Figure 10-14 Example of an inserted cell

To view an inserted or an appended cell in the DB grid

1. Activate and configure the DB grid (see section 10.4.1 on page 145).
2. Press **[ID#]**, and then use the arrow keys to move to the desired shaded grid cell.
3. Press **[ZOOM]**.
The grid changes to a linear view and the inserted or appended ID number is displayed (see Figure 10-15 on page 151).

ID	THICKNESS	
01A	0.104	L
01B	0.199	
01BB	0.200	
01C	0.295	

Inserted cell —

Figure 10-15 Example of a zoomed inserted cell

4. Press [**ZOOM**] again to return to the normal DB grid view.

10.5 Configuring AVG/MIN Measurements

You can use the AVG/MIN measurement function to store the average or the minimum measurement of several successive thickness readings to the datalogger.

To configure the AVG/MIN measurement option

1. From the measurement screen, press [**SETUP MENU**].
2. In the menu, select **AVG/MIN**.
3. In **AVG/MIN** screen (see Figure 10-16 on page 152):
 - a) Set **AVG/MIN ENABLE** to **ON** to activate the average/minimum measurement function.
 - b) Set **MODE** to **AVERAGE** to calculate the average of the sequential thickness readings or **MINIMUM** to calculate the minimum of the sequential thickness readings.
 - c) Set **# OF READINGS** to set the number of thickness values in the sequence (**2**, **3**, or **4**).

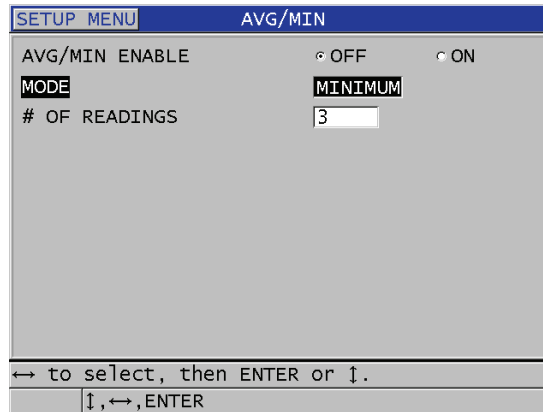


Figure 10-16 Opening the Avg/Min measure dialog box

4. Press [MEAS] to return to measurement screen.

10.6 Making AVG/MIN Measurements

When you are in the measurement screen and the AVG/MIN measurement is active, the last measured thickness values (up to four) appear above the current thickness value together with the average or minimum value (see Figure 10-17 on page 153).

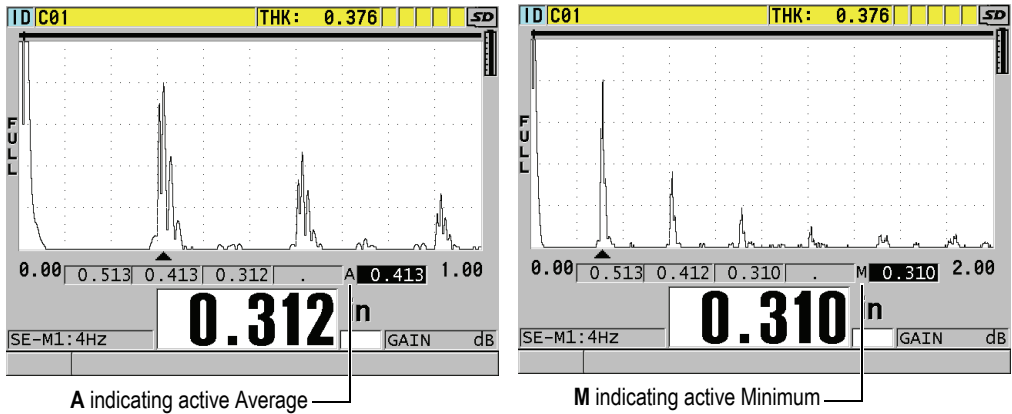


Figure 10-17 Examples of the measurement screen with the AVG/MIN measurement active

To make thickness readings using the AVG/MIN measurement

1. Activate and configure the **AVG/MIN** function (see section 10.5 on page 151).
2. Couple your transducer to the material.
The thickness appears on the display.
3. Press **[SAVE/SEND]** to display the thickness in the left most thickness box. Each time you press **[SAVE/SEND]** the actual thickness reading appears in the next shaded box moving to the right while the minimum or average of the thickness readings is automatically calculated and placed in the right most box.
4. If you want to replace a reading, use the **[◀]** and **[▶]** keys to switch from one highlighted box to another, and press **[SAVE/SEND]** to save the new reading.
5. When the minimum or average box is highlighted, press **[SAVE/SEND]** a last time to store that value in the datalogger at the current ID# location, and clear all the boxes.

OR

Press **[MEAS]** to clear all the boxes without saving to the datalogger.

10.7 Using Temperature Compensation

The 38DL PLUS can compensate for changes in sound velocity due to temperature variations. This function is useful for example when the test block may be at room temperature while the actual material can be at an elevated temperature.

Using the temperature compensation function, you can input the temperature of the calibration standard in °F or °C units. You can manually enter a fixed elevated temperature, manually enter a temperature for the current ID location, or automatically read the temperature from an optional temperature probe.

The sound velocity of most steel changes about 1 % for every 100 °F (55 °C) change in temperature. The following equation is used to compensate for the change in sound velocity due to temperature.

$$\text{Temperature corrected thickness} = \text{MTI} \times V_0 \times (1 + (k \times (T_1 - T_0)))$$

Where:

MTI = Measured time interval

V_0 = Calibrated test block velocity

T_1 = Actual material temperature

T_0 = Temperature at calibration

k = Temperature coefficient (normally -0.0001 for °F or -0.00018 for °C)

A temperature coefficient of 0.0001 assumes a 1 % change in velocity per 100 °F (55 °C) change in temperature.

To use the temperature compensation

1. Press **[SETUP MENU]**.
2. In the menu, select the **TEMP COMP**.
3. In the **TEMP COMP** screen (see Figure 10-18 on page 155):
 - a) Set **TEMP COMP ENABLE** to **ON** to activate the temperature compensation function.
 - b) Set **DEGREE UNITS** to the desired temperature units (**FAHRENHEIT** or **CELSIUS**).
 - c) Set **CALIBRATION TEMP** to the temperature of the test block used to perform the calibration. The allowable range is 14 °F to 932 °F or -10 °C to 500 °C.

- d) Set **TEMP COEFFICIENT** to the desired value (typically -0.00010 for °F or -0.00018 for °C) for steel.
- e) Set **CURRENT TEMP** to the temperature of the actual test piece.

NOTE

You can specify a negative sign using the [▶] or [◀] keys to move the cursor over the "+" or "-", and then using the [▲] and [▼] keys to change the sign.

SETUP MENU		TEMP COMP	
TEMP COMP ENABLE	<input type="radio"/> OFF	<input checked="" type="radio"/> ON	
DEGREE UNITS	FAHRENHEIT		
CALIBRATION TEMP	+ 70 ° F		
TEMP COEFFICIENT	- .00010		
CURRENT TEMP	+ 70 ° F		
↔ to select, then ENTER or ↓.			
↓, ↔, ENTER			

Figure 10-18 The TEMP COMP screen

4. Press [MEAS] to return to the measurement screen with the activated temperature compensation (see Figure 10-19 on page 156). The measured thickness is temperature-compensated based on the **CALIBRATION TEMP**, the **CURRENT TEMP**, and the **TEMP COEFFICIENT** parameter values.

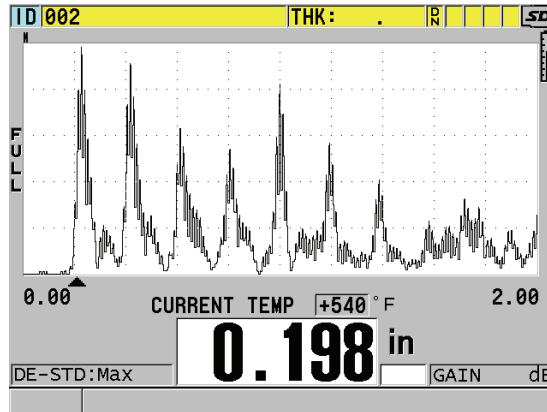


Figure 10-19 Displaying temperature compensation data

5. While the temperature compensation function is active, if the temperature of the test piece changes, you can quickly change the **CURRENT TEMP** as follows:
 - a) Press [2nd F], [XDCR RECALL] (REF VALUE).
 - b) In the **CURRENT TEMPERATURE** screen, enter the new current temperature value.

NOTE

Both the thickness and current temperature values are saved to the internal datalogger.

11. Using the Datalogger

This chapter describes how to use the 38DL PLUS internal datalogger to organize your data.

Topics are as follows:

- About the Datalogger (see section 11.1 on page 157)
- Creating a Data File (see section 11.2 on page 161)
- Performing File Operations (see section 11.3 on page 181)
- About Notes (see section 11.4 on page 189)
- Setting the ID Overwrite Protection (see section 11.5 on page 194)
- About the ID Review Screen (see section 11.6 on page 194)
- Using the Optional Bar Code Wand to Enter an ID Number (see section 11.7 on page 199)
- Generating Reports (see section 11.8 on page 200)

11.1 About the Datalogger

The 38DL PLUS datalogger is a file-based system where one file is opened at a time. The active file stores a measurement at a thickness measurement location ID. Each time you press **[SAVE/SEND]**, the displayed value is saved to the active file at the current ID. The ID is automatically incremented for the next measurement. When you press **[FILE]**, the name of the active file appears in the ID bar above the menu (see Figure 11-1 on page 158).

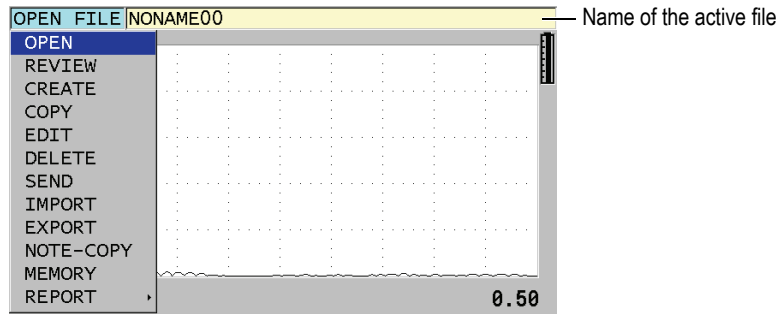


Figure 11-1 The active file name appearing in the ID bar

A file also contains header parameters that you can define to better describe the content of the file. You can define notes in the file, and associate up to four notes to an ID or to a range of IDs. In the file, you can organize the ID range, select the data format, and select the saved data. Table 10 on page 158 summarizes the contents of a file and indicates where you can find more information.

Table 10 File contents summary

Contents	Description	See section
Header	Extra parameters to describe the contents and the context of the data	11.2 on page 161
Measurement data	Organized by predefined IDs arranged by file types	11.2.1 on page 162
	Data format defined by the file data mode	11.2.2 on page 180
	Saved data (thickness measurement with or without the waveform) configured using the setup menu	5.4 on page 70
Notes	Centralized in a note table	11.4 on page 189
	Associated to an ID or to a range of IDs	11.4.2 on page 191

You can identify the datalogger parameters in the ID bar at the top of the measurement screen (see Figure 11-2 on page 159).

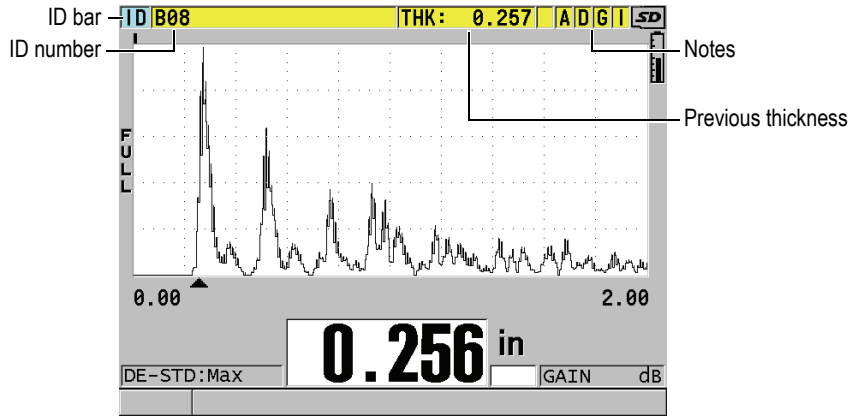


Figure 11-2 Identifying datalogger parameters

With each measurement, the 38DL PLUS also stores a complete description of the measurement conditions. Table 11 on page 160 describes the additional data stored with each thickness measurement and with each waveform.

Table 11 Additional information stored with the data

For a measurement	For a waveform
File name File header data Identifier Units (in. or mm) LOS (loss-of-signal) Differential mode Differential reference value Alarm mode Alarm status Alarm set points Minimum or maximum mode Minimum or Maximum Reading Velocity Resolution Transducer setup number and information Coating thickness (when THRU-COAT is active) Temperature (when temperature compensation is active) Oxide thickness (when Oxide Measurement is active)	Zoom status Horizontal axis limits Detection marker position Delay Range Rectification mode

You can store approximately 475,000 thickness values without waveforms in the internal memory or approximately 20,000 thickness values with waveforms. You can double the storage capacity by using an optional external microSD memory card. The maximum size of the external microSD card that can be used on the 38DL PLUS is 2 GB.

With the datalogger, you can easily create a data file (see section 11.2 on page 161), perform a number of file operations (see section 11.3 on page 181), add notes (see section 11.4 on page 189), and perform data operations (see section 11.5 on page 194).

You can also scan bar codes using the optional bar code reader to easily enter the bar code value into the instrument as the location ID numbers (see section 11.7 on page 199 for details).

11.2 Creating a Data File

The following procedure describes how to create a data file in the 38DL PLUS.

NOTE

You can also create a 38DL PLUS data file from a computer using the GageView interface program. Refer to the *GageView Interface Program — User's Manual* (P/N: 910-259-EN [U8778347]) for details.

To create a data file

1. From the measurement screen, press **[FILE]**.
2. In the menu, select **CREATE**.
3. In the **CREATE** screen (see Figure 11-3 on page 162):
 - a) In the **FILE NAME** parameter, enter the desired file name using up to 32 characters.
 - b) In the **DESCRIPTION** parameter, optionally enter a description of the contents of the file.
 - c) In the **INSPECTOR ID**, optionally enter an identification of the inspector.
 - d) In the **LOCATION NOTE** parameter, optionally enter an identification of where the measurement are performed.
 - e) Select the appropriate **DATA FILE TYPE** for your application (see section 11.2.1 on page 162 for details).
 - f) Select the appropriate **FILE DATA MODE** for your application (see section 11.2.2 on page 180 for details).
 - g) Set the **DELETE PROTECTION** mode **ON** or **OFF**.
Delete protection locks the file so it cannot be deleted. You can unlock the file for deletion using the file edit function.
 - h) Depending on the selected **FILE TYPE**, refer to the following sections for the remaining steps of this procedure:
 - **INCREMENTAL** see section 11.2.1.1 on page 163
 - **SEQUENTIAL** see section 11.2.1.2 on page 165
 - **SEQ+CUSTOM PT** see section 11.2.1.3 on page 166
 - **2D GRID** see section 11.2.1.4 on page 168

- **2D+CUSTOM PT** see section 11.2.1.5 on page 172
- **3D GRID** see section 11.2.1.6 on page 174
- **BOILER** see section 11.2.1.7 on page 176
- **3D CUSTOM** see section 11.2.1.8 on page 178

Figure 11-3 Example of the CREATE screen

TIP

At any time, you can press [2nd F], [▲] or [2nd F], [▼] to scroll between parameters on the screen.

11.2.1 About Data File Types

You can create a data file using one of the following eight data file types:

- Incremental
- Sequential
- Sequential with Custom Point
- 2-D Matrix Grid
- 2-D Matrix Grid with Custom Point

- 3-D Matrix Grid
- Boiler
- 3-D Custom

11.2.1.1 About the Incremental Data File Type

The incremental data file type uses the alphanumeric start ID value (up to 20 characters) and automatically increments to the subsequent ID value using the following incrementing rules:

- Increments only digits and letters, not punctuation or other special characters.
- Begins incrementing with the right-most character.
- Extends leftward until reaching the first punctuation or special character, or the left-most character, whichever comes first.
- Increments digits from 0, 1, 2, ..., 9. Makes the 9 to 0 transition only after incrementing the character to the left.
- Increments letters from A, B, C, ..., Z. Makes the Z to A transition only after incrementing the character to the left.
- When an ID cannot be incremented after saving a reading, the **Cannot increment ID!** message momentarily appears in the help text bar. Subsequent saves overwrite the reading of the last possible ID until you change the ID value range.

NOTE

To make the gage increment through a range of numbers several digits wide while beginning with a single digit ID number, the maximum number of digit positions must be entered initially using leading zeroes (see examples in Table 12 on page 163).

Table 12 Resulting ID examples for the INCREMENTAL file type

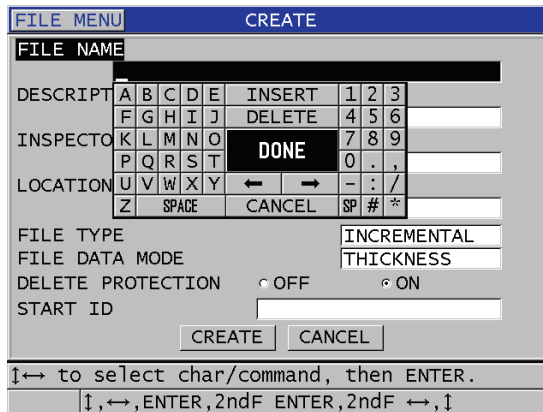
START ID	Resulting IDs
1	1, 2, 3, ..., 9
0001	0001 0010 0002 ... 0003 9999 ... 0009

Table 12 Resulting ID examples for the INCREMENTAL file type (continued)

START ID	Resulting IDs	
ABC	ABC ABD ABE ... ABZ	ACA ACB ACC ... ZZZ
1A	1A 1B 1C ... 1Z	2A 2B ... 9Z
ABC*12*34	ABC*12*34 ABC*12*35 ABC*12*36 ... ABC*12*99	

To create an incremental data file

- From the measurement screen, press **[FILE]**, and then select **CREATE** in the menu (see section 11.2 on page 161 for details on the first parameters).
- In the **CREATE** screen (see Figure 11-4 on page 164):
 - Enter the **START ID** value.
 - Select **CREATE**.

**Figure 11-4 The CREATE screen for the incremental data file type**

11.2.1.2 About the Sequential Data File Type

The sequential data file type is similar to the incremental type but you can define both a starting and ending ID numbers. The resulting file is inclusive of the starting and ending points and all incremental points in between (see examples in Table 13 on page 165).

Table 13 Resulting ID examples for the SEQUENTIAL file type

START ID	END ID	Resulting IDs
ABC123	ABC135	ABC123 ABC124 ABC125 ... ABC135
XY-GY	XY-IB	XY-GY XY-GZ XY-HA ... XY-IB

To create a sequential data file

1. From the measurement screen, press **[FILE]**, and then select **CREATE** in the menu (see section 11.2 on page 161 for details on the first parameters).
2. At the bottom of the **CREATE** screen, select **CONTINUE**.
3. In the second page of the **CREATE** screen (see Figure 11-5 on page 166):
 - a) Enter the **START ID** and **END ID** values.
 - b) Select **CREATE**.

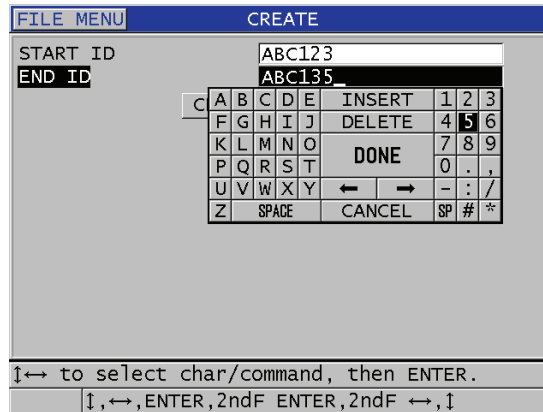


Figure 11-5 Selecting the ID range for the sequential file type

11.2.1.3 About the Sequential with Custom Points Data File Type

The sequential with custom point (SEQ+CUSTOM PT) data file type is defined by a starting and an ending ID number plus a series of custom points. The resulting file is inclusive of the start and end points and all points in between. In addition, multiple thickness readings per ID number location are assigned using the assigned custom points.

Use the sequential with custom point data file type for example when you want to measure along a pipe or tube, where at each ID number location, you can take measurements at the top, bottom, left, and right of the pipe (see an example in Table 14 on page 167).

Table 14 Resulting ID example for the SEQ+CUSTOM PT file type

START ID	END ID	Custom points	Resulting IDs
XYZ1267	XYZ1393	TOP BOTTOM LEFT RIGHT	XYZ1267TOP XYZ1267BOTTOM XYZ1267LEFT XYZ1267RIGHT XYZ1268TOP XYZ1268BOTTOM XYZ1268LEFT ... XYZ1393RIGHT

The allowable number of characters for each custom point depends on the ID number of characters defined in the start and end ID values. The total number of characters of the ID value plus the custom points cannot exceed 20 characters. For example, when the start and end ID values are seven characters long, as in the example in Table 14 on page 167, the maximum allowable length for each custom point is thirteen ($20 - 7 = 13$).

To create a sequential data file with custom points

1. From the measurement screen, press **[FILE]**, and then select **CREATE** in the menu (see section 11.2 on page 161 for details on the first parameters).
2. At the bottom of the **CREATE** screen, select **CONTINUE**.
3. In the second page of the **CREATE** screen (see Figure 11-6 on page 168):
 - a) Enter the **START ID** and **END ID** values.
 - b) Enter two or more **CUSTOM POINTS** values.
 - c) Press **[2nd F]**, **[▼]** to finish entering **CUSTOM POINTS** values.
 - d) Select **CREATE**.

FILE MENU		CREATE							
START ID	XYZ1267								
END ID	XYZ1393								
CUSTOM POINTS	BOTTOM								
	LEFT								
	RIGHT								
	A	B	C	D	E	INSERT	1	2	3
	F	G	H	I	J	DELETE	4	5	6
	K	L	M	N	O	DONE	7	8	9
	P	Q	R	S	T		0	.	,
	U	V	W	X	Y	←	→	-	/
	Z	SPACE				CANCEL	SP	#	*
↓↔ to select char/command, then ENTER.									
↓,↔,ENTER,2ndF ENTER,2ndF ↔,↓									

Figure 11-6 Configuring the ID range for a sequential with custom points data file type

11.2.1.4 About the 2-D Grid Data File Type

A grid is a sequence of ID numbers arranged to describe a path through a two-dimensional. Each part of the ID number corresponds to a particular matrix dimension.

A 2-D (two-dimensional) sequence begins with the ID number that refers to the first column and the first row (see Figure 11-7 on page 169). Then the column (or row) increments one value at a time until the sequence reaches the last column (or row) value while the other dimension value stays constant. At this point, the other dimension increments from its first to its last value. This continues until the ID number that refers to the last column and the last row is reached. You can select to first increment either the columns or the rows.

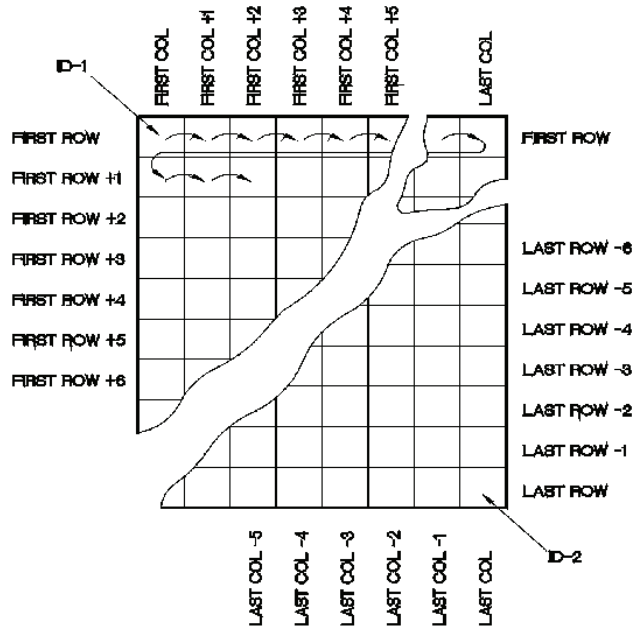


Figure 11-7 General 2-D grid example

A grid structure may associate one dimension of the grid with the physical parts whose wall thickness is to be measured. The particular measurement points on each part are then associated with the other dimension of the grid (see the example in Figure 11-8 on page 170).

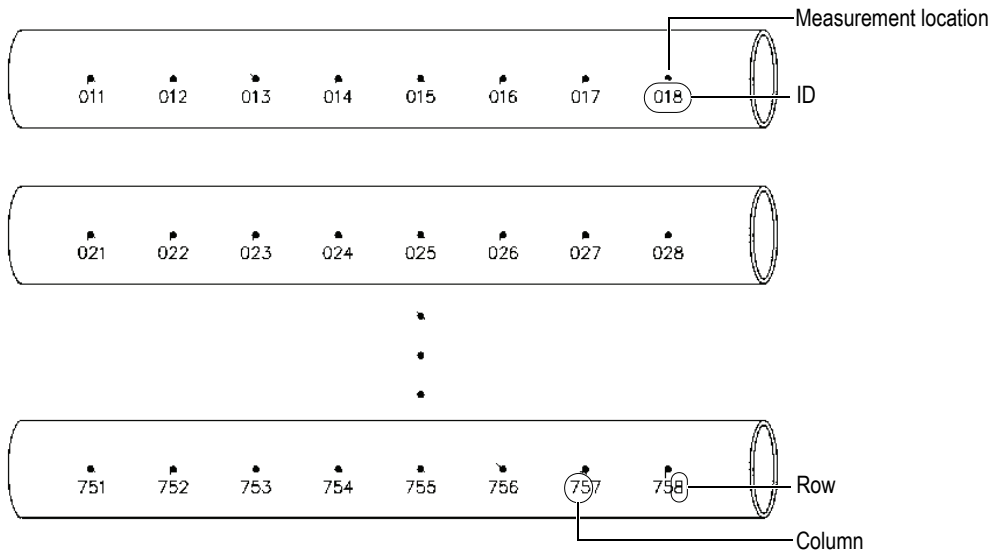


Figure 11-8 One grid for 75 identical parts

Alternatively, the rows and columns of a grid may refer to a two-dimensional map of measurement points on the surface of one part. In this case, a different grid is made for each part (see the examples in Figure 11-9 on page 171).

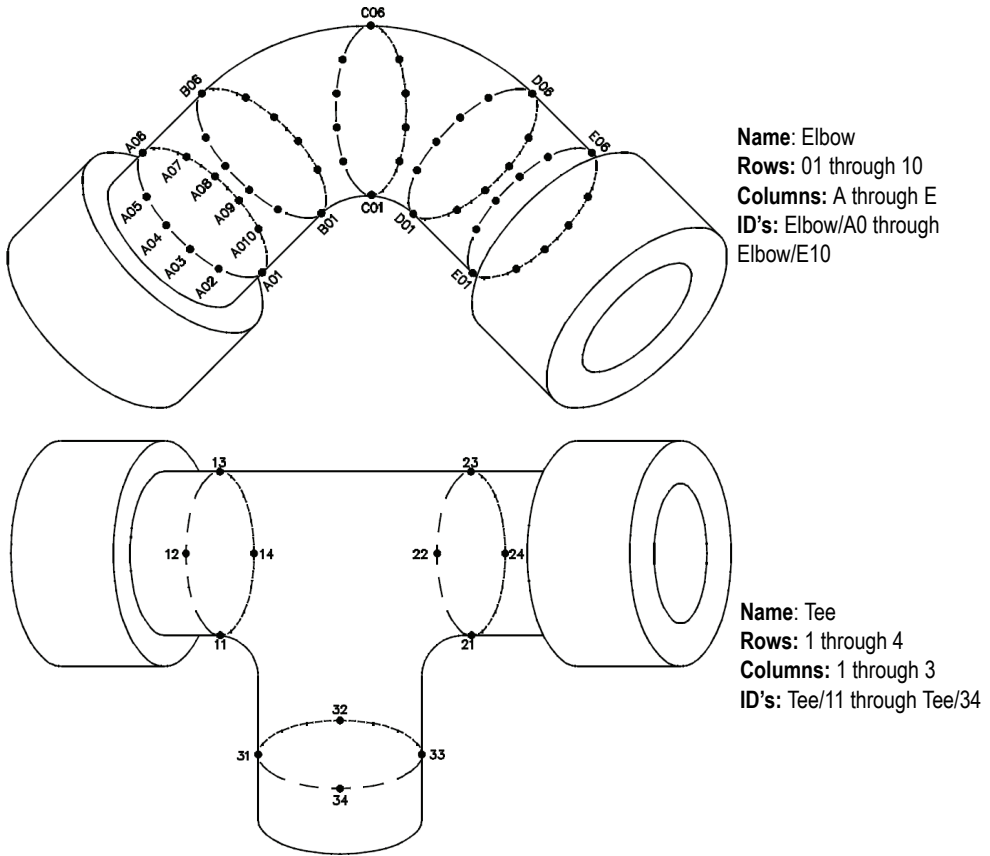


Figure 11-9 Different named grid for each part

To create a 2-D grid data file

1. From the measurement screen, press **[FILE]**, and then select **CREATE** in the menu (see section 11.2 on page 161 for details on the first parameters).
2. At the bottom of the **CREATE** screen, select **CONTINUE**.
3. In the second page of the **CREATE** screen (see Figure 11-10 on page 172):
 - a) Enter the **START COLUMN**, **END COLUMN**, **START ROW**, and **END ROW** values.

- b) Select the **ID FORMAT** to determine how letters are incremented after Z:
STANDARD: A, B, C... Z, AA, AB, AC... ZZ.
EPRI: A, B, C... Z, AA, BB, CC... ZZ.
- c) In **INC 1ST BY**, select which parameter increments the first (**ROW** or **COLUMN**).
- d) Select **CREATE**.

FILE MENU		CREATE									
START COLUMN		A									
END COLUMN		Z									
START ROW		01									
END ROW		10									
ID FORMAT		A	B	C	D	E	INSERT	1	2	3	
INC 1ST BY		F	G	H	I	J	DELETE	4	5	6	
		K	L	M	N	O	DONE	7	8	9	
	C	P	Q	R	S	T		0	.	,	
		U	V	W	X	Y	←	→	-	/	
		Z	SPACE				CANCEL	SP	#	*	
↑↔ to select char/command, then ENTER.											
↑, ↔, ENTER, 2ndF ENTER, 2ndF ↔, ↓											

Figure 11-10 Configuring the ID range for a 2-D grid data file type

NOTE

The 38DL PLUS has the ability to add a row, add a column, and change the incrementing direction after a grid file is created (see section 11.3.3 on page 183 for details).

11.2.1.5 About the 2-D Grid with Custom Points Data File Type

The 2-D grid with custom points data file type is similar to the 2-D grid data file type (see section 11.2.1.4 on page 168), except that you can add custom points. Custom points to record multiple readings with each grid ID number (see an example in Table 15 on page 173).

Table 15 Resulting ID example for the 2D+CUSTOM PT file type

Parameters	Values	CUSTOM POINTS	Resulting IDs
START COLUMN	A	LEFT	A01LEFT
END COLUMN	J	CENTER	A01CENTER
START ROW	01	RIGHT	A01RIGHT
END ROW	17		A02LEFT
			...
			J17RIGHT

To create a 2-D grid with custom points data file

1. From the measurement screen, press **[FILE]**, and then select **CREATE** in the menu (see section 11.2 on page 161 for details on the first parameters).
2. At the bottom of the **CREATE** screen, select **CONTINUE**.
3. In the second page of the **CREATE** screen (see Figure 11-11 on page 174):
 - a) Enter the **START COLUMN**, **END COLUMN**, **START ROW**, and **END ROW** values.
 - b) Enter two or more **CUSTOM POINTS** values.
 - c) Press **[2nd F]**, **[▼]** to finish entering **CUSTOM POINTS** values.
 - d) In **INC 1ST BY**, select which parameter increments first (**POINT**, **ROW**, or **COLUMN**).
 - e) In **INC 2ND BY**, select which parameter increments second (**POINT**, **ROW**, or **COLUMN**).
 - f) Select **CREATE**.

FILE MENU		CREATE	
START COLUMN	A		
END COLUMN	J		
START ROW	01		
END ROW	17		
CUSTOM POINTS	LEFT		
	CENTER		
	RIGHT		
INC 1ST BY	A B C D E	INSERT	1 2 3
INC 2ND BY	F G H I J	DELETE	4 5 6
	K L M N O	DONE	7 8 9
	P Q R S T	0	. ,
	U V W X Y	←	→ - : /
	Z SPACE	CANCEL	SP # *
↑↔ to select char/command, then ENTER.			
↑, ↔, ENTER, 2ndF ENTER, 2ndF ↔, ↓			

Figure 11-11 Configuring the ID range for a 2-D grid with custom points data file type

NOTE

The columns of the 38DL PLUS can increment past Z. For example: Start Column: A; End Column: AC; Column Result: A, B, C,...Z, AA, AB, AC.

11.2.1.6 About the 3-D Grid Data File Type

A 3-D grid is a sequence of multipart ID numbers arranged to describe a path through a three-dimensional matrix. Each part of the ID number corresponds to a particular matrix dimension.

A 3-D (three-dimensional) sequence begins with the ID number that refers to the first column, the first row, and the first point. Each time you press **[SAVE/SEND]**, the value for the first dimension increments by one while the values for the other two dimensions remain unchanged. When the sequence reaches the last value of the first dimension, the value for the second dimension increments by one. This continues until the ID number that refers to the last column, last row and last point is reached. You can select either the columns, rows, or points to increment first.

A three-dimensional grid structure may associate two dimensions of the grid (for example, the columns and rows) with the physical coordinates on the part whose wall thickness is to be measured. The particular measurement points on each part are then associated with the third dimension of the grid (for example, the points). This scenario allows multiple readings to be stored at each grid coordinate. The example shown in Table 15 on page 173 assumes that you chose to increment the point first, the row second and the column third.

Table 16 Resulting ID example for the 3-D GRID file type

Parameters	Values	Resulting IDs
Start column	A	A1X
End column	F	A1Y
Start row	1	A1Z
End row	4	A2X
Start point	X	...
End point	Z	A4Z
		B1X
		B1Y
		...
		AF4Z

To create a 3-D grid data file

1. From the measurement screen, press **[FILE]**, and then select **CREATE** in the menu (see section 11.2 on page 161 for details on the first parameters).
2. At the bottom of the **CREATE** screen, select **CONTINUE**.
3. In the second page of the **CREATE** screen (see Figure 11-12 on page 176):
 - a) Enter the **START COLUMN**, **END COLUMN**, **START ROW**, **END ROW**, **START POINT**, and **END POINT** values.
 - b) In **INC 1ST BY**, select which parameter increments first (**POINT**, **ROW**, or **COLUMN**).
 - c) In **INC 2ND BY**, select which parameter increments second (**POINT**, **ROW**, or **COLUMN**).
 - d) Select **CREATE**.

FILE MENU		CREATE
START COLUMN	A	
END COLUMN	F	
START ROW	1	
END ROW	4	
START POINT	X	
END POINT	Y	
INC 1ST BY	POINT	
INC 2ND BY	ROW	
		CREATE CANCEL
↔ to select, then ENTER or ↓.		
↓, ↔, ENTER		

Figure 11-12 Configuring the ID range for a 3-D grid data file type

11.2.1.7 About the Boiler Data File Type

A boiler file is a special file type designed specifically for boiler applications. A common method for identifying a thickness measurement location is using the following three dimensional approach:

Elevation

The first dimension refers to the physical distance from the bottom of the boiler toward the top.

Tube number

The second dimension refers to the number of the specific boiler tube to be inspected.

Custom points

The third dimension refers to the actual thickness reading location at the specified elevation on the specified tube.

The three dimensions are combined in a single ID number to precisely identify the exact location of each thickness reading. Table 17 on page 177 shows an example where you chose to increment the custom points first, the tube number second, and the elevation third.

Table 17 Resulting ID example for the BOILER file type

ELEVATIONS	START TUBE	END TUBE	CUSTOM POINTS	Resulting IDs
10FT 20FT 45FT 100FT	01	73	L (left) C (center) R (right)	10FT-01L 10FT-01C 10FT-01R 10FT-02L ... 10FT-73R 20FT-01L ... 100FT-73R

To create a boiler data file

1. From the measurement screen, press **[FILE]**, and then select **CREATE** in the menu (see section 11.2 on page 161 for details on the first parameters).
2. At the bottom of the **CREATE** screen, select **CONTINUE**.
3. In the second page of the **CREATE** screen (see Figure 11-13 on page 178):
 - a) Enter the **START TUBE** and **END TUBE** values.
 - b) Enter two or more **CUSTOM POINTS** values.
 - c) Press **[2nd F]**, **[▼]** to finish entering **CUSTOM POINTS** values.
 - d) Enter two or more **ELEVATIONS** values.
 - e) Press **[2nd F]**, **[▼]** to finish entering **ELEVATIONS** values.
 - f) In **INC 1ST BY**, select which parameter increments first (**POINT**, **TUBE**, or **ELEVATIONS**).
 - g) In **INC 2ND BY**, select which parameter increments second (**POINT**, **TUBE**, or **ELEVATIONS**).
 - h) Select **CREATE**.

FILE MENU		CREATE
START TUBE		01
END TUBE		73
CUSTOM POINTS		C
		R
ELEVATIONS		45FT-
		100FT-
INC 1ST BY		POINT
INC 2ND BY		TUBE
		CREATE CANCEL
↔ to select, then ENTER or ↓.		
↓,↔,ENTER		

Figure 11-13 Configuring the ID range for a boiler data file type

11.2.1.8 About the 3-D Custom File Type

The 3-D custom file type is very similar to a standard 3-D Grid except that the point parameter can be a custom list of points.

Table 18 on page 178 shows an example where the custom point increments first, the custom row second, and the column third.

Table 18 Resulting ID example for the 3-D CUSTOM file type

Parameters	Value	CUSTOM ROWS	CUSTOM POINTS	Resulting IDs
START COLUMN END COLUMN	A F	-TOP- -MIDDLE- -BOTTOM-	LEFT RIGHT	A-TOP-LEFT A-TOP-RIGHT A-MIDDLE-LEFT A-MIDDLE-RIGHT ... F-BOTTOM-LEFT F-BOTTOM-RIGHT

To create a 3-D custom data file

1. From the measurement screen, press **[FILE]**, and then select **CREATE** in the menu (see section 11.2 on page 161 for details on the first parameters).

2. At the bottom of the **CREATE** screen, select **CONTINUE**.
3. In the second page of the **CREATE** screen (see Figure 11-14 on page 179):
 - a) Enter the **START COLUMN**, and **END COLUMN** values.
 - b) Enter two or more **CUSTOM ROWS** values.
 - c) Press [**2nd F**], [**▼**] to finish entering **CUSTOM ROWS** values.
 - d) Enter two or more **CUSTOM POINTS** values.
 - e) Press [**2nd F**], [**▼**] to finish entering **CUSTOM POINTS** values.
 - f) In **INC 1ST BY**, select which parameter increments first (**POINT**, **ROW**, or **COLUMN**).
 - g) In **INC 2ND BY**, select which parameter increments second (**POINT**, **ROW**, or **COLUMN**).
 - h) Select **CREATE**.

FILE MENU		CREATE
START COLUMN		A
END COLUMN		F
CUSTOM ROWS		MIDDLE
		BOTTOM
CUSTOM POINTS		LEFT
		RIGHT
INC 1ST BY		POINT
INC 2ND BY		ROW
		CREATE CANCEL
↔ to select, then ENTER.		
↓, ↔, ENTER		

Figure 11-14 Configuring the ID range for a 3-D custom data file type

NOTE

The columns of the 38DL PLUS can increment past Z. For example:

Start Column: A;

End Column: AC;

Column Result: A, B, C,...Z, AA, AB, AC.

11.2.2 About File Data Modes

When you create a data file on the 38DL PLUS, you must select the file data mode to determine which measured values to store in the file (see step 3.f in section 11.2 on page 161). Table 19 on page 180 describes the available file data mode options. You can only store one type of data in a file.

Table 19 File data mode stored measurements

File data mode	Stored measurements	When to use
THICKNESS	Standard thickness Echo-to-echo thicknesses	When basic thickness measurement functions
THRU COAT	Coating thickness Material thicknesses	When using THRU-COAT (see section 5.5 on page 72)
TEMP COMP	Material temperature Material thickness	When using temperature compensation (see section 10.7 on page 154)
OXIDE LAYER	Oxide thickness Material thickness	When using the optional oxide software (see section 7.3 on page 89)
VELOCITY	Velocity	When performing velocity measurements
MIN/MAX	Minimum thickness Maximum thickness	When using the MIN/MAX mode (see section 8.2 on page 112)
TIME OF FLT	Time of flight	When measuring time of flight
REDUCTION RT	Material thickness Reduction rate	When the reduction rate differential mode is activated (see REDUCTION RT in section 8.4 on page 114)
SOFT CONTACT	Sagittal height Radius of curvature Lenses thickness	When using the multilayer software option (see section 7.4.3 on page 99)

Table 19 File data mode stored measurements (continued)

File data mode	Stored measurements	When to use
% TOTAL THK	Thickness Percent total thickness	When using the multilayer software option (see section 7.4.4 on page 100)

You can set the default file data mode to the option you use most frequently.

To change the default file data mode

1. From the measurement screen, press [SETUP MENU].
2. In the menu, select **SYSTEM**.
3. In the **SYSTEM** screen, set **DEFAULT FILE DATA MODE** to the desired option (see Table 19 on page 180 for details).
4. Press [MEAS] to return to the measurement screen.

11.3 Performing File Operations

Pressing [FILE] opens a menu from which you can perform numerous file operations (see Figure 11-15 on page 181). The following sections describe how to perform the operations. Datalogger files are stored in the internal microSD memory card. You can import/export files from/to an external microSD memory card.

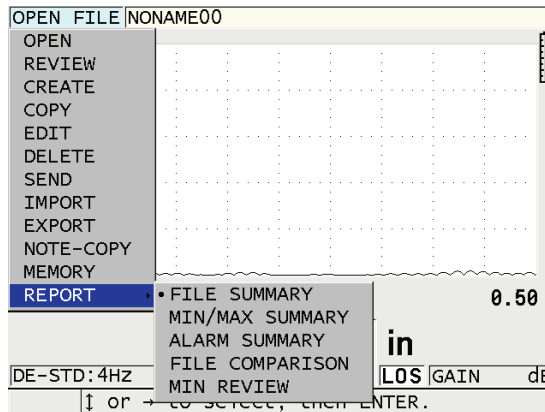


Figure 11-15 The file menu and report submenu

11.3.1 Opening a File

You can open an existing file to make it the active file to which new measurements will be saved.

To open a file

1. Press **[FILE]**.
2. In the menu, select **OPEN**.
3. In the **OPEN** screen (see Figure 11-16 on page 182):
 - a) In **SORT BY**, select how files appearing on the screen are sorted (by **NAME** or by **DATE CREATED**).
 - b) In the list of files, select the file that you wish to open.
The descriptive header for the highlighted file name appears on the lower section of the display.
 - c) Select **OPEN** to return to the measurement screen with the selected file as the active file and the ID number set to the first ID number in the file.

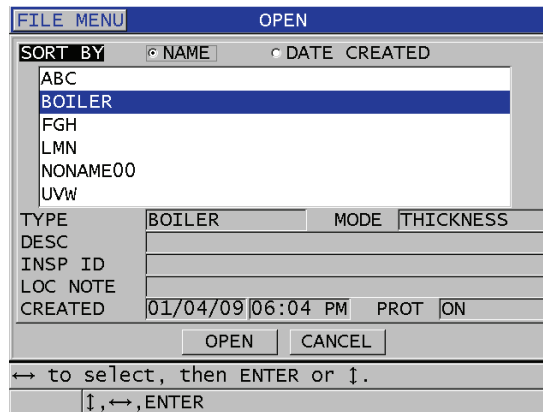


Figure 11-16 Opening a file

11.3.2 Copying a File

You can duplicate a file that already exists in the datalogger. The file copy function is useful when you need to create a new file with the exact same ID number structure as a previously created file. You can also choose to copy the thickness data.

The file copy only allows you to copy an existing file in the internal memory to the internal memory. Use the file import and export functions to copy data between the internal memory and the external microSD card.

To copy a file

1. From the measurement screen, press **[FILE]**.
2. In the menu, select **COPY**.
3. In the **COPY** screen (see Figure 11-17 on page 183):
 - a) In the list, select the source file.
 - b) In **COPY NAME**, enter the file name for the destination file.
 - c) Set **COPY THICKNESS DATA** to **YES** when you want to also copy the thickness readings from the original file into the new file.
 - d) Select **COPY**.

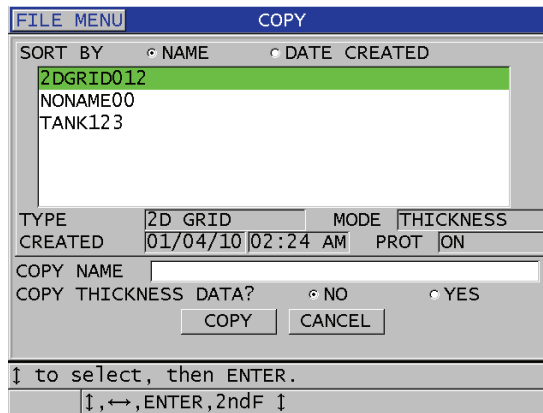


Figure 11-17 Copying a file

4. Open the newly created file when you want to make it the active file (see section 11.3.1 on page 182.)

11.3.3 Editing a File

Once a file is created, you can use the edit function to change the following file parameters:

- File name
- File description
- Inspector ID
- Location note
- Delete protection (on/off)
- End row, column, or point of a grid file
- Incrementing order of a grid file

The edit function does not let you edit the file type and can not be used to edit individual measurement identifiers (ID) or actual thickness readings.

To edit an existing file

1. From the measurement screen, press **[FILE]**.
2. In the menu, select **EDIT**.
3. In the **EDIT** screen (see Figure 11-18 on page 185):
 - a) In the list, select the file to edit.

NOTE

When scrolling through the file names, a descriptive header for the highlighted file name appears on the lower section of the display. This information can assist in selecting the proper file if you are uncertain of the exact file name.

- b) To rename the file, edit the **NAME** value.
- c) Edit the file description (**DESC**), the inspector identification (**INSP ID**), and the location note (**LOC NOTE**) values as needed.
- d) To change the file lock state, set **DELETE PROTECTION** to **ON** or **OFF**.
- e) For a nongrid file, select **UPDATE**.

FILE MENU		EDIT	
SORT BY		<input checked="" type="radio"/> NAME	<input type="radio"/> DATE CREATED
<div style="border: 1px solid black; padding: 2px;"> ABC BOILER FGH </div>			
TYPE	BOILER	MODE	THICKNESS
CREATED	01/04/09 06:04 PM	PROT	ON
NAME	BOILER01		
DESC	A B C D E	INSERT	1 2 3
INSP ID	F G H I J	DELETE	4 5 6
LOC NOTE	K L M N O	DONE	7 8 9
DELETE PROT	P Q R S T		0 . / N
	U V W X Y	← →	- : /
	Z SPACE	CANCEL	SP # *
↔ to select char/command, then ENTER.			
↑, ↔, ENTER, 2ndF ENTER, 2ndF ↔, ↓			

Figure 11-18 Entering new file information

4. For a grid file, select **CONTINUE**, and then in the second page of the **EDIT** screen (see Figure 11-19 on page 185):
 - a) Increase the **END COLUMN** and **END ROW** values as needed. You cannot decrease the values.
 - b) If needed, change the **INC 1ST BY** value.
 - c) Select **UPDATE**.

FILE MENU		EDIT	
END COLUMN	<input type="text" value="Z"/>		
END ROW	<input type="text" value="15"/>		
INC 1ST BY	<input type="text" value="ROW"/>		
		UPDATE	CANCEL
↔ to select, then ENTER or ↓.			
↑, ↔, ENTER			

Figure 11-19 Displaying the grid edit screen

11.3.4 Deleting a File or its Contents

You can use the file delete function to completely erase the file from the datalogger memory or to erase the contents of a file. Files that are delete-protected cannot be deleted until the delete protection is disabled (see section 11.3.3 on page 183.)



CAUTION

Once you delete a file, you cannot recover any information that was once contained in that file.

To delete a file stored in the 38DL PLUS

1. From the measurement screen, press **[FILE]**.
2. In the menu, select **DELETE**.
3. In the **DELETE** screen (see Figure 11-20 on page 187):
 - a) In the list, select one or more files to delete.
A check mark appears on the right on the line of files that you selected.
 - b) Press **[2nd F]**, **[▼]** to leave the list.
 - c) Select the desired **Delete Stored Data** or **Entire File** option.
 - d) Set **DELETE MODE** to **DATA** to only delete the contents of the file.
OR
Set **DELETE MODE** to **FILE** to completely erase the file from the memory.
 - e) Select **DELETE** to perform the operation.

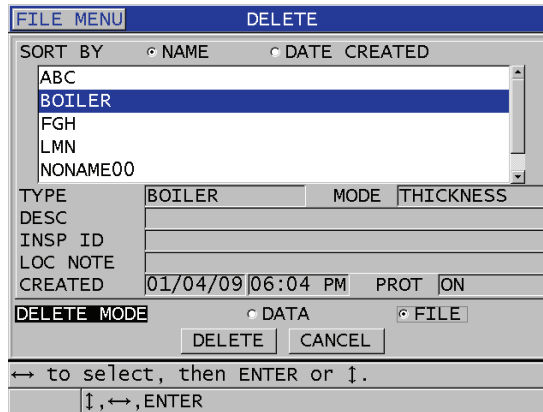


Figure 11-20 Deleting a file

NOTE

When you select to delete multiple files, and some files are delete-protected, the 38DL PLUS will only delete the files that are not delete-protected.

11.3.5 Deleting a Range of IDs

You can delete a range of IDs in the active file using the clear memory function. This function deletes both the data and the ID number locations for incremental and manual (built in GageView) data files. For other data file types only the data is deleted, not the ID number locations.

To delete a range of IDs in a file

1. Open the file from which you wish to delete the data of a range of IDs (see section 11.3.1 on page 182).
2. Press [2nd F], [FILE] (CLR MEM).
3. In the **CLEAR ID RANGE**, screen (see Figure 11-21 on page 188):
 - a) Edit the **STARTING ID** and the **ENDING ID** values to define the range of IDs that you wish to delete from the file.
 - b) Select **CLEAR**.

CLEAR ID RANGE												
STARTING ID		001										
ENDING ID		005										
A	B	C	D	E	INSERT	1	2	3				
F	G	H	I	J	DELETE	4	5	6				
K	L	M	N	O	DONE	7	8	9				
P	Q	R	S	T		0	.	,				
U	V	W	X	Y	←	→	-	:	/			
Z	SPACE	CANCEL			SP	#	*					
↑↔ to select char/command, then ENTER.												
↑, ↔, ENTER, 2ndF ENTER, 2ndF ↔, ↓												

Figure 11-21 Deleting the data of an ID range in the active file

11.3.6 Deleting All Data Files

You can use the reset function to quickly erase all the files stored in the 38DL PLUS.



CAUTION

Using the measurement reset erases all files and data contained in those files. The deleted files and the data they contain cannot be recovered. The datalogger will be completely empty after this procedure.

To delete all files

1. Press [2nd F], [SETUP MENU] (SP MENU).
2. In the menu, select **RESETS**.
3. In the **RESETS** screen (see Figure 11-22 on page 189):
 - a) In the **RESETS** list, select **INTERNAL MEMORY RESET** to delete all files on the internal microSD memory card.
 - b) Select **RESET** to delete all the files.

OR

Select **CANCEL** or press [MEAS] to abort the operation.

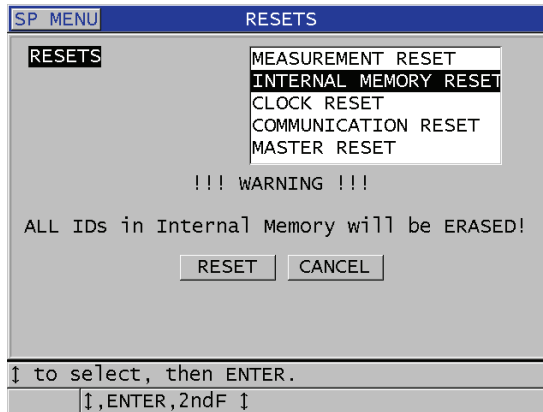


Figure 11-22 Warning message when resetting measurements

11.4 About Notes

A note is an annotation that you can record with a particular measurement, for example to identify an unusual measurement condition. With the 38DL PLUS, you can define a list of text notes saved with the data file (see Figure 11-23 on page 189).

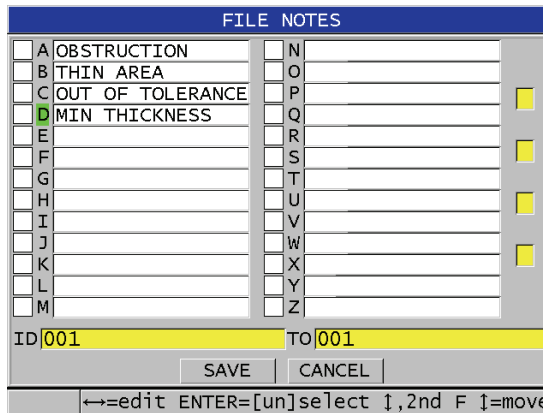


Figure 11-23 The FILE NOTES screen

A note is made of up to 16 characters. In the **FILE NOTES** screen, you can enter up to 26 notes per file. Each note is uniquely identified by a letter code. You can select up to four notes in the list, and then associate them to an ID or to a range of IDs.

When a note is associated to the current ID, the letter code of the note appears in the ID bar at the top of the measurement screen (see Figure 11-2 on page 159).

11.4.1 Creating or Editing Notes

You create or edit the text notes in the note table that is saved with a file.

NOTE

You can also quickly and easily create a note table on a computer using the GageView interface program. Refer to the *GageView Interface Program – User’s Manual* (P/N: 910-259-EN [U8778347]) for details.

To create or edit notes

1. Open the file in which you want to create or edit the notes (see section 11.3.1 on page 182).
2. Press **[2nd F], [ID#] (NOTE)**.
3. In the **FILE NOTES** screen:
 - a) Select the letter code for the note that you wish to create or edit.
 - b) Press the **[▶]** key to enter the edit mode.
 - c) Create or edit the note text.
 - d) Repeat steps 3.a to 3.c to create or edit other notes.
 - e) Select **SAVE** to save the note list to the file.

NOTE

If there are any previous notes, the **FILE NOTES** screen may show these notes.

11.4.2 Associating a Note to an ID or to a Range of IDs

You can associate up to four notes to each measurement ID within a file. You can also select to use up to four notes and save them to a range of IDs in a file. Notes can be saved to an ID with or without a thickness reading. Notes can be added to an ID or a range of IDs without overwriting the stored thickness readings.

To associate a note to an ID or to a range of IDs

1. From the measurement screen, press **[2nd F], [ID#] (NOTE)**.
2. In the **FILE NOTES** screen (see Figure 11-24 on page 191):
 - a) Select the letter code for the note that you wish to associate.
 - b) Press **[ENTER]**.
A checkmark appears in the check box to the left of the letter code.
 - c) Repeat steps 2.a to 2.b when you want to associate other notes (up to four).
 - d) In **ID**, enter the ID or the start ID of the range to which you want to associate the note(s).
 - e) In **TO**, enter the ID or the end ID of the range to which you want to associate the note(s).
 - f) Select **SAVE** to save the note list to the file.
The letter codes for the checked notes are assigned to the selected ID range.

FILE NOTES	
<input type="checkbox"/>	A OBSTRUCTION
<input checked="" type="checkbox"/>	B HIGH TEMP
<input checked="" type="checkbox"/>	C ROUGH SURFACE
<input type="checkbox"/>	D
<input type="checkbox"/>	E
<input type="checkbox"/>	F
<input type="checkbox"/>	G
<input type="checkbox"/>	H
<input type="checkbox"/>	I
<input type="checkbox"/>	J
<input type="checkbox"/>	K
<input type="checkbox"/>	L
<input type="checkbox"/>	M
<input type="checkbox"/>	N
<input type="checkbox"/>	O
<input type="checkbox"/>	P
<input type="checkbox"/>	Q
<input type="checkbox"/>	R
<input type="checkbox"/>	S
<input type="checkbox"/>	T
<input type="checkbox"/>	U
<input type="checkbox"/>	V
<input type="checkbox"/>	W
<input type="checkbox"/>	X
<input type="checkbox"/>	Y
<input type="checkbox"/>	Z
ID <u>10FT-01L</u> TO <u>10FT-01L</u>	
SAVE CANCEL	
←=edit ENTER=[un]select ↓,2nd F ↑=move	

Figure 11-24 Selecting a note from the notes table

NOTE

The letter codes are automatically untagged every time you press [SAVE/SEND]. Therefore, you must select the desired comment code before using the [SAVE/SEND] key.

11.4.3 Deleting a Note from a File

You can delete a note from a file.



CAUTION

To prevent loss of data, do not delete notes of letter codes that have already been associated with an ID or with a range of IDs. This would destroy the meaning of the letter codes stored with IDs.

To delete a note from a file

1. Open the file in which you want to delete a note (see section 11.3.1 on page 182).
2. Press [2nd F], [ID#] (NOTE).
3. In the FILE NOTES screen:
 - a) Select the letter code for the note that you wish to delete.
 - b) Press the [▶] key to enter the edit mode.
 - c) Delete all the characters of the note text.
 - d) Select SAVE to save the edited note list to the file.

11.4.4 Copying a Note Table

You can easily copy notes from one file to another file in the 38DL PLUS. This is very useful when you are creating files from the 38DL PLUS and want to use a common note table.



CAUTION

To prevent loss of data, do not copy a note table to a file that has existing stored letter codes. Copying would redefine the meaning of existing stored notes.

For example, if A = HOT SURFACES in the original note table, and you copy a note table where A = PAINTED SURFACES, this changes the definition of A, and thus changes the meaning of any previously stored A notes.

To copy a note table

1. Press [FILE].
2. In the menu, select **NOTE-COPY**.
3. In the **NOTE-COPY** screen (see Figure 11-25 on page 193):
 - a) Select the **SOURCE FILE**, the file from which you want to copy the note table.
 - b) Select the **DESTINATION FILE**, the file to which you want to copy the note table.
 - c) Select **COPY**.

FILE MENU		NOTE-COPY	
SOURCE FILE			
SORT BY	<input checked="" type="radio"/> NAME	<input type="radio"/> DATE CREATED	
	ABC		
	BOILER		
TYPE	BOILER	MODE	THICKNESS
CREATED	01/04/09 06:04 PM	PROT	ON
DESTINATION FILE			
SORT BY	<input checked="" type="radio"/> NAME	<input type="radio"/> DATE CREATED	
	ABC		
	BOILER		
TYPE	BOILER	MODE	THICKNESS
CREATED	01/04/09 06:04 PM	PROT	ON
COPY		CANCEL	
↔ to select, then ENTER or ↓.			
↓, ↔, ENTER			

Figure 11-25 Copying a note table from one file to another

11.5 Setting the ID Overwrite Protection

You can activate the ID overwrite protection to warn you every time that you attempt to overwrite an existing measurement in a file. You can enable this function at any time.

When the ID overwrite protection is enabled, a message appears on the help text bar when you attempt to save data over existing thickness readings/waveforms. Select **YES** to replace the previous reading with the new one, or **NO** to leave the original value.



Figure 11-26 The ID overwrite protection message

To set the ID overwrite protection

1. From the measurement screen, press [SETUP MENU].
2. In the menu, select **MEAS**.
3. In the **MEAS** screen, set **ID OVERWRITE PROTECTION** to **ON** or **OFF**.
4. Press [**MEAS**] to return to the measurement screen.

11.6 About the ID Review Screen

You can review the data stored in the active file using the ID review screen. You toggle the state of the ID review screen by pressing [**ID#**]. The ID review screen shows the waveform and the data for the active ID.

Figure 11-27 on page 195 shows an example of ID review screen and describes its contents. The area under the waveform is reserved for status flags describing the displayed stored thickness values. The flags are the same single letter abbreviations for status words that are transmitted by the gage using the send commands (see section 14 on page 241).

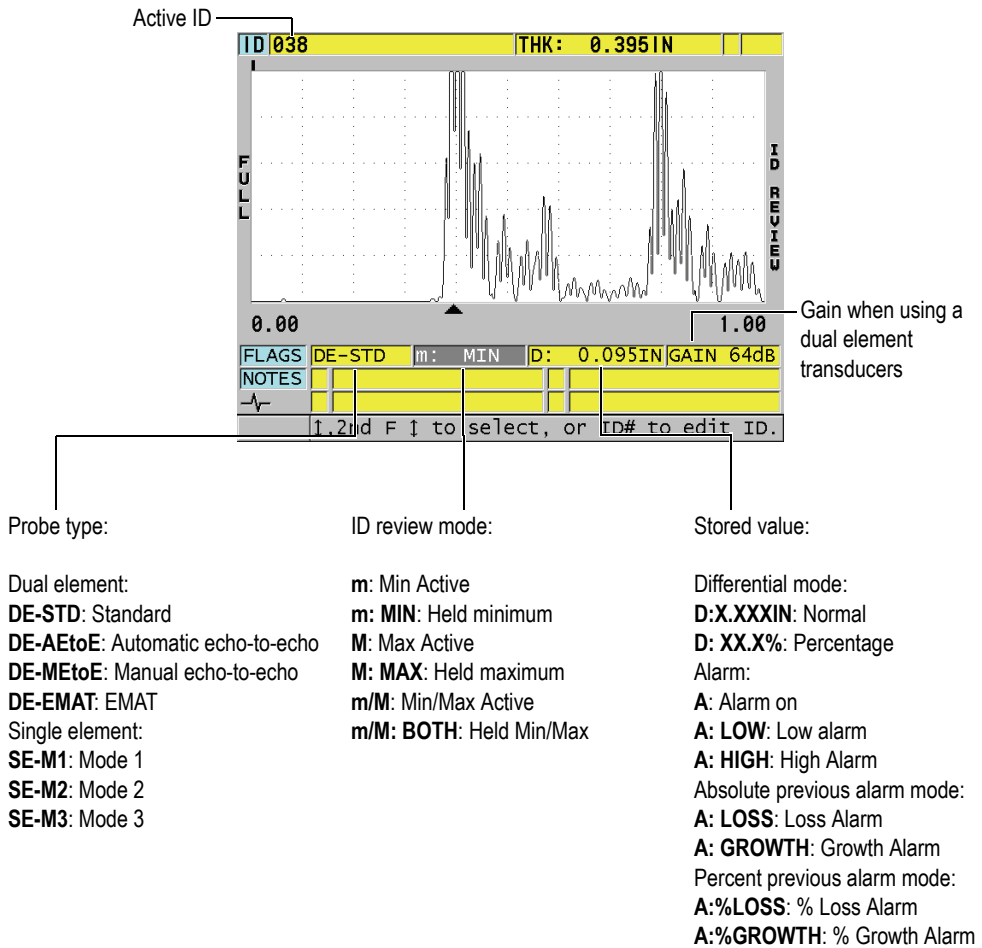


Figure 11-27 Identifying the ID review screen

The ID review screen has three purposes:

- Review datalogger contents by scanning through stored ID locations in the active file.
- Move within the data file and change the current ID location to any location that already exists in the data file.

- Change the current ID location to any location that already exists in the data file for the purposes of editing that ID location.

11.6.1 Reviewing Stored Data and Changing the Active ID

You use the ID review screen to review the data in the active file.

To review stored data and change the active ID

1. Open the file that you wish to review (see section 11.3.1 on page 182).
2. From the measurement screen, press **[ID#]**.
3. While in the ID review screen (see Figure 11-27 on page 195):
 - a) Review the waveform, status flags, notes, and measured values for the active ID.
 - b) Press **[▲]** to display the data for the next ID in the file.
 - c) Press **[▼]** to display the data for the previous ID in the file.
 - d) Press **[2nd F]**, **[▲]** and **[2nd F]**, **[▼]** to respectively jump to the last ID and to the first ID in the file.
 - e) Press **[ID#]** to edit the ID (see section 11.6.2 on page 196).
4. Press **[MEAS]** to return to the measurement screen with the new active ID.

11.6.2 Editing the ID

You can edit the ID for one of two following purposes:

- Change the active ID to quickly jump to an existing ID. This is useful when you are using a large database and it would take too long to locate the desired ID using the arrow keys.
- Change the active ID to a new ID, which does not yet exist in the file. This mode is useful when you want to include additional measurement points to the active file. Additional IDs can be added anywhere in the database (beginning, middle, end).

NOTE

No stored data is shown while editing the ID.

To use the ID edit mode

1. Open the file in which you wish to edit an ID (see section 11.3.1 on page 182).
2. From the measurement screen, press **[ID#]**.
3. Select the ID you wish to edit (see section 11.6.1 on page 196).
4. Press **[ID#]** again, and edit the ID value (see Figure 11-28 on page 197).

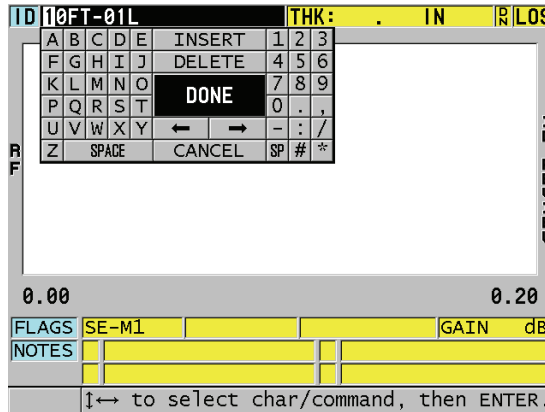


Figure 11-28 Editing the ID # edit mode

5. Press **[MEAS]** to return to the measurement screen with the new active ID.
 6. When the edited ID is not in the database, the help text bar message shown in Figure 11-29 on page 198 appears, select **INSERT** to insert the new ID before the active ID.
- OR
- Select **APPEND** to add the new ID at the end of the file.

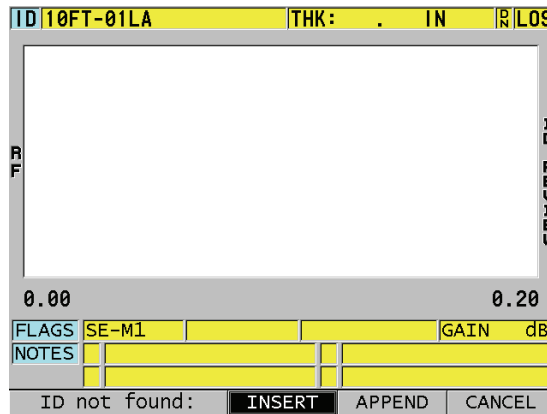


Figure 11-29 The message when the edited ID is not in the database

7. Press **[SAVE/SEND]** with or without an active measurement in order for the edited ID to become a permanent part of the database.
The sequence resumes at the previous active ID.

11.6.3 Erasing Data in the Active File



CAUTION

Data erased by the following techniques **CANNOT** be recovered.

To erase a single measurement

1. From the measurement screen, press **[ID#]**.
The ID review screen appears and shows the active ID with its stored data.
2. Select the ID to be erased (see section 11.6.1 on page 196).
3. Press **[2nd F]**, **[FILE]** (**CLR MEM**) to erase the data at the displayed ID.
The displayed ID changes to the next ID in the sequence.

TIP

To replace a thickness reading, it is easier to save a new measurement at the desired ID from the measurement screen. If you do not want to save a measurement at a specific ID, press **[SAVE/SEND]** from the measurement screen when you are not taking a measurement. This stores an LOS condition and **— . —** at the specific ID number.

4. Press **[MEAS]** to return to the measurement screen.
-

NOTE

When deleting the measurement stored in an ID, the ID is also deleted. In all other file types, only the thickness and waveform data is deleted.

11.7 Using the Optional Bar Code Wand to Enter an ID Number

Olympus offers a noncontact bar code reader that can operate with the 38DL PLUS (P/N: 38DLP/BCW/NC [U8780289]). With the bar code reader you can automatically edit the current ID number to match that of a bar code label.

To enter an ID number using the bar code reader

1. From the measurement screen, press **[SETUP MENU]**.
2. In the menu, select **COMM**.
3. In the **COMM** screen (see Figure 11-30 on page 200):
 - a) Set **CONNECTION TYPE** to **RS-232**.
 - b) Set **RS-232 DEVICE** to **BAR CODE**.

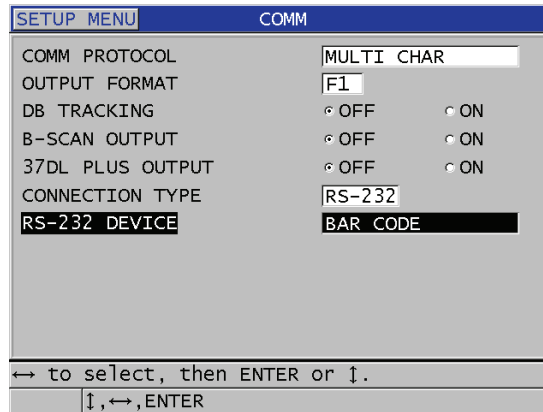


Figure 11-30 Selecting the bar code RS-232 device

4. Press **[MEAS]** to return to the measurement screen.
5. Connect the Olympus bar code reader into the RS-232 connector on the 38DL PLUS (see Figure 1-4 on page 18).
6. Position the noncontact bar code reader over the bar code label (0.0 in. to 2.00 in. [0 mm to 50 mm] away from the label), and then press the trigger button.
The ID number changes to the value coded on the label and the gage returns to the measurement screen, ready to take a measurement.
7. Press **[SAVE/SEND]** to save a measurement.
The current ID number is displayed in the ID section of the screen (top left).

NOTE

Print labels on medium density 3 of 9 code. Consult Olympus for further information on label requirements.

11.8 Generating Reports

The 38DL PLUS can generate inspection data reports without having to connect to a computer or printer. The following reports are available:

File summary

Shows basic statistics for the file (minimum thickness and location, maximum thickness and location, high and low alarm conditions along with the mean, median, and standard deviation).

Minimum/Maximum summary

Shows a list of ID number location that have the minimum and maximum thickness in a file.

Alarm summary

Shows a list of all the ID number locations where a low alarm and high alarm occurred.

File comparison

Allows you to select two files and compare them. The first file contains the previous inspection data and the second file contains the current inspection data. The report indicates the maximum wall loss and any area of greater wall thickness (growth) and their ID number locations.

Minimum Review

Allows you to select a file and then review all minimum thickness locations in the file. You can verify the thickness at all minimum location and replace them if needed.

To generate a report

1. From the measurement screen, press **[FILE]**.
2. In the menu, select **REPORT**.
3. In the submenu, select the desired type of report. When you select:
 - **FILE SUMMARY**, go to step 4
 - **MIN/MAX SUMMARY**, go to step 5
 - **FILE COMPARISON**, go to step 6
 - **ALARM SUMMARY**, go to step 7
 - **MIN REVIEW**, go to step 8
4. In the **FILE SUMMARY** screen (see Figure 11-31 on page 202):
 - a) Select the file for which you want to create the report.
 - b) Select **REPORT**.

The **FILE SUMMARY** report result screen opens (see Figure 11-32 on page 202).

FILE MENU		FILE SUMMARY	
SORT BY ◂ NAME ◂ DATE CREATED			
ABC			
BOILER			
FGH			
LMN			
NONAME00			
UVW			
TYPE	BOILER	MODE	THICKNESS
CREATED	01/04/09 07:12 PM	PROT	ON
REPORT		CANCEL	
↓ to select, then ENTER.			
↑, ←, ENTER, 2ndF ↓			

Figure 11-31 The FILE SUMMARY report screen

FILE SUMMARY			
START ID	10FT-01L		
END ID	100FT-73R		
TOTAL ID COUNT	876		
#MINS:	34	MIN VAL:	0.398
#MAXS:	34	MAX VAL:	0.494
#HI ALARMS:	0	%HI:	0.000%
#LO ALARMS:	0	%LOW:	0.000%
MEAN:	0.446		
MEDIAN:	0.446		
STD DEV:	0.048		
CANCEL		NEW REPORT	

Figure 11-32 The FILE SUMMARY report result screen

- c) Select **CANCEL** to return to the measurement screen or **NEW REPORT** to generate another report.
5. In the **MIN/MAX SUMMARY** screen:
 - a) Select the file for which you want to create the report.
 - b) Select **REPORT**.
The **MIN/MAX SUMMARY** report result screen opens with the first min ID # highlighted (see Figure 11-33 on page 203).

Figure 11-33 The MIN/MAX SUMMARY report screen

- c) Press **[2nd F]**, **[▲]** or **[2nd F]**, **[▼]** to move between the **#MINS** and **#MAXS** lists.
 - d) Select **CANCEL** to return to the measurement screen or **NEW REPORT** to generate another report.
6. In the **FILE COMPARISON** screen (see Figure 11-34 on page 204):
 - a) In the upper list, select the reference file that you want to use in the comparison.
 - b) In the lower list, select the comparison file (containing newer data for the same measurement points).
 - c) Select **REPORT**.
The **FILE COMPARISON** report result screen opens with the first maximum wall loss ID highlighted (see Figure 11-35 on page 204).

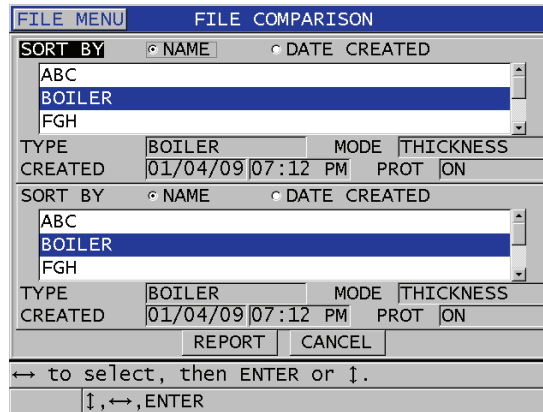


Figure 11-34 The FILE COMPARISON report screen

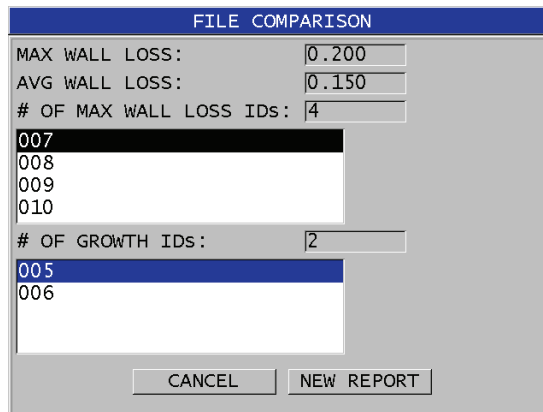


Figure 11-35 The FILE COMPARISON report result screen

- d) Review the maximum wall loss location list and the maximum wall growth location list.
 - e) Select **CANCEL** to return to the measurement screen or **NEW REPORT** to generate another report.
7. In the **ALARM SUMMARY** screen:
- a) Select the file for which you want to generate the report.

- b) Select **REPORT**.

The report page of the **ALARM SUMMARY** screen opens with the first low alarm location ID highlighted (see Figure 11-36 on page 205).

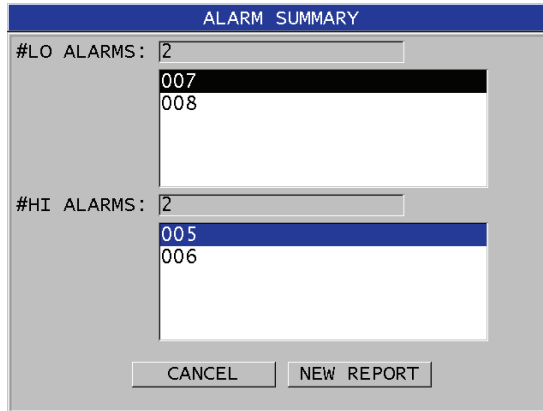


Figure 11-36 The ALARM SUMMARY report result screen

- c) Review the low and the high alarm location lists.
- d) Select **CANCEL** to return to the measurement screen or **NEW REPORT** to generate another report.
8. In the **MIN REVIEW** screen:
- a) Select the file for which you want to generate the report.
- b) Select **REPORT**.
The **MIN/MAX SUMMARY** report result screen opens with the minimum thickness ID highlighted (see Figure 11-37 on page 206).

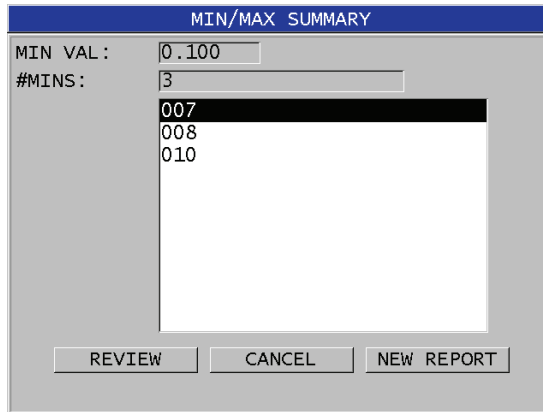


Figure 11-37 The MIN/MAX SUMMARY report result screen

- c) In the list, select an ID.
 The 38DL PLUS returns to the live measurement screen at the selected minimum ID in the file (see Figure 11-38 on page 206).

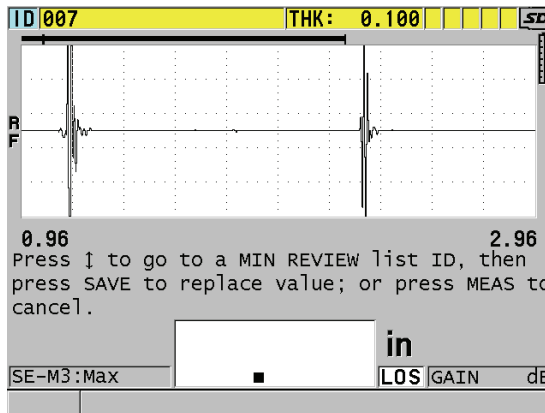


Figure 11-38 Returning to the measurement screen

- d) You can couple the probe back to the minimum ID location to verify the thickness, and then press [SAVE/SEND] to store the new measurement.
 e) Use the [▲] and [▼] keys to move to other minimum review list IDs.

f) Press **[MEAS]** to exit the minimum review.

12. About Dual Element Transducer Setups

You can use a wide variety of transducers with the 38DL PLUS. You can create, store, and quickly recall setups in the instrument for the transducers that you use and for specific applications.

The 38DL PLUS comes with predefined setups that always remain in the instrument as defaults and cannot be removed (see Table 20 on page 209). The default conditions are selected to easily get you started with your applications. You can however easily change existing setups and create up to 35 user-defined application setups, providing flexibility for a wide range of applications.

Table 20 Predefined setups

Quantity	Setup type	Application
22	Predefined	Standard single and dual element probes
7	Predefined	High penetration option
2	Predefined	Internal oxide software option
35	User-defined	Custom applications

12.1 About Standard D79X and Other Dual Element Transducers

The 38DL PLUS is compatible with a full line of Olympus dual element thickness gage transducers (see Table 21 on page 211). The 38DL PLUS automatically recognizes a D79X transducer when you plug one and automatically requests you to perform a transducer zero compensation ([Do ZERO]).

The 38DL PLUS recognizes the transducer through the identification pin located in the molded plug of the cable. Transducer recognition allows the 38DL PLUS to automatically recall setup parameters for the transducer along with a corresponding V-path correction. This generally provides the highest degree of accuracy and repeatability. For best performance, Olympus recommends using an Olympus dual element transducer. Olympus cannot guarantee proper performance with other dual element transducers or transducers that are not designed for use with the 38DL PLUS.

If a dual element transducer without a recognition pin is plugged into a 38DL PLUS, the instrument prompts you to select a generic transducer setup or one of the previously created custom stored transducer setup. The 38DL PLUS has the ability to build and store a custom transducer setup for nonrecognized dual element transducers in the frequency range of 1 MHz to 10 MHz.

12.2 Creating a Setup for Nonstandard Dual Element Transducers

The 38DL PLUS automatically detects standard D79X series dual element transducers and automatically loads the appropriate setup. When you use a nonstandard dual element transducer, you need to create a custom setup.

To create a setup for a nonstandard dual element transducer

1. Connect the nonstandard dual element transducer to the 38DL PLUS.
2. In the **GENERIC SETUP SELECTION** screen that appears (see Figure 12-1 on page 211):
 - a) In the **SETUP TYPE** list, select **DEFAULT**.
 - b) In the **SELECT SETUP** list, select the setup that best matches the frequency of the connected transducer.

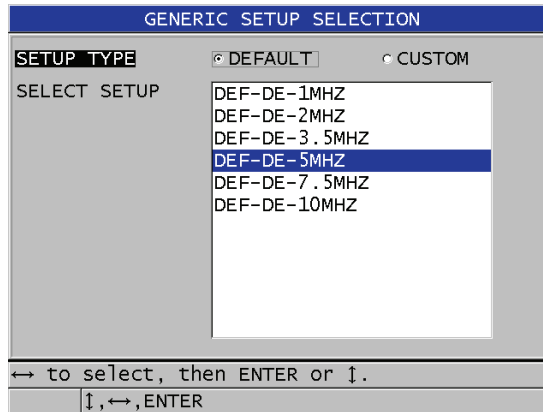


Figure 12-1 The GENERIC SETUP SELECTION screen

3. Press **[MEAS]** to return to the measurement screen.
4. Press **[XDCR RECALL]**.
5. In the menu, select **DEFAULT DUAL ELEMENT**.
6. In the **DEFAULT DUAL ELEMENT** screen, among the default transducer list, select the transducer that best matches the frequency and the diameter of the dual element transducer that you are using (see Table 21 on page 211).


Table 21 Default transducers

Default transducer	Frequency	Tip diameter
D790/791/D799	5 MHz	0.434 in. (11.0 mm)
D792/D793	5 MHz	0.283 in. (7.2 mm)
D794/D795	10 MHz	0.283 in. (7.2 mm)
D797	2 MHz	0.900 in. (22.9 mm)
D798/D7226	7.5 MHz	0.283 in. (7.2 mm)
MTD705	5 MHz	0.200 in. (5.1 mm)
D7906 (THRU-COAT)	5 MHz	0.434 in. (11.0 mm)
D7908	7.5 MHz	0.283 in. (7.2 mm)
Generic setups for dual element transducers:		
DEF-DE-2MHZ	2 MHz	
DEF-DE-3.5MHZ	3.5 MHz	

Table 21 Default transducers (continued)

Default transducer	Frequency	Tip diameter
DEF-DE-5MHZ	5 MHz	
DEF-DE-7.5MHZ	7.5 MHz	
DEF-DE-10MHZ	10 MHz	

7. In the **ACTIVE** screen (see Figure 12-2 on page 212):
 - a) Set **MEAS OPTION** to the desired echo detection mode to use with this transducer (see section 5.6 on page 74 for details).
 - b) In **SETUP NAME**, enter a setup name that describes the transducer and the application for which the setup will be used.
 - c) Set **VELOCITY** to the sound velocity in the material to be tested.
 - d) If needed, adjust the **MAX GAIN** value (see section 13.6.1 on page 228).
 - e) If needed, adjust the **EXT BLANK** value (see section 10.2 on page 135).
 - f) Press **[SAVE/SEND]** to save the changes to the setup.

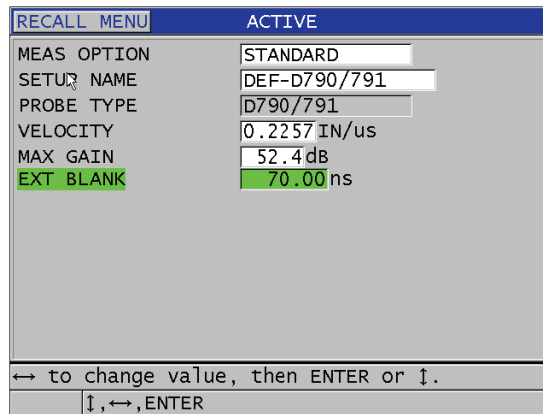**Figure 12-2 Example of the ACTIVE screen**

8. In the **SAVE SETUP** screen:
 - a) If needed, highlight **SAVE AS**, and then modify the setup name.
 - b) In the **SAVE TO** list, select the custom setup location where to save the setup.
 - c) Select **SAVE**.

9. Back in the **ACTIVE** screen, press **[MEAS]** to return to the measurement screen.

12.3 Recalling Stored Dual Element Transducer Setups

The 38DL PLUS allows you to store and recall setups for dual element transducers. Stored dual element transducer setups can also include calibration information like the velocity, the zero offset, the V-path, and the default gain. This feature makes it easy to change between different transducer setups designed for different applications.



CAUTION

Unsaved data will be lost when a different application setup is recalled. Save all changes made to the active setup before recalling another setup.

To recall a custom dual element transducer setup

1. Press **[XDCR RECALL]**.
2. In the menu, select **CUSTOM DUAL ELEMENT**.
3. In the **CUSTOM DUAL ELEMENT** screen, select the desired custom setup.
4. In the **ACTIVE** screen, review the setup parameters.
5. Press **[MEAS]** to return to the measurement screen with the recalled setup active.

12.4 About the V-Path

The V-path is the path along which the ultrasonic wave travels from one element to the other when using a dual element transducer. Since the V-path is slightly longer than twice the thickness, the instrument must calculate a compensation to measure the true thickness. Using a V-path correction allows the 38DL PLUS to measure thicknesses with the highest degree of accuracy and repeatability.

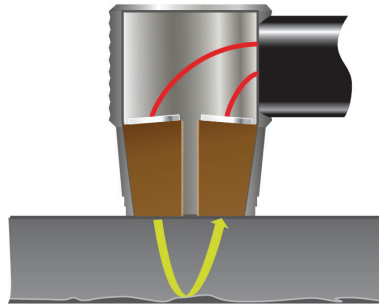


Figure 12-3 Illustration of the V-path

When you connect an Olympus standard D79X series dual element transducer, the 38DL PLUS automatically recognizes it and recalls the appropriate default setup and V-path correction. The 38DL PLUS also includes a function to build a custom V-path compensation for almost any other dual element transducer. This compensation curve is saved and recalled along with a custom setup.

12.4.1 Activating the V-Path Function

You need to activate the V-path function to be able to build a V-path correction curve.

To activate the V-path function

1. Press [SETUP MENU].
2. In the menu select **MEAS**.
3. In the **MEAS** screen, set **VPATH CAL ENABLE** to **ON**.
4. Press [MEAS] to return to the measurement screen.

12.4.2 Building a V-Path Correction Curve for a Nonstandard Dual Element Transducer

Creating a custom V-path requires a multi-step test block representing the thickness range and material to be tested (minimum and maximum thicknesses). You need to measure on at least three test block steps. You can use up to ten known thicknesses to generate a V-path correction curve. Using more V-path calibration points improves the accuracy of the measurements.

**IMPORTANT**

When using generic dual element transducers, you need to determine the exact thickness range over which you will measure. The minimum and maximum thicknesses are highly dependent on:

- Frequency of the transducer
 - Material being tested
 - Roof angle of the transducer
 - Delay material in the transducer
 - Signal noise in the transducer
-

**CAUTION**

Olympus cannot guarantee the accuracy or performance with non-D79X transducers. The user assumes all responsibility for assuring that the generic dual element transducer is performing properly and is suitable for the application.

To build a V-path correction for a nonstandard dual element transducer

1. Ensure that the transducer is not coupled to the test material and that there is no couplant on the tip to the transducer.
2. Press **[2nd F]**, **[CAL ZERO]** (**Do ZERO**) to perform the transducer zero calibration.
3. To ensure that the instrument properly detects echoes:
 - a) Press **[RANGE]** until the range value is higher than the maximum thickness of the test block.
 - b) Couple the transducer to the thickest test block step, and then press **[GAIN]** to adjust the gain so that the instrument properly detects the back-wall echo, and then ensure that there are no noise signals above 20 % of the screen height.

NOTE

The thickness readings at this point may not be accurate because a proper zero offset for the transducer has not yet been set.

- c) Couple the transducer to the thinnest test block step.
 - d) If necessary, press **[GAIN]** to adjust the gain so that the instrument properly detects the back-wall echo.
 - e) If necessary, adjust the extend blank so that the gage is making proper detection on the back-wall signal (see section 5.6.1 on page 77).
 - f) Ensure that the instrument properly detects echoes on all test block steps.
4. Activate the V-path function (see section 12.4.1 on page 214 for details).
 5. Couple the transducer to a thick sample representing the thickest material that you will measure.
 6. Press **[CAL VEL]**.
 7. In the help text bar, select **YES** to the **VPath Calibration?** prompt (see Figure 12-4 on page 216).



Figure 12-4 Answering YES at the V-path calibration prompt

8. While the transducer is coupled to the thick sample and getting a steady thickness reading, press **[ENTER]**.
9. In the **V-PATH CALIBRATION** screen, edit the point **1** value to match the known thickness (see Figure 12-5 on page 217).

V-PATH CALIBRATION				
ENTER VALUE FOR TEST BLOCK POINT 1				
1	2	3	4	5
0.500	--.---	--.---	--.---	--.---
6	7	8	9	10
--.---	--.---	--.---	--.---	--.---
NEXT TEST BLOCK POINT 2				
Then CAL VEL to measure next selected test block point or MEAS if done.				
↔=Move ↓=Select MEAS or ENTER=Done.				
↑, ↔, ENTER, MEAS, CAL VEL				

Figure 12-5 Editing point 1 of the V-path calibration

10. Press [CAL VEL].
11. Couple the transducer to the next thickest sample to get a steady thickness reading, and then press [ENTER].
12. In the **V-PATH CALIBRATION** screen, edit the value for the next point to match the known thickness.
13. Repeat steps 10 to 12 for the other thicknesses. You need a minimum of three points and a maximum of ten V-path calibration points.
14. When all known thickness values from all calibration points have been entered, press [MEAS].
15. At this point you can either press [CAL VEL] to view the V-path Calibration table.
OR
Save the V-path calibration as a custom dual element transducer setup:
 - a) Press [SAVE/SEND].
 - b) In the **SAVE SETUP** screen, enter the desired custom setup file name (see Figure 12-6 on page 218).

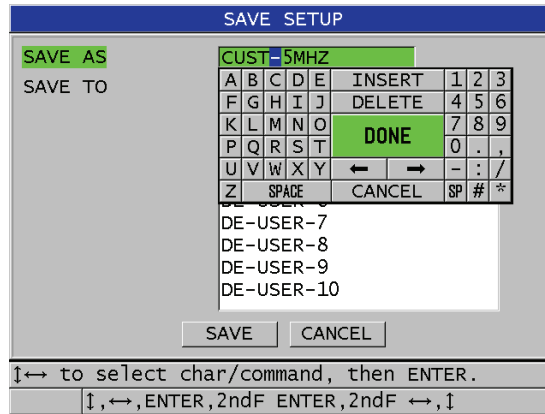


Figure 12-6 Saving the setup

- c) In the **SAVE TO** list, select a storage location.



CAUTION

DE-USER-X (where X = 1 to 10) represents an empty location. Selecting a custom setup location that already has a stored custom setup deletes and replaces the contents with the new custom dual element transducer setup.

- d) Select **SAVE** to save the custom setup.
- e) In the **ACTIVE** screen, review the parameters.
- f) Press **[MEAS]** to return to the measurement screen.
The new custom transducer is now the active setup and can be recalled from the list of custom dual element transducer setups.

13. About Custom Setups for Single Element Transducers

The 38DL PLUS includes predefined setups for standard single element transducers. In some cases, a 38DL PLUS ships from the factory preprogrammed with one or more custom setups to meet special customer requirements. You can create your own custom setups to meet the need of a particular single element transducer or for a particular application. With predefined and custom setups you can quickly change between transducer and application setups by selecting a previously saved setup.

Topics are as follows:

- Creating a Custom Setup for a Single Element Transducer (see section 13.1 on page 220)
- Quickly Adjusting Waveform Parameters For Single Element Transducers (see section 13.2 on page 222)
- About the Detection Modes (see section 13.3 on page 224)
- About the First Peak (see section 13.4 on page 226)
- About the Pulser Power (see section 13.5 on page 227)
- About the Time-Dependent Gain Curve (see section 13.6 on page 227)
- About the Main Bang Blank (see section 13.7 on page 230)
- About the Echo Window (see section 13.8 on page 231)
- Saving Setup Parameters (see section 13.9 on page 237)
- Quickly Recalling a Custom Setup for Single Element Transducers (see section 13.10 on page 238)

13.1 Creating a Custom Setup for a Single Element Transducer

You should create a custom setup when the measurement requirements of a particular application are not optimally met by one of the standard setups. Once adjustments are made, you can name and store this setup in one of the 35 user-defined setup locations.



CAUTION

The adjustments described in the following procedure and subsections should be made only by a qualified technician who is familiar with the basic theory of ultrasonic gaging and the interpretation of ultrasonic waveforms.

Many of the adjustments that you can make in a setup are interactive. All of them have an effect on the measurement range and/or measurement accuracy of the 38DL PLUS. In most cases, do not attempt adjustments without monitoring the waveform. Additionally, when establishing a custom setup for a specific application, it is essential to verify the performance on reference standards representing the materials and thickness range to measure.

To create a custom setup for a single element transducer

1. Connect the single element transducer to the 38DL PLUS (see section 5.1 on page 57).
2. Press [**XDCR RECALL**].
3. In the menu, select the **CUSTOM SINGLE ELEMENT**.
4. In the **CUSTOM SINGLE ELEMENT** screen, select the desired custom setup location (**SE-USER-n**) in which you wish to save the custom setup.

TIP

To reduce the number of changes to make to parameter values, you can also select an existing single element setup with parameter values that are close to the desired setup.

5. In the **ACTIVE** screen (see Figure 13-1 on page 221):
 - a) Set **DET MODE** to the desired detection mode (see section 13.3 on page 224 for details).

RECALL MENU	ACTIVE
DET MODE	MODE 1
SETUP NAME	SE-USER-1
MEAS TYPE	STANDARD
PROBE TYPE	M112
VELOCITY	0.2260 IN/us
ZERO VALUE	643.0
PULSER POWER	200 VOLTS
MAX GAIN	53.9 dB
INIT GAIN	35.9 dB
TDG SLOPE	1.07 dB/us
MB BLANK	0.25 us
ECHO WINDOW	199.65 us
ECHO 1 DETECT	-SLOPE
↔ to select, then ENTER or ↓.	
↑, ↔, ENTER	

Figure 13-1 The ACTIVE screen for the setup of a single element transducer

- b) Enter a **SETUP NAME** that describes the transducer and/or the application for which you create the setup.
- c) Set **MEAS TYPE** to the desired measurement type. The available choices are:
 - **STANDARD**: For normal mode 1, 2, or 3 positive or negative peak measurement.
 - **OXIDE LAYER** (optional): For simultaneous measurement of the thickness of a boiler tube and of its internal oxide layer with the oxide layer software option (see section 7.3 on page 89 for details).
 - **BARRIER LAYER** (optional): For thickness measurement of thin barrier layer materials in multilayer plastic with the multi-measurement software option (see section 7.4 on page 95 for details).
 - **FIRST PEAK**: For the detection of the first of several peaks of similar amplitudes (see section 13.4 on page 226 for details).
- d) Set **PROBE TYPE** to indicate the transducer type to be used with this setup. The selected probe type must match the frequency of the transducer being used for proper pulser/receiver performance.
- e) Set **VELOCITY** to the value of the sound velocity in the material to be tested with this setup (see section 5.2.4 on page 65).
- f) Set **ZERO VALUE** to the calibrated zero offset value (time of flight of the echo that is not traveling through the material) for this transducer (see section 5.2.1 on page 61).

- g) If needed, increase the **PULSER POWER** to increase the ultrasound wave penetration in the material. Reduce the value for better near surface resolution (see section 13.5 on page 227 for details).
 - h) Set **MAX GAIN** to the desired maximum gain value (see section 13.6.1 on page 228 for details).
 - i) Set **INIT GAIN** to the desired initial gain value (see section 13.6.2 on page 229 for details).
 - j) Set **TDG SLOPE** to the desired time-dependent gain slope value (see section 13.6.3 on page 229 for details).
 - k) Set **MB BLANK** to the desired main bang blank time interval (see section 13.7 on page 230 for details).
 - l) Set **ECHO WINDOW** to the desired time interval (see section 13.8 on page 231 for details).
 - m) Set **ECHO 1 DETECT** to **-SLOPE** to detect the negative peak of the first echo, or **+SLOPE** to detect the positive peak of the first echo (see section 13.8.1 on page 233 for details).
6. Press **[SAVE/SEND]**.
 7. In the **SAVE SETUP** screen:
 - a) If needed, in **SAVE AS**, edit the setup name.
 - b) In the **SAVE TO** list, select the desired custom setup location where you want to save the setup.
 - c) Select **SAVE**.
 8. Press **[MEAS]** to return to the measurement screen.
The saved setup becomes the active setup.

13.2 Quickly Adjusting Waveform Parameters For Single Element Transducers

With single element transducers, you can quickly adjust individual waveform parameters using the **[WAVE ADJ]** key.

To quickly adjust individual waveform parameters

1. Ensure that a single element transducer is connected to the 38DL PLUS.
2. From the measurement screen, press **[WAVE ADJ]**.
The waveform adjustment parameter appears on the measurement screen above the thickness value (see Figure 13-2 on page 223).

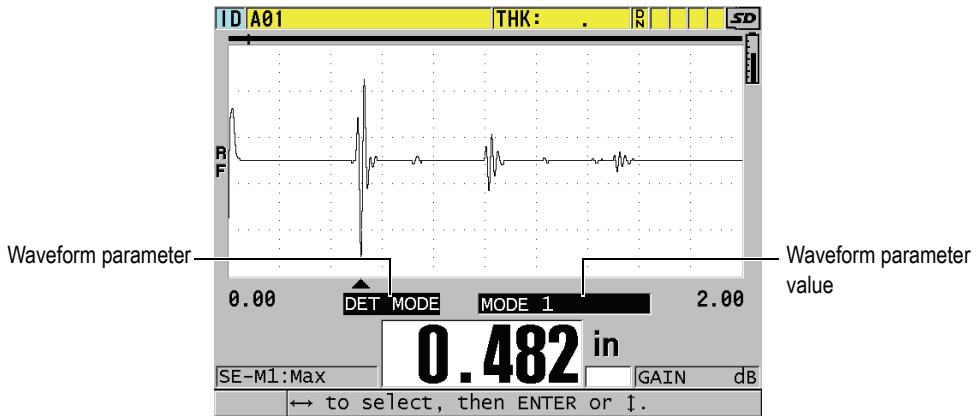


Figure 13-2 Adjusting the waveform parameters

3. Use the [**▲**] or [**▼**] key to select the parameter that you wish to adjust among the following:
 - **DET MODE** (see section 13.3 on page 224 for details)
 - **M3 BLANK** in mode 3 only (see section 13.8.3 on page 236 for details)
 - **IF BLANK** in mode 2 and 3 only (see section 13.8.2 on page 234 for details)
 - **ECHO 2 DETECT** in mode 2 and 3 only (see section 13.8.1 on page 233 for details)
 - **ECHO 1 DETECT** (see section 13.8.1 on page 233 for details)
 - **ECHO WINDOW** (see section 13.8.1 on page 233 for details)
 - **MB BLANK** (see section 13.7 on page 230 for details)
 - **TDG SLOPE** (see section 13.6.3 on page 229 for details)
 - **INIT GAIN** (see section 13.6.2 on page 229 for details)
 - **MAX GAIN** (see section 13.6.1 on page 228 for details)
 - **PULSER POWER** (see section 13.5 on page 227 for details)
 - **PROBE TYPE**
 - **MEAS TYPE** (see step 5.c in section 13.1 on page 220 for details)
4. Use the [**◀**] or [**▶**] keys to select the value for the selected parameter.
5. Repeat steps 3 and 4 to adjust other parameters.
6. Press [**WAVE ADJ**] again to hide the waveform adjustment parameter.

13.3 About the Detection Modes

There are three detection modes (**Mode 1**, **Mode 2**, and **Mode 3**):

Mode 1

Measures the time of flight between the main bang and the first back-wall echo using a direct contact transducer (see Figure 13-3 on page 224).

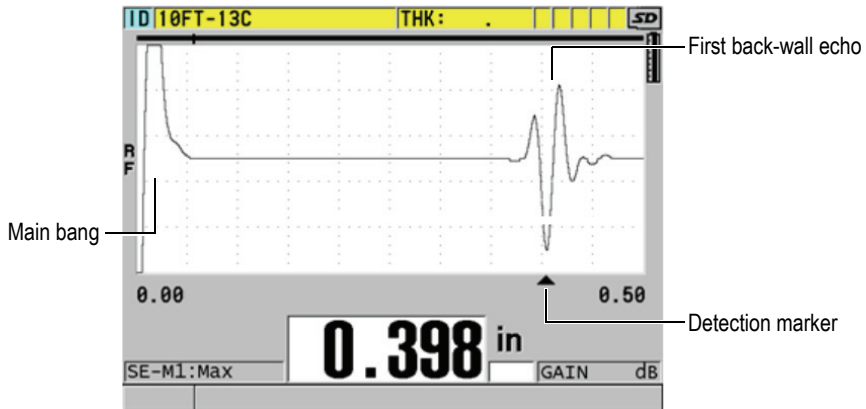


Figure 13-3 Mode 1 detection example

Mode 2

Measures the time of flight between the interface (or delay line) echo and the first back-wall echo using a delay line or an immersion transducer (see Figure 13-4 on page 225).

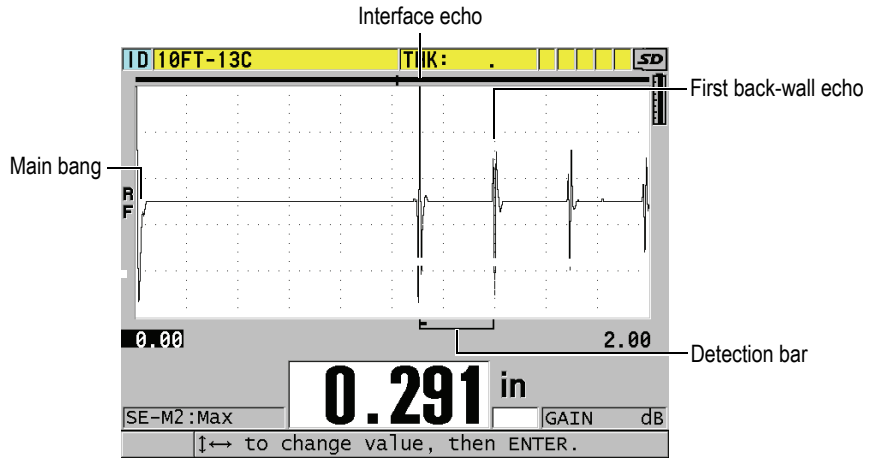


Figure 13-4 Mode 2 detection example

Mode 3

Measures the time of flight between one back-wall echo to the next back-wall echo using a delay line or an immersion transducer (see Figure 13-5 on page 225).

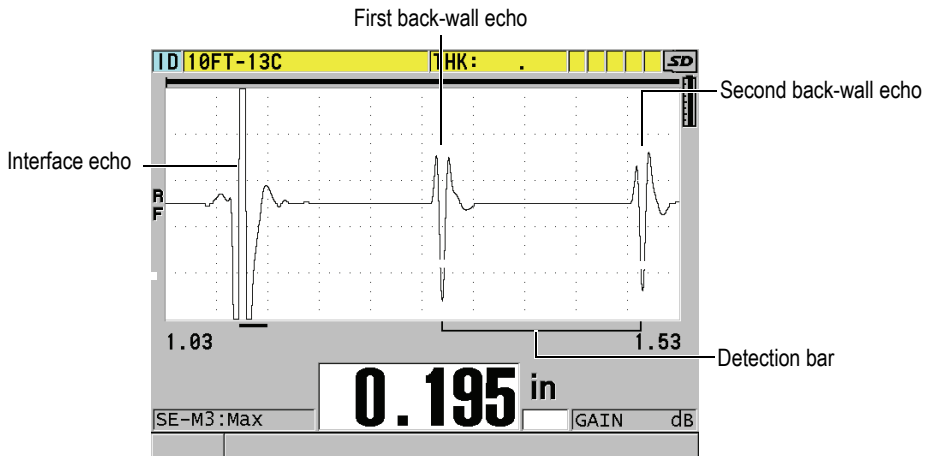


Figure 13-5 Mode 3 detection example

NOTE

Refer to section 13.8 on page 231 for information on the modes in relation with the echo window.

13.4 About the First Peak

With single element transducers, the 38DL PLUS normally detects peaks on either the highest positive or highest negative peak of the RF waveform. This feature works well for most precision thickness applications.

This normal peak detection can be unstable for applications in which the back-wall echo is irregular and contains several negative or positive peaks that are close in amplitude. In these cases, the thickness reading can fluctuate as the gage switches detection from one peak to another. This can happen for example in applications measuring the length of bolts or the thickness of gel coat over fiberglass (see Figure 13-6 on page 226). In these cases, to help stabilize the echo detection and thickness measurements, select the first peak algorithm to detect the first of several peaks of similar amplitudes (see step 5.c in section 13.1 on page 220).

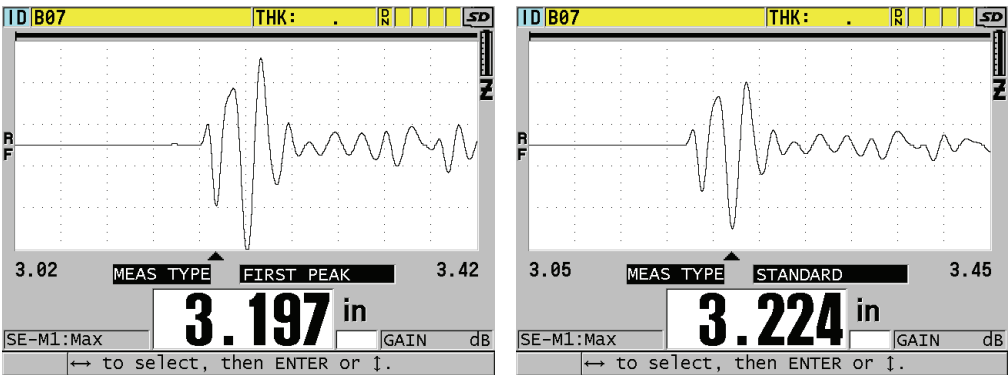


Figure 13-6 Detection of the first or the second negative peak

13.5 About the Pulser Power

You can set the excitation pulse (main bang) voltage to one of the following values: 60 V, 110 V, 150 V, and 200 V.

Higher voltages may provide greater penetration at the expense of a lower near-surface resolution, especially in mode 1. Inversely, lower voltages may provide better near-surface resolution at the expense of a lower penetration.

For most applications, the 110 V value provides the best signal-to-noise ratio for returning echoes. The pulser power indicates the voltage used to excite the transducer and therefore, affects the size of the initial pulse (see Figure 13-7 on page 227) and the amount of energy going into the material.

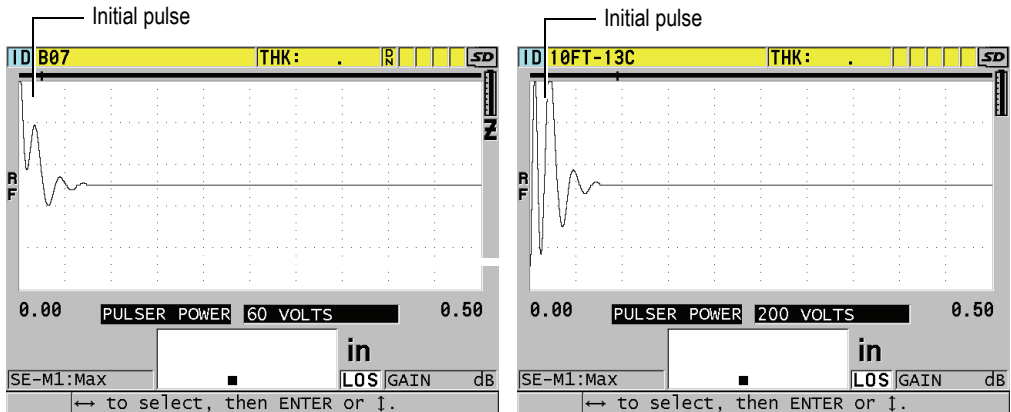


Figure 13-7 Comparing pulser power set to 60 V and 200 V

13.6 About the Time-Dependent Gain Curve

With single element transducers, the 38DL PLUS either uses the automatic gain control (AGC) [see section 9.1 on page 123 for details on how to activate the AGC] or the time-dependent gain (TDG) functions to automatically adjust receiver gain to an optimum level when an echo is detected.

The 38DL PLUS offers three parameters to draw a time-dependent gain curve: **INIT GAIN**, **TDG SLOPE**, and **MAX GAIN** (see Figure 13-8 on page 228). From the initial gain level, receiver gain slopes up to the maximum gain level at the rate determined

by the **TDG SLOPE** setting. When you adjust any of the received gain parameters, a black time-dependent gain curve is displayed so that you can clearly see the zones of initial gain, slope, and maximum gain.

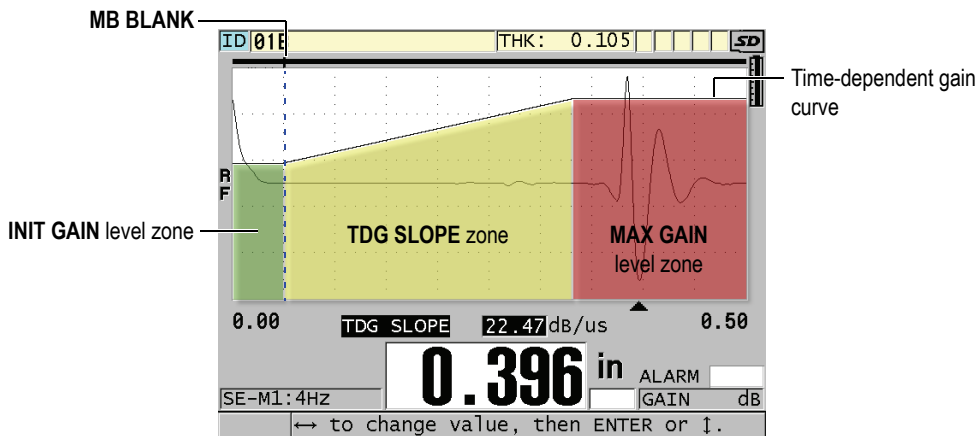


Figure 13-8 The TDG zones and parameters

You can use the TDG curve to optimize near-surface resolution while providing a higher maximum gain for thicker samples. You can also use the TDG curve in measurements of highly scattering materials, such as cast metals and fiberglass, to minimize detection of scattered echoes occurring ahead of the back-wall echo.

13.6.1 About the Maximum Gain

The maximum gain indicates the maximum (time-dependent) receiver gain possible. The maximum gain is used to amplify echoes that are further out in time. In general for a given application, you should set the maximum gain high enough so that all echoes of interest are detected.

You can adjust the maximum available receiver gain from 0.0 dB to 99.0 dB. When no echo is detected (LOS prompt), the gain rises to the maximum level set by the initial gain, slope, and maximum gain. When the maximum gain is set too high, the gage may hang up on transducer noise or other spurious signals; when it is set too low, returning echoes may not be high enough for detection.

NOTE

The max gain can never be lower than the initial gain and has a maximum value of 99.0 dB.

13.6.2 About the Initial Gain

The initial gain sets an upper limit on receiver gain in the vicinity of the excitation pulse (mode 1) or of the interface echo (modes 2 and 3). By effectively making the excitation pulse or interface echo smaller, the TDG curve allows detection of echoes occurring close to the pulse. You can adjust the initial gain from 0 dB to the maximum defined by the **MAX GAIN** setting.

The **INIT GAIN** setting is most critical in applications where minimum thickness measurements must be optimized. It should always be set with the aid of a reference standard representing that minimum. In cases where the minimum thickness capability is less important than penetration and scatter echoes are not a problem, you can set the initial gain equal to the maximum gain.

The initial gain does the following:

- Indicates the initial (time-dependent) receiver gain currently selected
- Amplifies echoes that are close to the Main Bang or interface echoes
- Starts at time zero and extends to:
 - the main bang blank in mode 1
 - the end of the interface blank in modes 2 and 3

13.6.3 About the TDG Slope

The TDG slope controls the rate at which the receiver gain slopes up from the initial gain level to the maximum gain level. The TDG slope starts at the position of the **MB BLANK** parameter in mode 1 and at the end of the **IF BLANK** parameter in mode 2 and mode 3. The TDG slope helps suppress reflections from grain structure or fibers. Generally, you should set the TDG slope as high as possible to reach the maximum gain as quickly as possible without having the gage hang up on spurious signals. You can set the slope from 0.0 dB/ μ s to 39.95 dB/ μ s.

13.7 About the Main Bang Blank

The main bang blank is effectively a blank zone that protects the receiver from false readings generated by the main bang. This blank or dead zone (up to 18 microseconds) prevents the detection of the trailing edge echoes of the excitation pulse as if they were back-wall or interface echoes. The end of the main bang blank indicates the point in time where the gage begins to search for echoes.

In general, set the main bang blank just beyond the point where the gage hangs up, and then test with the transducer both coupled to and uncoupled from the test material to ensure accurate measurements.

In mode 1, however, the length of the main bang blank determines the minimum thickness that can be measured, and it must be positioned with care after selecting the initial gain level (see Figure 13-9 on page 230). When the main bang blank is too short, the instrument hangs up on the excitation pulse and readings are not possible. When the main bang blank is too long, the minimum measurable thickness is unnecessarily restricted. When using immersion transducers, ensure that the main bang blank is always set before the interface echo from the shortest water path.

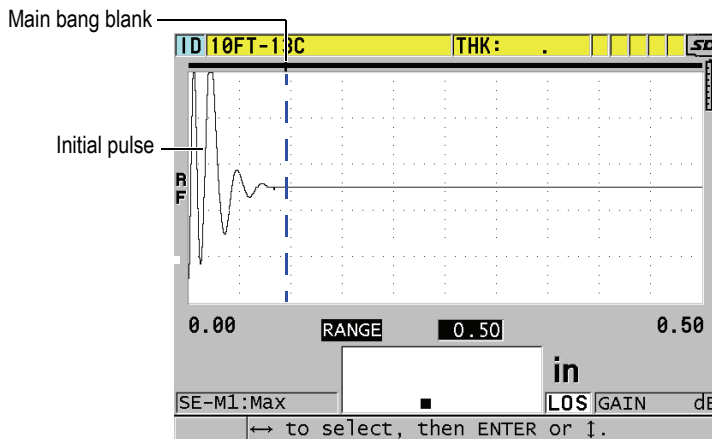


Figure 13-9 Main bang blank position for mode 1

In mode 2 and mode 3, the setting of the main bang blank is not critical when set at some point between the end of the excitation pulse and the interface echo (see Figure 13-10 on page 231).

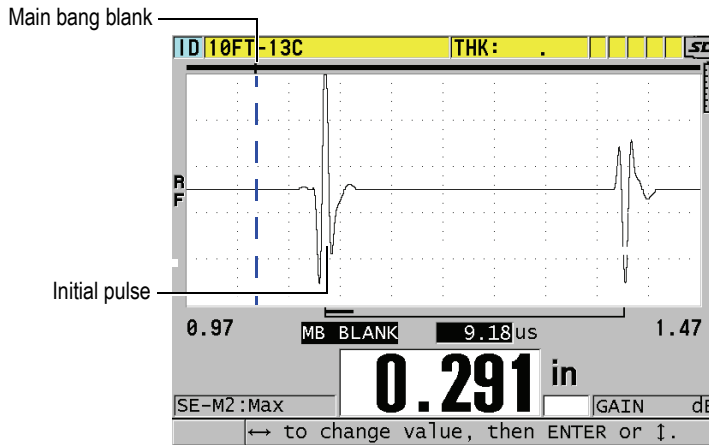


Figure 13-10 Main bang blank position for mode 2 and mode 3

13.8 About the Echo Window

The echo window is the time interval after each main bang during which the instrument is enabled to detect echoes. The echo window interval begins at the end of the main bang blank. The echo window ends $x \mu\text{s}$ following the main bang in mode 1, or $x \mu\text{s}$ following the interface blank in mode 2 and mode 3.

In mode 1, you can usually set the echo window to any value greater than the round-trip pulse transit time in the thickest or slowest piece of material to be measured (see Figure 13-11 on page 232). The exact setting is not critical as long as it is long enough to include the farthest echo of interest.

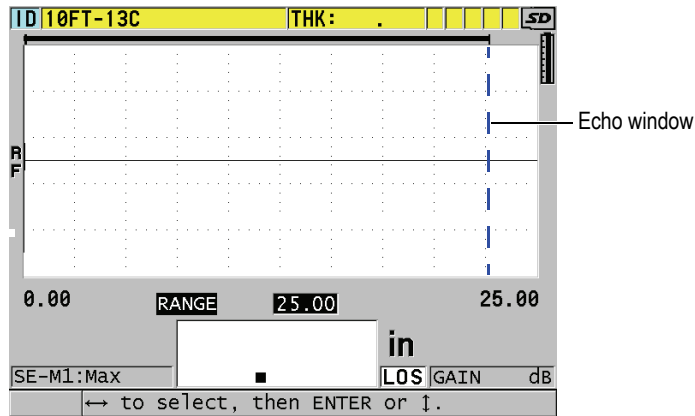


Figure 13-11 Echo window setting for mode 1

In mode 2 and mode 3, the echo window is limited to the time interval between successive interface echoes (see Figure 13-12 on page 232). The end of the echo window must be set ahead of the second interface echo to prevent an incorrect detection, which in turn determines a maximum measurable thickness. In applications involving mode 2 and mode 3 immersion measurements, the echo window placement must apply throughout the range of the water paths to be used.

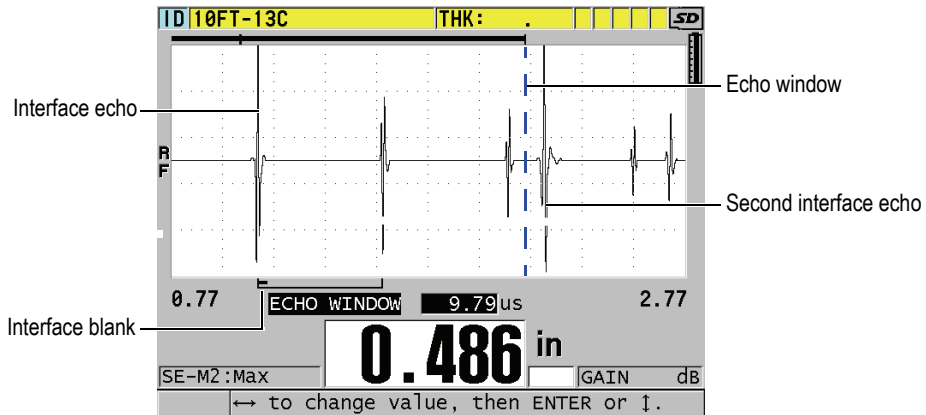


Figure 13-12 Echo window setting for mode 2 and mode 3

13.8.1 About the Detection of Echo 1 and Echo 2

You can select the detection polarity (positive or negative) for the first and second echoes. Depending on the measurement mode and on the type of test material, the maximum amplitude in an echo can either be a positive or negative peak. Positive and negative polarity refer to processed echoes displayed on the waveform display (see Figure 13-13 on page 233). To measure thicknesses with the highest accuracy, it is important that the 38DL PLUS detects the maximum amplitude peak in an echo.

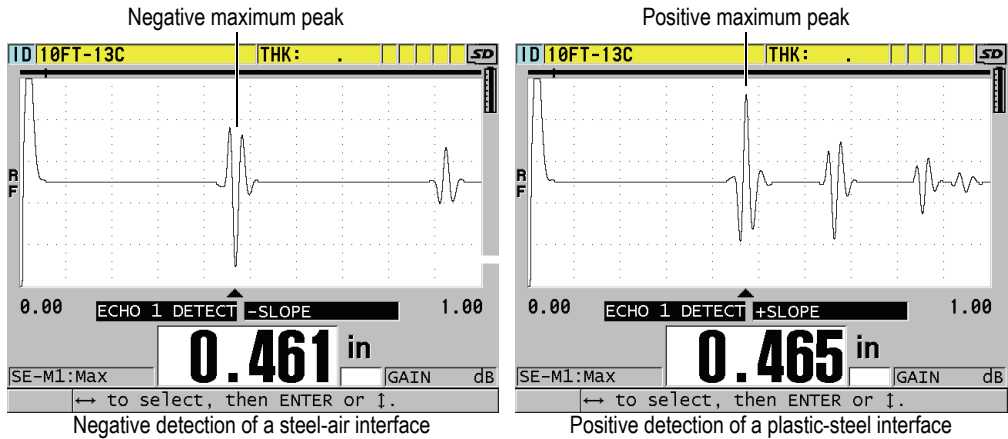


Figure 13-13 Negative and positive echo detection examples

Refer to Table 22 on page 234 to help you decide which detection polarity to select for a given application.

Table 22 Polarity of echoes

Measurement mode	Echo 1	Echo 2
Mode 1 using contact transducer	Back-wall echo normally negative except when measuring material of low acoustic impedance bonded to a material of high impedance (such as plastic or rubber over metal), where the echo is phase-reversed.	Not applicable
Mode 2 using delay line or immersion transducers	Interface echo normally positive for high-impedance materials such as metals and ceramics, and negative for low-impedance materials such as most plastics.	Back-wall echo normally negative unless the back-wall echo represents the sort of low-to-high impedance boundary.
Mode 3 using delay line or immersion transducers	Interface echo normally positive for high-impedance materials.	Back-wall echo normally negative except in some special cases involving difficult geometries where phase distortion may cause the positive side of the back-wall echo to be better defined than the negative side.

13.8.2 About the Interface Blank

The interface blank represents a blank or dead zone up to 20 μs long that follows the leading edge of the interface echo. The interface blank is only available in mode 2 and mode 3.

In mode 2, the interface blank prevents the detection of trailing lobes or cycles of the interface echo, which might otherwise be detected as back-wall echoes, resulting in a hang-up condition (see Figure 13-14 on page 235). The interface blank should be set as short as possible to avoid unnecessarily restricting minimum measurable thicknesses.

The initial gain parameter often helps reduce the interface echo amplitude and permits the use of a shorter interface blank. Check the interface blank settings with the transducer both coupled to and uncoupled from the test material.

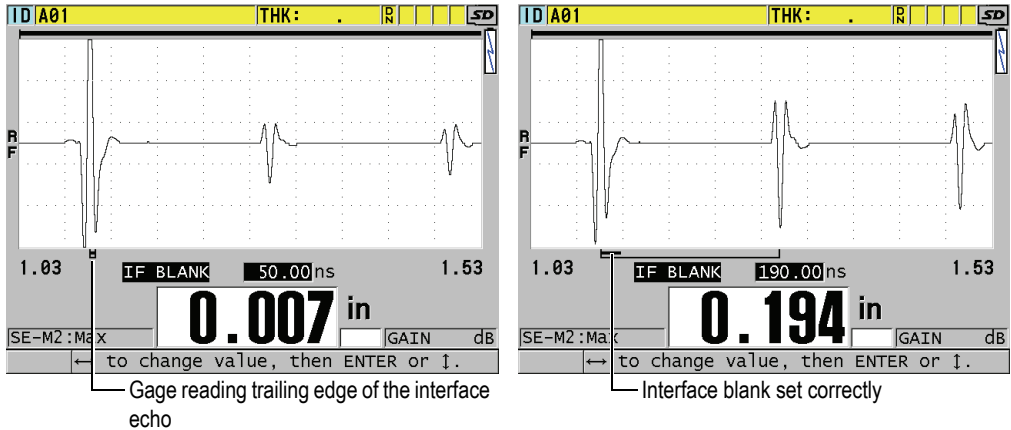


Figure 13-14 Examples of the interface blank in mode 2

In mode 3, the interface blank selects which pair of back-wall echoes are measured (see Figure 13-15 on page 236). In most conditions, the interface blank would be set just short of the first back-wall echo. However, as a practical matter, the first back-wall echo from thin materials is often distorted or lost in the interface echo. With some challenging geometries (such as tight radii), later pairs of back-wall echoes may be cleaner than early ones. In these cases, set the interface blank to a length that ensures detection of a clean and well-defined pair of back-wall echoes, even if echoes are not the first two.

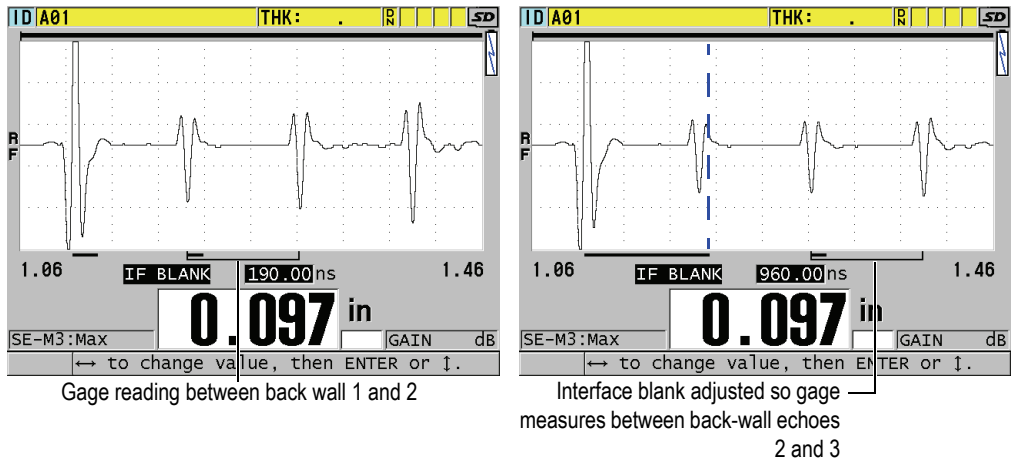


Figure 13-15 Examples of the interface blank in mode 3

13.8.3 About the Mode 3 Echo Blank

The echo blank in mode 3 (**M3 BLANK**) is similar to the interface blank in mode 2 or to the main bang blank in mode 1. This function creates a blank or dead zone up to 20 μ s long following the leading edge of the first detected back-wall echo, to prevent detection of trailing lobes or cycles of that echo and the resulting gage hang-up (see Figure 13-16 on page 237).

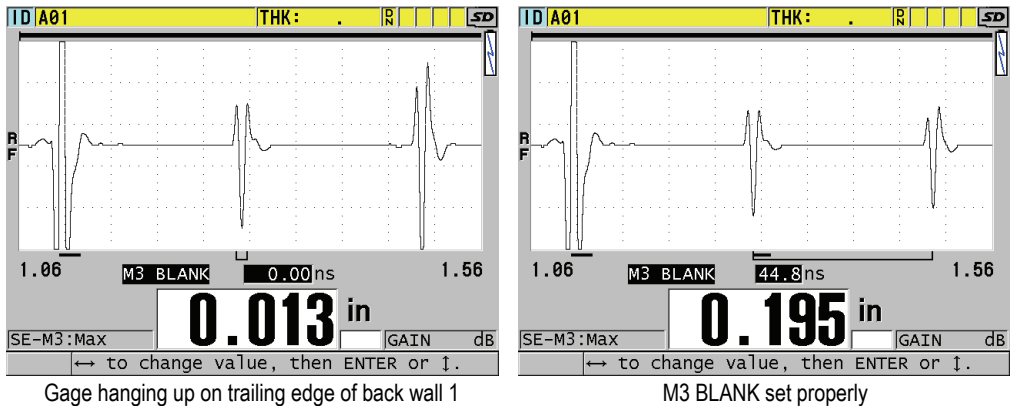


Figure 13-16 Examples of M3 Blank adjustment

Because the mode 3 echo blank limits minimum measurable thicknesses, set the controls as short as possible; typically no longer than a few hundred nanoseconds. Special cases may be an exception where mode conversion effects on curved samples cause significant spurious signals between legitimate echo peaks; in such cases set the mode 3 echo blank as long as necessary to prevent detection of the spurious signals.

13.9 Saving Setup Parameters

After adjusting selected waveform parameters, you can store the settings for a quick and easy recall. The 38DL PLUS can store up to 35 custom setups in its internal memory.

To save setup parameters

1. Make the appropriate changes to the waveform parameters.
2. Press [XDCR RECALL].

In the menu, ensure that **ACTIVE** is highlighted. The changes that you made are located in the active setup.

3. Press [SAVE/SEND].
4. In the **SAVE SETUP** screen (see Figure 13-17 on page 238).
 - a) In **SAVE AS**, enter a name for the custom setup.

- b) In the **SAVE TO** list, select one of the 35 available custom setup location.



CAUTION

Setups named **SE-USER-1** through **SE-USER-35** are empty locations. Use caution when selecting a location that already contains a custom setup because the new setup will replace the old information.

- c) Select **SAVE** to save the custom setup.

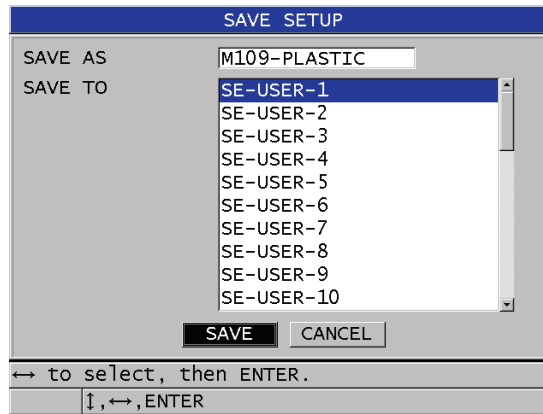


Figure 13-17 Saving custom setups

5. In the **ACTIVE** screen, review the setup parameters.
6. Press **[MEAS]** to return to the measurement screen.

13.10 Quickly Recalling a Custom Setup for Single Element Transducers

Normally, you can change the setup for a custom application by pressing **[RECALL XDCCR]** to select the appropriate setup in the list of available setups, and then press **[MEAS]**. This process is adequate for typical setups that are changed infrequently. However, when it is necessary to frequently change between two or more custom setups, rather use the quick setup recall function.

When the quick setup recall function is activated, you can use a simple keypad shortcut to quickly switch to any of the first four custom setups for single element transducers.

To activate the quick setup recall function

1. From the measurement screen, press **[SETUP MENU]**.
2. In the menu, select **MEAS**.
3. In the **MEAS** screen, set **QUICK SETUP RECALL** to **ON**.
4. Press **[MEAS]** to return to the measurement screen.

To quickly recall one of the four first custom setups

- ◆ While in measurement screen with the quick setup recall function activated, press **[2nd F], [▲]** to recall the first custom single element transducer setup.
OR
Press **[2nd F], [▶]** to recall the second custom single element transducer setup.
OR
Press **[2nd F], [▼]** to recall the third custom single element transducer setup.
OR
Press **[2nd F], [◀]** to recall the fourth custom single element transducer setup.

NOTE

This feature only works when a single element transducer is plugged into the 38DL PLUS.

14. Managing Communications and Data Transfer

This section describes how the 38DL PLUS can communicate with a computer or a printer to send, receive, import, and export files. The 38DL PLUS has two communication ports: USB and RS-232.

The 38DL PLUS comes standard with a USB cable for communicating using the USB 2.0 protocol. You must purchase an optional RS-232 cable (see Table 23 on page 244) to use RS-232 communication. The 38DL PLUS can send data to any device capable of receiving ASCII-formatted data using the RS-232C/D protocol. This includes personal computers, minicomputers, dataloggers, and printers. The data cable must be compatible with the 38DL PLUS output connector and the serial input connector of the receiving device. Olympus supplies cables for computers and serial printers and provides assistance with connecting to any other equipment.

NOTE

When communicating directly to a printer, the 38DL PLUS will only work with RS-232 serial printers.

14.1 About GageView

GageView is the Olympus interface program designed to communicate with instruments such as the 38DL PLUS. GageView provides the capability to create inspection database files, upload and download data files, and generate reports. Olympus recommends to use GageView to communicate with the 38DL PLUS and to manage 38DL PLUS data.

GageView is compatible with Windows 2000, XP, Vista, and Windows 7. For more details, refer to the *GageView Interface Program – User’s Manual* (P/N: 910-259-EN [U8778347]).

14.2 Setting Up USB Communication

The default communication protocol for the 38DL PLUS is USB 2.0. The 38DL PLUS can also be set to use RS-232 serial communication (see section 14.3 on page 243).

To set up the USB communication

1. Ensure that the 38DL PLUS driver is installed on the computer.
This driver is installed when you install the GageView interface program.

NOTE

For more information on installing GageView, refer to the *GageView Interface Program – User’s Manual* (P/N: 910-259-EN [U8778347]).

2. If you use a communication program other than GageView, refer to the program documentation to properly configure the program for USB communication.
3. Turn the 38DL PLUS on.
4. From the measurement screen, press **[SETUP MENU]**.
5. In the menu, select **COMM**.
6. In **COMM** screen, set **CONNECTION TYPE** to **USB**.
7. Press **[MEAS]** to return to the measurement screen.
8. Connect one end of a USB cable to the USB client connector under the I/O door of the 38DL PLUS, and the other end to a USB port of the computer (see Figure 14-1 on page 243).

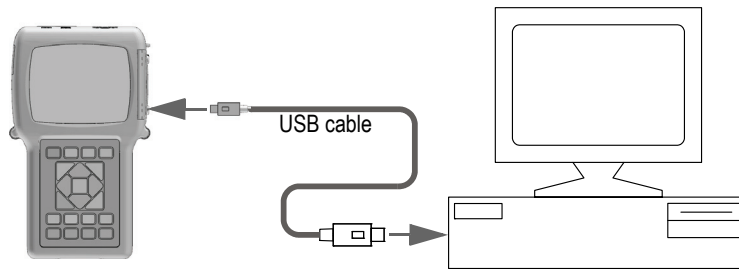


Figure 14-1 Connecting the 38DL PLUS to a computer

The first time that you connect the 38DL PLUS to this computer, the computer prompts you that a new hardware device has been detected and asks if you would like to install the driver. Refer to the *GageView Interface Program — User's Manual* (P/N: 910-259-EN [U8778347]) for more information.

The driver loads, and then you can start to use a program such as GageView to communicate with the 38DL PLUS.

TIP

If you experience problem to establish the communication between the 38DL PLUS and a remote device, consider using the 38DL PLUS communication reset function to return all communication parameters to the default values (see section 14.7 on page 258), and then reconfigure only needed communication parameters.

14.3 Setting Up RS-232 Serial Communication

The 38DL PLUS can transmit stored data and displayed readings over its input/output (I/O) RS-232 cable to any device with a RS-232 serial interface. The 38DL PLUS can also receive and execute commands sent from any device with a serial interface. Such devices include personal computers and printers.

To enable the 38DL PLUS to communicate with another RS-232 serial device, you must use the correct cable. Since all computers do not have the same serial port connector, the correct cable must be ordered from Olympus. The RS-232 cable is an option for the 38DL PLUS, which you can specify at the time of order (see Table 23 on page 244).

Table 23 Optional RS-232 cables

I/O cable part number	Computer serial port connector	Cable length	Typical device
36DLP-9F6	"D" Type, 9-pin male	6 ft. (2 m)	Windows computer
36DLP-PR6	"D" Type, 25-pin female	6 ft. (2 m)	Serial printer

The serial communication parameter configuration must be the same in both the 38DL PLUS and the other device. In the 38DL PLUS, the baud rate is selectable (1200, 2400, 4800, 9600, 19200, 38400, 57600, and 115200) while the other RS-232 parameter are fixed:

- Word length = 8 characters
- Stop Bits = 1
- Parity = None

To set up the RS-232 serial communication

1. Refer to the receiving device hardware and software documentation, and set the receiving device serial communication parameters to values supported by the 38DL PLUS:
 - a) Set the baud rate to 1200, 2400, 4800, 9600, 19200, 38400, 57600, or 115200.
 - b) Set the stop bits to 1.
 - c) Set the parity to none.
2. On the 38DL PLUS, from the measurement screen, press **[SETUP MENU]**.
3. In the menu, select **SYSTEM**.
4. In **SYSTEM** screen, set **SAVE/SEND KEY** to **SEND**.
5. Press **[SETUP MENU]**.
6. In the menu, select **COMM**.
7. In the **COMM** screen (see Figure 14-2 on page 245):
 - a) Set **CONNECTION TYPE** to **RS-232**.
The RS-232 parameters appear.
 - b) Set **RS-232 DEVICE** to match the type of device to which you connect the 38DL PLUS:
 - **PRINTER**: when connecting to serial printers.
 - **TERMINAL**: when connecting to computers.

- **BAR CODE:** when connecting to the Olympus bar code reader (P/N: 38DLP/BCW/NC [U8780289]).
 - **CALIPER:** when connecting to the Olympus caliper (P/N: HPV/C [U8780124]).
 - **FISCHER:** when connecting to the Fischer coating gage.
- c) Set **BAUD RATE** to the same value selected in step 1.a.
- d) Set **CONTINUOUS OUTPUT MODE** to one of the following options:
- **OFF:** Continuous output is off (default value).
 - **ON:** Continuously sends data at the selected measurement rate (see section 4.6 on page 54).
 - **5 SEC AVERAGE:** Sends one averaged thickness reading every 5 seconds.
 - **10 SEC AVERAGE:** Sends one averaged thickness reading every 10 seconds.

SETUP MENU	COMM
COMM PROTOCOL	MULTI CHAR
OUTPUT FORMAT	F1
DATABASE TRACKING	<input type="radio"/> OFF <input type="radio"/> ON
B-SCAN OUTPUT	<input type="radio"/> OFF <input type="radio"/> ON
37DL PLUS OUTPUT	<input type="radio"/> OFF <input type="radio"/> ON
CONNECTION TYPE	RS-232
RS-232 DEVICE	TERMINAL
BAUD RATE	19200
CONTINUOUS OUTPUT MODE	OFF

↔ to select, then ENTER or ↓.

↑, ↔, ENTER

Figure 14-2 Viewing communication parameters

8. Using the appropriate RS-232 cable (see Table 23 on page 244), connect the 38DL PLUS to the remote serial communication device.
9. If needed, on the remote serial communication device, start the serial communication program.
10. Press **[MEAS]** to return to the measurement screen.

TIP

If you experience problem to establish the communication between the 38DL PLUS and a remote device, consider using the 38DL PLUS communication reset function to return all communication parameters to the default values (see section 14.7 on page 258) and reconfigure only needed communication parameters.

14.4 Exchanging Data with a Remote Device

You can exchange 38DL PLUS data with a remote device such as a computer or a printer.

NOTE

Data transmitted from the 38DL PLUS remains in the 38DL PLUS internal memory.

14.4.1 Sending Entire Files (RS-232)

You can send a single or multiple files from the 38DL PLUS to a computer or printer. The data that is transmitted includes the file name, the file header, ID numbers, thickness data, flags, calibration setups, and notes.

To send entire files from the 38DL PLUS to a computer or printer

1. Ensure that the RS-232 communication parameters are configured correctly (see section 14.3 on page 243).
2. From the measurement screen, press **[FILE]**.
3. In the menu, select **SEND**.
4. In the **SEND** screen (see Figure 14-3 on page 247):
 - a) Use the **[◀]** and **[▶]** keys to select to send **ALL** files or only **SELECTED** files. When you select **ALL**, in the file list, a check mark appears on the right of all files.
 - b) When you select **SELECTED**, you can individually select the files to send:
 - (1) Set **SORT BY** to the desired sort option (**NAME** or **DATE CREATED**).

- (2) In the file list, highlight each file, and then press **[ENTER]** to toggle the file transfer check mark so that only files you wish to send have a check mark on the right.
 - (3) Press **[2nd F]**, **[▼]** to leave the file list.
- c) Select the **SEND** button at the bottom of the screen.
- The **Accessing storage. Please wait** message appears on the help text bar while the data is transferred.

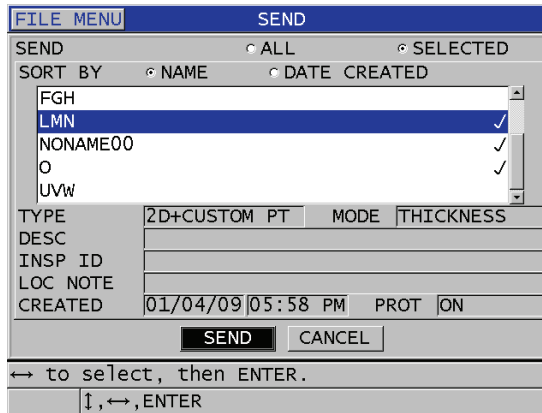


Figure 14-3 Selecting a file to send

14.4.2 Sending an ID Range from a File (RS-232)

The 38DL PLUS allows you to only transmit a portion of a given file to a computer or to a printer.

To send a specific range of ID numbers from a specific file

1. Ensure that the RS-232 communication is configured correctly (see section 14.3 on page 243).
2. Open the file that contains the data to be transmitted, if the desired file is not already the active file (see section 11.3.1 on page 182).
3. From the measurement screen, press and hold **[SAVE/SEND]**, until the **ID - RANGE SEND** screen opens.

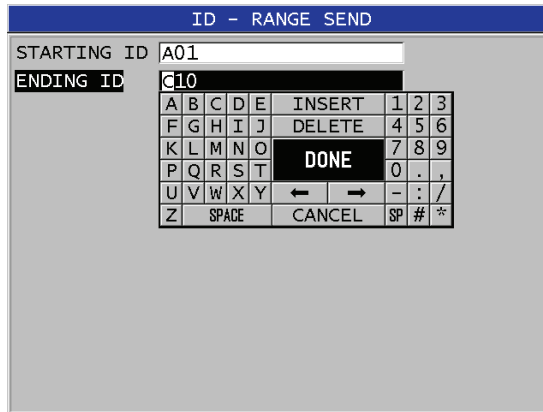


Figure 14-4 Identifying a range of ID numbers to send

4. Enter the **STARTING ID** and the **ENDING ID** of the desired range of ID numbers that you want to transmit.
5. Select **SEND**.
The gage transmits the data for the specified range.

14.4.3 Sending the Currently Displayed Measurement (RS-232)

You can transmit the current displayed measurement data only. This function is useful when the 38DL PLUS is continuously connected to an external device (printer, data collector, or computer) and you need to collect only data on command.

To perform a single send

1. Ensure that the RS-232 communication is configured correctly (see section 14.3 on page 243).
2. Setup the desired measurement screen on the 38DL PLUS.
3. Make a thickness reading.
4. Press **[SAVE/SEND]** briefly (release in less than one second).

The displayed measurement data with its appropriate setup flags is transmitted and the instrument returns to the original measurement screen.

NOTE

The specific data transmitted depends on the datalogger output format. Pressing **[SAVE/SEND]** while the thickness display is blank sends “—.—” and the displayed flags.

NOTE

Sending a displayed reading blanks a held reading, resets the minimum or maximum function, and releases a frozen waveform.

14.4.4 Exporting a File to the External Memory Card

The 38DL PLUS has the ability to export files from the internal memory to the external microSD memory card. You can export the files in CSV (comma separated variables), text (space delimited), or in survey (used by the GageView interface program) format. Using a microSD card reader, you can then open these files directly on your computer in Microsoft Excel, or any other program. You can import survey files in GageView from the microSD card reader.

You can send your user-defined transducer setups to the GageView interface program to save a copy of these setups on a computer. You can also send these transducer setups back to the 38DL PLUS (see section 14.4.5 on page 250). This procedure allows you to easily set up multiple 38DL PLUS instruments with the same custom transducer setup.

To export files to the external memory card

1. Ensure that a microSD memory card is inserted in its slot under the I/O door on the right side of the 38DL PLUS (see Figure 1-5 on page 19).
2. If you inserted the microSD memory card while the 38DL PLUS was turned on, turn the 38DL PLUS off, and then back on so that it recognizes the presence of the memory card.
3. From the measurement screen, press **[FILE]**.
4. In the menu, select **EXPORT**.

5. In the **EXPORT** screen (see Figure 14-5 on page 250):
 - a) If needed, change the **SORT BY** parameter to change how files are sorted in the file list.
 - b) In the file list, highlight the file that you want to export.
 - c) Set **FILE** to the desired file format:
 - **SURVEY FILE**: to be imported in GageView
 - **EXCEL CSV**: to be opened in Microsoft Excel
 - **TEXT FILE**: to be opened in many Windows-based programs
6. Select **EXPORT**.
 The selected file is created in the following folder on the external microSD memory card: \OlympusNDT\38DLP\Transfer.
 The instrument automatically returns to the measurement screen.

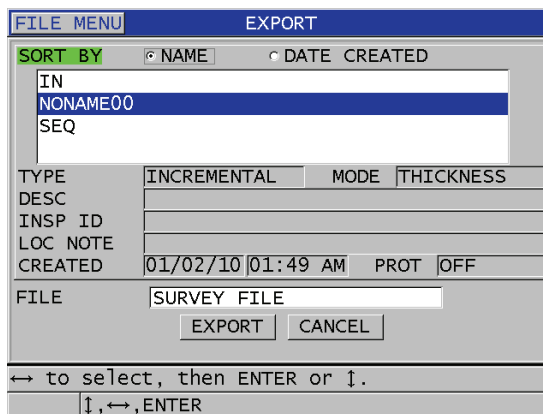


Figure 14-5 The EXPORT screen

14.4.5 Importing Survey Files from the External Memory Card

You can import a survey file from the external microSD memory card to the 38DL PLUS internal memory. You can use this function in conjunction with the GageView interface program to import survey files that have been exported from GageView to a microSD card. This feature allows you to import files in the 38DL PLUS while the instrument is in the field and cannot be connected to a computer.

To import survey files from the external memory card

1. Ensure that the \OlympusNDT\38DLP\Transfer folder on your external microSD memory card contains the file that you wish to import in the 38DL PLUS internal memory.
2. Insert the microSD memory card in its slot under the I/O door on the right side of the 38DL PLUS (see Figure 1-5 on page 19).
3. If you inserted the microSD memory card while the 38DL PLUS was turned on, turn the 38DL PLUS off, and then back on so that it recognizes the presence of the memory card.
4. From the measurement screen, press **[FILE]**.
5. In the menu, select **IMPORT**.
6. In the **IMPORT** screen (see Figure 14-6 on page 251):
 - a) Select the file to import in the list of available files.
The listed files are those found in the \OlympusNDT\38DLP\Transfer folder on the external microSD memory card.
 - b) Select **IMPORT**.
 - c) When a file with the same name already exists in the 38DL PLUS, the **Overwrite existing file?** message appears. When you still want to import the file, select **YES**.
A beep confirms the end of the file transfer and the instrument returns to the measurement screen.

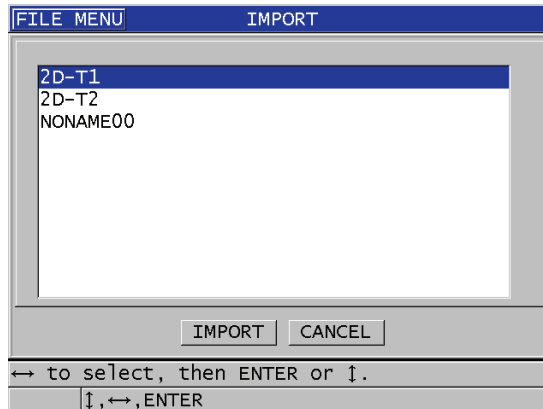


Figure 14-6 Example of the IMPORT screen

14.4.6 Receiving Files from a Computer

The same type of datalogger information, which you can send to a computer, can also be received or downloaded from a computer into the instrument. There are two benefits:

- At the next survey date, months, or years later, retrieve to the gage previously saved thickness survey data stored in a computer file with ID numbers. You can use this retrieved data for the following purposes:
 - To guide you through the measurement sequence using the ID numbers.
 - To compare current values, at the measurement site, with previously measured thickness values.
 - To manually or automatically verify that the current measurement setup is identical to the previously used setup.
- Create ID number sequences in a computer, and then download them to the instrument. This externally created sequence can guide you through the prescribed measurement location path. The ID sequence created in the computer must have setup information. The setup can be the gage default setups or any other desired sequence of setups.

The data downloaded to the 38DL PLUS must be in the same precise format in which data is transmitted. Olympus recommends using the GageView interface program to handle all functions of interfacing, storing, and creating 38DL PLUS data. Please contact Olympus for information on additional software data management programs.

To receive a data file from a computer

1. When using GageView or another program to send the file from the computer using the USB port, set the USB communication parameters and connect the 38DL PLUS to the computer (see section 14.2 on page 242).
2. When using a program to send the file from the computer using the RS-232 port, set the RS-232 communication parameters and connect the 38DL PLUS to the computer (see section 14.3 on page 243).
3. Turn on the 38DL PLUS and ensure that the measurement screen is active.
4. On the computer, begin sending formatted data.
The 38DL PLUS displays a **RECEIVING DATA** screen while the data is sent, and then returns to the measurement screen.

14.5 Capturing 38DL PLUS Screen Images

You can save a snapshot of the full 38DL PLUS screen contents to an image file. This function is useful when you need an exact replica of the display for reporting or documentation purposes. You can do this using one of the following two methods:

- Sending a Screen Capture to GageView (see section 14.5.1 on page 253)
- Sending a Screen Capture to the External microSD Card (see section 14.5.2 on page 255)

14.5.1 Sending a Screen Capture to GageView

You can send the full 38DL PLUS screen contents to the GageView interface program.

Refer to the *GageView Interface Program — User's Manual* (P/N: 910-259-EN [U8778347]) for information on how to install and use GageView.

To send a screen capture to GageView

1. Set the USB communication parameters, and then connect the 38DL PLUS to the computer (see section 14.2 on page 242).
2. On the 38DL PLUS, select the screen that you wish to capture.
3. On the computer, start GageView.
4. In GageView, perform the following tasks only the first time that you connect the 38DL PLUS to GageView on this computer:
 - a) On the GageView menu, select **Device > Config**.
 - b) In the **Device Configuration** dialog box (see Figure 14-7 on page 254):
 - (1) In the **Device List**, select 38DL PLUS, and then click **Add**.
38DL PLUS (USB) appears in the **Current Configured Devices** list.
 - (2) Select the **Connect at Startup** check box so that GageView automatically attempts to connect to the 38DL PLUS when it starts.
 - (3) Click **OK**.

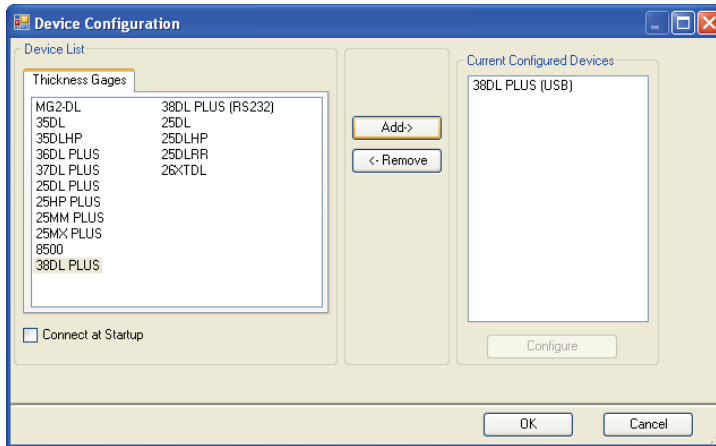


Figure 14-7 The Device Configuration dialog box

5. In GageView, perform the following tasks:
 - a) On the menu, select **Device > Tools**.
 - b) In the **Device Tools** dialog box (see Figure 14-8 on page 255), select **Screen Capture**, and then click **Receive**.
The screen image appears when the data transfer completes.
 - c) Click **Copy** to copy the screen capture to the Windows clipboard.
OR
Click **Save** to save the image as a BMP file to a folder and file name of your choice.

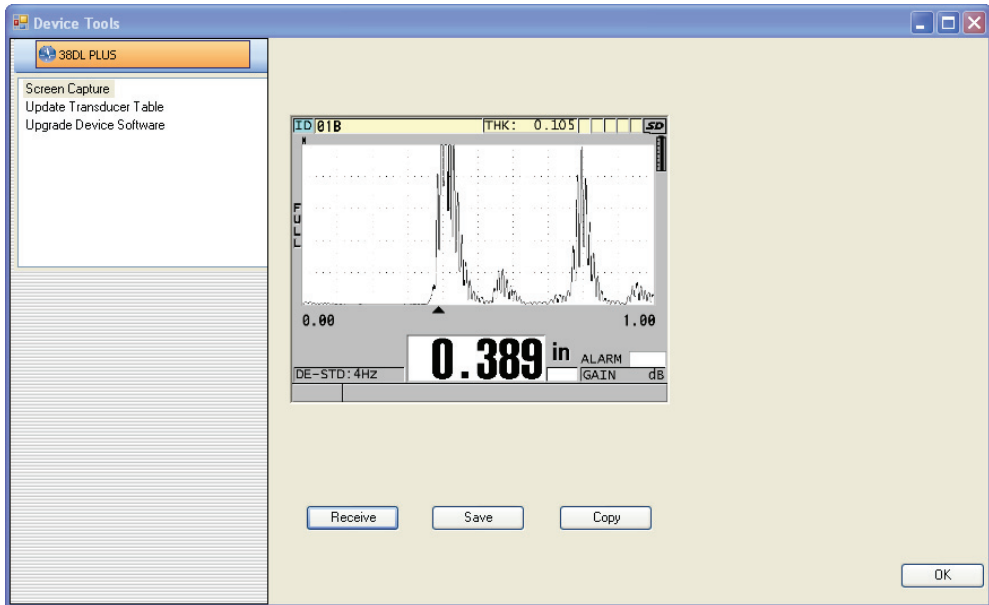


Figure 14-8 The Device Tools dialog box with a screen capture

14.5.2 Sending a Screen Capture to the External microSD Card

The 38DL PLUS has the ability to copy the contents of the current screen to the external microSD card. The screen shot is saved as a bitmap (.bmp) file. You can then connect the microSD card to a computer and open the file in any program that can view bitmap (.bmp) files.

To send a screen capture to the external microSD card

1. Ensure that a microSD memory card is inserted in its slot under the I/O door on the right side of the 38DL PLUS (see Figure 1-5 on page 19).
2. If you inserted the microSD memory card while the 38DL PLUS was turned on, turn the 38DL PLUS off, and then back on so that it recognizes the presence of the memory card.
3. Ensure that the function to save a screen capture to the microSD card is enabled:
 - a) From the measurement screen, press [SETUP MENU].
 - b) In the menu, select **SYSTEM**.

- c) Set **PRINT SCREEN TO SD CARD** to **ON**.
4. Select the screen that you wish to capture.
5. Press **[2nd F]**, **[DISPLAY]**.
The screen freezes for about 20 seconds as the file is being sent to the following folder on the external memory card: \OlympusNDT\38DLP\Snapshot.
The screen shots are automatically named BMP*n*.bmp where *n* starts at 0 and is incremented by one each time a new screen shot is added.
6. To transfer the image file:
 - a) Remove the microSD memory card from its slot in the 38DL PLUS.
 - b) Using a microSD card reader, connect the memory card to a computer.
 - c) Copy the file from the \OlympusNDT\38DLP\Snapshot folder on the card to the desired folder on the computer.

14.6 RS-232 Serial Data Output Formats

The 38DL PLUS supports 10 output formats for RS-232 transmitted data. Output formats vary depending whether you are using a dual element transducer or a single element transducer. Table 24 on page 256 and Table 25 on page 257 describe the contents of each format for dual element transducers or a single element transducers respectively.

NOTE

For USB communications, the output format is normally set to F1.

Table 24 Serial data output format for dual element transducers

Format	File header	ID header	Thickness table	Wave-forms	Setup table	Note table
F1	✓	✓	✓	✓	✓	✓
F2	✓	✓	✓		✓	✓
F4				✓		
F5		✓	✓	✓	✓	✓
F6		✓	✓		✓	✓
F7		✓	✓	✓	✓	

Table 24 Serial data output format for dual element transducers (continued)

Format	File header	ID header	Thickness table	Wave-forms	Setup table	Note table
F8		✓	✓		✓	
F9		✓	✓	✓	✓	✓
F10		✓	✓		✓	✓

Table 25 Serial data output format for single element transducers

Format	File header	ID header	Thickness table	Wave-forms	Setup table	Note table
F1	✓	✓	✓	✓	✓	✓
F2	✓	✓	✓		✓	
F4				✓		
F5		✓	✓	✓	✓	
F6		✓	✓		✓	
F7		✓	✓	✓	✓	
F8		✓	✓		✓	
F9		✓	✓	✓	✓	✓
F10		✓	✓		✓	

To view or change the current output file format

1. From the measurement screen, press [SETUP MENU].
2. In the menu, select **COMM**.
3. In **COMM** screen, view or change the **OUTPUT FORMAT** value (see Table 24 on page 256 and Table 25 on page 257 for a description of the formats).

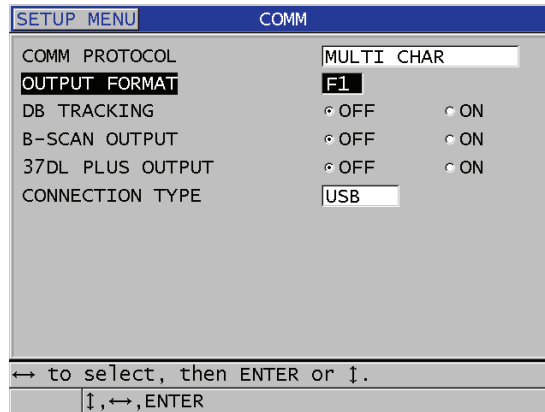


Figure 14-9 Viewing or changing the file output format

4. Press [MEAS] to return to the measurement screen.

14.7 Resetting the Communication Parameters

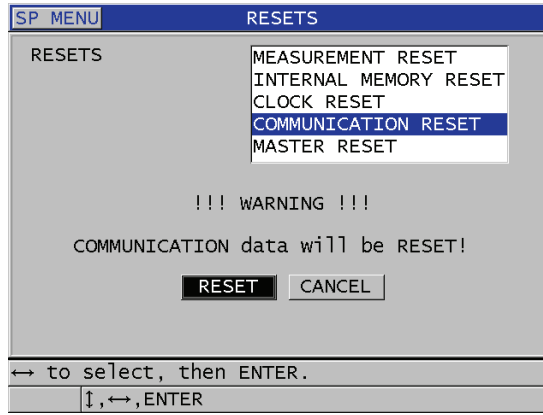
The communication reset function quickly returns communication parameters to the factory default values. This function may be useful when you experience difficulties to establish the communication with a remote device. Table 26 on page 258 gives the default values for the communication parameters.

Table 26 Default communication parameter values

Parameter	Value
COMM PROTOCOL	MULTI CHAR
OUTPUT FORMAT	F1
DATABASE TRACKING	OFF
B-SCAN OUTPUT	OFF
37DL OUTPUT	OFF
CONNECTION TYPE	USB

To reset the communication parameters

1. Press [2nd F], [SETUP MENU] (SP MENU).
2. In the menu, select **RESETS**.
3. In the **RESETS** screen (see Figure 14-10 on page 259):
 - a) In the **RESETS** list, select **COMMUNICATION RESET**.
 - b) Select **RESET**.

**Figure 14-10 Selecting the COMMUNICATION RESET**

15. Maintaining and Troubleshooting the 38DL PLUS

This section describes how to maintain your 38DL PLUS by applying routine care and maintenance.

Topics are as follows:

- Providing Routine Gage Maintenance (see section 15.1 on page 261)
- Cleaning the Instrument (see section 15.2 on page 262)
- Maintaining Transducers (see section 15.3 on page 262)
- Using Instrument Resets (see section 15.4 on page 263)
- Performing Hardware Diagnostic Tests (see section 15.5 on page 265)
- Performing the Software Diagnostic Test (see section 15.6 on page 267)
- Viewing the Instrument Status (see section 15.7 on page 268)
- Understanding Error Messages (see section 15.8 on page 269)
- Resolving Battery Pack and Charger Problems (see section 15.9 on page 269)
- Resolving Measurement Problems (see section 15.10 on page 270)

15.1 Providing Routine Gage Maintenance

The 38DL PLUS case is sealed to prevent intrusion of environmental liquids and dust when the I/O door is closed. However, the instrument should never be immersed in any fluid.

The 38DL PLUS case is designed to withstand normal field use. However, as with any electronic instrument, damage is possible if not handled with some care. Observe the following instructions in particular:

- Never press a key with a hard or sharp object.

- When connecting cables to the instrument, first align the connector with the mating receptacle on the instrument (dual element D79X series transducer center pin is down, and the RS-232 I/O cable key tab facing down), then carefully insert the connector straight into the receptacle.
- When disconnecting cables from the instrument, first grasp the connector (not the cable), and then gently pull it out.
- Do not throw or drop the instrument.
- Do not use strong solvents or abrasives to clean the rubber boot, case, keypad, and display screen.

15.2 Cleaning the Instrument

First, clean the instrument with a dry damp cloth. If necessary, after closing the I/O door and the connector dust flap, use a wet damp cloth with a mild detergent to wash the instrument. Dry the instrument before using it.

15.3 Maintaining Transducers

The ultrasonic transducers used with the 38DL PLUS are rugged devices that need little care. However, they are not indestructible, and some attention to the following items result in the longer life span.

- Make high-temperature measurements only with suitable high temperature transducers. Standard transducers can be damaged or destroyed if put in contact with surfaces hotter than approximately 125 °F (52 °C).
- Cutting, pinching, or pulling the cables causes damage to the cables. Be careful to prevent mechanical abuse to the cables. Never leave a transducer where a heavy object can be placed on the cable. Never remove a transducer from the gage by pulling on the cable; pull on the molded connector only. Never tie a knot in the transducer cable. Do not twist or pull the cable at the point where it connects to the transducer.
- Excessive wear at the tip of the Transducer degrades its performance. To minimize wear, do not scrape or drag the transducer across rough surfaces. Operating the transducer may become erratic or impossible when a transducer tip becomes rough or cracked. Although some wear is normal, severe wear limits transducer life. Take particular care with plastic delay line transducers; replace worn delay lines.

15.4 Using Instrument Resets

The 38DL PLUS includes reset functions to quickly restore the gage to its default parameters. Resets are useful shortcuts to known configurations. The reset functions are:

MEASUREMENT RESET

Changes the measurement parameters to the default factory values listed in Table 27 on page 263.

Table 27 Measurement default settings

Parameter	Default value
Measurement mode with differential	Fast, min, max, and alarms turned off
Material sound velocity	0.2350 in./s or 5.969 mm/s (approximate velocity of the included test blocks)
Differential reference value	0.0 in. or 0.0 mm
Low alarm reference value	0.0 in. or 0.0 mm
High alarm reference value	25.0 in. or 635.0 mm
Display update rate	4 per second
Zoom	Off
Range	Minimum range
LOS condition	Blank thickness display
Resolution	0.001 in. or 0.01 mm

INTERNAL MEMORY RESET

Deletes all stored data on the internal microSD memory card and reformats the card.



CAUTION

The internal memory reset permanently deletes all stored thickness readings/waveforms that are stored in the memory card. However, this reset does not delete any stored transducer setups.

CLOCK RESET

Resets the date to 01/01/2010 in the MM/DD/YYYY format and the time to 12:00AM in the 12-hour format.

COMMUNICATION RESET

Changes the communication settings to the default factory values listed in Table 28 on page 264.

Table 28 Default communication settings

Parameter	Default value
COMM PROTOCOL	Multi Character
OUTPUT FORMAT:	F1
DATABASE TRACKING	Off
B-SCAN OUTPUT	Off
37DL PLUS OUTPUT	Off
CONNECTION TYPE	USB

MASTER RESET

Performs the measurement reset and the internal memory reset in one step.



CAUTION

The master reset permanently deletes all stored thickness readings/waveforms that are stored in the internal memory card of the 38DL PLUS.

To activate a reset function

1. Press **[2nd F]**, **[SETUP MENU]** (SP MENU).
2. In the menu, select **RESETS**.
3. In the **RESETS** screen (see Figure 15-1 on page 265):
 - a) In the **RESETS** list, highlight the desired reset function.
A warning message appears, indicating the type of data that will be reset.
 - b) Select **RESET**.

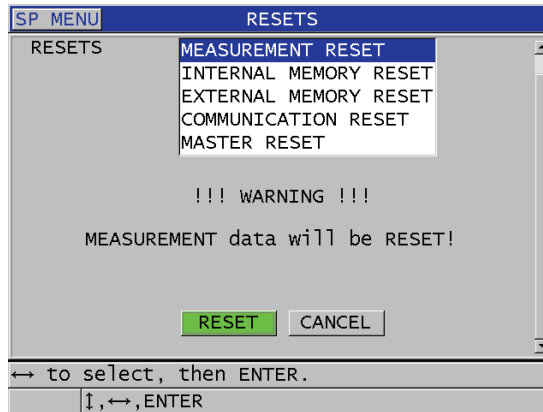


Figure 15-1 Activating a reset function

15.5 Performing Hardware Diagnostic Tests

The 38DL PLUS includes a function to perform several diagnostic self tests. The tests can help in localizing a suspected hardware problem or to verify correct hardware operation. Some tests are designed for Olympus internal testing procedures during the manufacturing process.

The available tests are:

- Keypad test
- Video test
- Internal microSD card test (Pass or Fail)
- External microSD card test (Pass or Fail)
- Dual element transducer test
- ESS Test (Electronic Stress Screening) [for Olympus internal use only]
- B-scan Test (for Olympus internal use only)
- Battery Test (for Olympus internal use only)
- One-wire test (for Olympus internal use only)

To perform a diagnostic test

1. Press [2nd F], [SETUP MENU] (SP MENU).

2. In the menu, select **TESTS**.
3. In the **TESTS** screen, select the desired test, and then press **[ENTER]**.
4. When **KEYPAD TEST** is selected, in the **KEYPAD TEST** screen (see Figure 15-2 on page 266)
 - a) Test any key by pressing it on the keypad.
When that specific key is working correctly, the instrument displays the name of the key in the last key pressed box.
 - b) Press **[ENTER]** to terminate the keypad test.

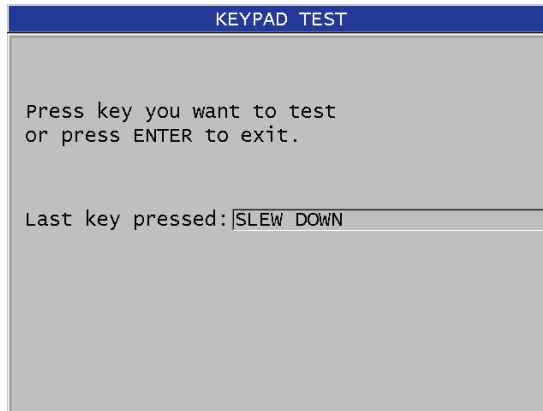


Figure 15-2 The KEYPAD TEST screen

5. When **VIDEO TEST** is selected:
 - a) In the **VIDEO TEST** screen, press **[DISPLAY]** to start the video test.
The display shows three vertical color strips that darken to black. Any problems with the display show up as a disruption of the pattern.
 - b) Press **[ENTER]** to terminate the video test.
6. When **INTERNAL SD CARD TEST** or **EXTERNAL SD CARD TEST** is selected, in the **INTERNAL SD CARD TEST** or **EXTERNAL SD CARD TEST** screen:
 - a) Press **[DISPLAY]** to start the test.
The test result appears in **SD Card Test Status**. The possible results are:
 - **PASS**: indicates that the card is functioning properly.
 - **FAIL**: indicates that there is a problem with the memory card. When the external card fails, re-install or replace the card, and then restart the instrument. When the internal card fails, contact Olympus for service.

- b) Press **[ENTER]** to terminate the **SD CARD** test.
7. When **DUAL XDCR TEST** is selected, in the **DUAL XDCR TEST** screen (see Figure 15-3 on page 267):
- a) Press **[DISPLAY]** to start the test which measures the time of flight through each side of a dual element transducer.
The measured parameter values appear.
- b) Interpret the **Tx** and the **Rx** values as follows:
- Similar values indicate a normal dual element transducer.
 - A difference between the values indicates that the delay line wear is not the same for each element.
 - A missing value indicates that a cable is broken or that the element is not functioning.
- c) You can note the calculated **ZERO VALUE**.
- d) Press **[ENTER]** to terminate the dual element transducer test.

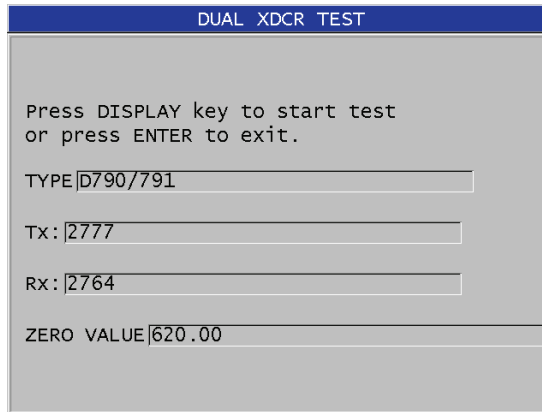


Figure 15-3 The DUAL XDCR TEST screen


15.6 Performing the Software Diagnostic Test

The software diagnostic (**SW DIAG**) function presents a log of errors that occurred during instrument operation. Olympus uses this information to troubleshoot the operating software.

To assess the software diagnostic

1. Press [2nd F], [SETUP MENU] (SP MENU).
2. In the menu, select **SW DIAG**.

The **SW DIAG** screen appears, showing the log of errors (see Figure 15-4 on page 268).

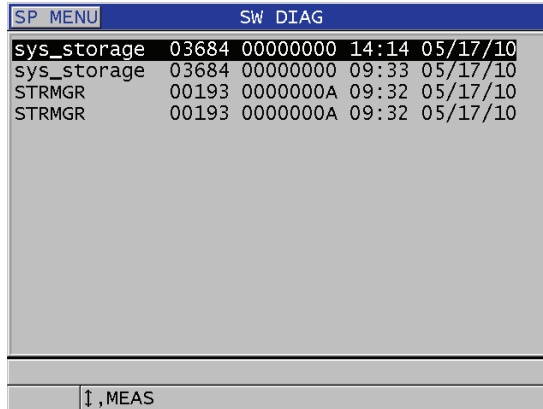

The screenshot shows a terminal window with a blue header bar containing 'SP MENU' and 'SW DIAG'. Below the header, there is a log of errors with the following text:

sys_storage	03684	00000000	14:14	05/17/10
sys_storage	03684	00000000	09:33	05/17/10
STRMGR	00193	0000000A	09:32	05/17/10
STRMGR	00193	0000000A	09:32	05/17/10

At the bottom of the screen, there is a grey bar with the text '↑,MEAS'.

Figure 15-4 Example of the SW DIAG screen

3. Press [MEAS] to return to the measurement screen.

15.7 Viewing the Instrument Status

The **STATUS** screen lists important information about the instrument. The status screen shows the following information:

- Current instrument internal temperature
- Current battery charge level
- Instrument model
- Software release date (build date)
- Software version
- Hardware version
- Options code (S/N) to be communicated to Olympus for software option activation

To view the instrument status

1. Press [2nd F], [SETUP MENU] (SP MENU).
2. In the menu, select **STATUS** (see Figure 15-5 on page 269).

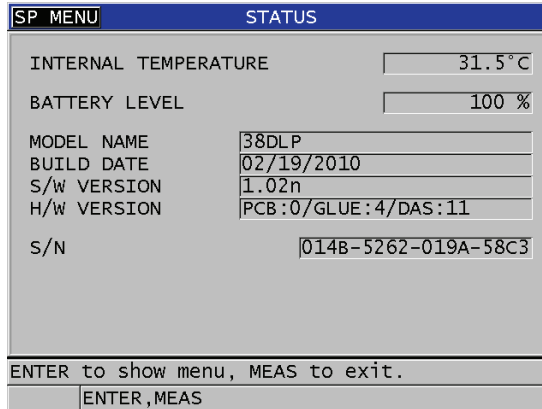


Figure 15-5 Example of the STATUS screen

3. Press [MEAS] to return to the measurement screen.

15.8 Understanding Error Messages

When operating the gage, certain error messages may appear. Usually these messages indicate a problem with the operating procedure, but some might indicate a physical problem with the gage itself. If you do not understand an error message, contact Olympus for assistance.

15.9 Resolving Battery Pack and Charger Problems

The power indicator (in the upper-right corner of the display) shows bars that indicate the percentage of remaining battery charge level. When the charge level becomes low, the gage automatically turns off. If the gage turns off immediately after you turn it on or if you cannot turn it on, the battery pack is probably depleted.

After recharging the battery pack (see section 2.3.2 on page 28), you may need to replace the battery if the instrument only operates when the charger is connected.

NOTE

The battery is designed to withstand several hundred discharge-recharge cycles before failing.

The power indicator only shows the remaining charge level when the charger is not connected to the instrument.

If you are still unable to turn on the instrument after the charger is connected for several minutes, the instrument or the charger may be at fault.

15.10 Resolving Measurement Problems

Table 29 Measurement troubleshooting

Symptom	Possible explanation
No or weak echoes, no measurement (LOS)	<ul style="list-style-type: none">• Insufficient couplant, especially on rough or curved surfaces• Gain set too low• Material is too attenuating or surfaces are not parallel or are too rough.• Gage requires service, try the master reset.• The echo is too low in amplitude to be detected. Try increasing the gain.
Strong echoes, no measurements	<ul style="list-style-type: none">• The echo may be in a blank area of the waveform and cannot be detected.• The echo is outside of the echo window.

Table 29 Measurement troubleshooting (continued)

Symptom	Possible explanation
Strong echoes, incorrect measurements	<ul style="list-style-type: none">• Out of calibration; perform calibration.• Differential mode — check DIFF flag.• Min or Max mode — see section 8.2 on page 112.• Material is too grainy, has flaws, inclusions or laminations, or very high surface noise; try manual gain adjustment or extended blank.

Appendix A: Technical Specifications

Table 30 General EN15317 Specifications

Parameter	Value
Size	Height x Width x Depth Without protective boot: <ul style="list-style-type: none"> • 8.33 in. x 5.04 in. x 1.82 in. • 211.6 mm x 128.1 mm x 46.2 mm With the rubber protective boot: <ul style="list-style-type: none"> • 9.30 in. x 5.14 in. x 2.62 in. • 236.2 mm x 130.6 mm x 66.5 mm
Weight	1.80 lb (816.5 g)
Power supply types	AC-DC adaptor 24 V Lithium-ion battery 24.42 Wh Five AA auxiliary batteries
Probe sockets types	Dual LEMO with center pin IP67
Battery operating time Lithium-ion	12.6 hours minimum 14 hours typical 14.7 hours maximum
Operating temperature	With Lithium-ion battery: 14 °F to 122 °F (–10 °C to 50 °C)
Battery storage temperature	–4 °F to 104 °F (–20 °C to 40 °C)
Battery indicator	8-step battery charge level indication Flashing low-battery warning
Pulse repetition frequency (PRF)	1 kHz Burst Measurement rates: 4 Hz, 8 Hz, 16 Hz, 20 Hz, and 30 Hz
Alarm indicators	Visual high-alarm and low- alarm indicators with audio tone

Table 30 General EN15317 Specifications (continued)

Parameter	Value
Thru coating	Echo-to-echo measurement and THRU-COAT
Minimum and maximum thickness	Single element: 0.004 in. to 25 in. (0.1 mm to 635.0 mm) Dual element: 0.020 in. to 25 in. (0.5 mm to 635.0 mm)

Table 31 Display EN15317 Specifications

Parameter	Value
Type	Color graphical TFT, LCD, 640 x 480 pixels
Size	[Height] x [Width], [Diagonal] 2.21 in. x 2.94 in., 3.68 in. (56.16 mm x 74.88 mm, 93.6 mm)

Table 32 Transmitter EN15317 Specifications

Parameter	Value
Transmitter pulse	Adjustable square wave pulser
Pulser voltage	Pulse voltages: 60 V, 110 V, 150 V, and 200 V
Pulse rise time	Damping in: 5 ns typical Damping out: 3.5 ns typical (pulse width dependent)
Pulse duration	Adjustable to probe frequency

Table 33 Receiver EN15317 Specifications

Parameter	Value
Gain control	Automatic or manual: 0 dB to 99 dB
Frequency range	0.5 MHz to 24 MHz typical (filter dependent)

Table 34 Other EN15317 Specifications

Parameter	Value
Data storage	Internal and external 2 GB microSD memory cards. Each card: 475000 thickness readings or 20000 waveforms with thickness readings
Data output types	2.0 USB client RS-232 Removable microSD memory card
Calibration setting storage	Default single and dual element transducer setups 35 custom single element and 10 custom dual element storage locations
Calibration	Single or two-point calibration test block Velocity can be entered manually. Multi-points for custom V-path calibration with dual element transducers
Display response time	Adjustable 4 Hz, 8 Hz, 16 Hz, 20 Hz, and 30 Hz
Number of pixels to display a waveform	640 x 480 pixels
Printer output	RS-232 serial

Table 35 Environmental rating specifications

Parameter	Value
IP rating	Designed for IP67
Explosive atmosphere	MIL-STD-810F, Section 511.4, Procedure I
Shock test	MIL-STD-810F, Section 516.5, Procedure I
Vibration test	MIL-STD-810F, Section 514.5, Procedure I
Drop test	MIL-STD-810F, Section 516.5, Procedure IV- Transit Drop

Table 36 Measurement specifications

Parameter	Value
Measurement modes	<p>Standard dual element: Time between excitation pulse and first back-wall echo using dual element transducer.</p> <p>Dual echo-to-echo: Time between successive back-wall echoes using dual element transducers.</p> <p>Thru-coat: Time between excitation pulse and first back-wall echo while ignoring or displaying a coating thickness.</p> <p>Mode 1: Time between excitation pulse and first echo following blank period using contact transducers.</p> <p>Mode 2: Time between the interface echo and the first back-wall echo. Normally used with delay line or immersion transducers.</p> <p>Mode 3: Time between a pair of back-wall echoes following the interface echo. Normally used with delay line or immersion transducers.</p>
V-path correction	Automatic or manually created, dependent on transducer type
Measurement resolution	Selectable from the keypad: LOW: 0.01 in. (0.1 mm) STD: 0.001 in. (0.01 mm) HI: 0.0001 in. (0.001 mm) with high resolution option. Not all resolutions are available for all measurement modes
Material sound velocity range	0.0300 in./ μ s to 0.5511 in./ μ s (0.762 mm/ μ s to 13.999 mm/ μ s)
Material sound velocity resolution	0.0001 in./ μ s (0.001 mm/ μ s)
Alarm set points range	0.00 in. to 25.00 in. (0.00 mm to 635.00 mm)

Table 37 Datalogger Specifications

Parameter	Value
Storage capacity	475000 thickness readings or 20000 waveforms with thickness readings
ID number length	1 to 20 characters
File name length	1 to 32 characters

Table 37 Datalogger Specifications (continued)

Parameter	Value
File formats	Incremental Sequential (defined by starting and ending ID number) Sequential with custom points 2-D grid 2-D grid with custom points 3-D grid 3-D custom Boiler
External memory card	microSD memory card 2 GB maximum capacity

Table 38 Typical measurement ranges and default setups for single element transducer^a

Setup name	Transducer	Typical measurement range
DEFM1-20.0-M116	M116	Steel: 0.020 in. to 1.500 in. (0.250 mm to 8.000 mm)
DEFM1-10.0-M112	M112	Steel: 0.030 in. to 10.000 in. (0.760 mm to 250.000 mm)
DEFM1-10.0-M1016	M1016	Steel: 0.030 in. to 10.000 in. (0.760 mm to 250.00 mm)
DEFM1-5.0-M110	M110	Steel: 0.040 in. to 15.000 in. (1.00 mm to 380.00 mm)
DEFM1-5.0-M109	M109	Steel: 0.050 in. to 20.000 in. (1.00 mm to 500.00 mm)
DEFM1-2.25-M106	M106	Steel: 0.080 in. to 25.000 in. (2.00 mm to 635.00 mm)
DEFM1-2.25-M1036	M1036	Steel: 0.080 in. to 25.000 in. (2.00 mm to 635.00 mm)
DEFM3-20.0-M208	M208	Steel: 0.008 in. to 0.200 in. (0.25 mm to 5.00 mm)
DEFP2-20.0-M208	M208	Plastic: 0.005 in. to 0.200 in. (0.12 mm to 5 mm)
DEFM3-10.0-M202	M202	Steel: 0.010 in. to 0.500 in. (0.25 mm to 12.00 mm)
DEFM2-10.0-M202	M202	Steel: 0.030 in. to 0.500 in. (0.75 mm to 12.00 mm)
DEFP2-10.0-M202	M202	Plastic: 0.025 in. to 0.25 in. (0.6 mm to 6 mm)
DEFM3-15.0-V260	V260	Steel: 0.010 in. to 0.200 in. (0.25 mm to 5.00 mm)
DEFM2-15.0-V260	V260	Steel: 0.030 in. to 0.500 in. (0.75 mm to 12.50 mm)
DEFP2-15.0-V260	V260	Plastic: 0.010 in. to 0.120 in. (0.25 mm to 3 mm)
DEFM2-5.0-M201	M201	Steel: 0.050 in. to 1.000 in. (1.50 mm to 25.40 mm)
DEFP2-5.0-M201	M201	Plastic: 0.025 in. to 0.500 in. (0.62 mm to 12.5 mm)
DEFM2-5.0-M206	M206	Steel: 0.050 in. to 0.750 in. (1.25 mm to 19.00 mm)
DEFP2-5.0-M206	M206	Plastic: 0.040 in. to 0.500 in. (1 mm to 12.5 mm)

Table 38 Typical measurement ranges and default setups for single element transducer^a (continued)

Setup name	Transducer	Typical measurement range
DEFM2-2.25-M207	M207	Steel: 0.080 in. to 0.750 in. (2.00 mm to 19.00 mm)
DEFP2-2.25-M207	M207	Plastic: 0.080 in. to 0.500 in. (2 mm to 12.5 mm)
DEFM2-20.0-M208	M208	Steel: 0.020 in. to 0.200 in. (0.50 mm to 10.00 mm)
DEFM1-0.5-M101	M101	Steel: 0.500 in. to 25.00 in. (12.5 mm to 635 mm)
DEFM1-1.0-M102	M102	Steel: 0.200 in. to 25.00 in. (5.0 mm to 635 mm)
DEFM1-1.0-M103	M103	Steel: 0.100 in. to 25.00 in. (2.5 mm to 635 mm)
DEFP1-0.5-M2008	M2008	Fiberglass: 0.200 in. to 3.00 in. (5.0 mm to 75 mm)

- a. The maximum thickness measuring capability depends on transducer type, material conditions, and temperature.

Table 39 Setup parameter description

Name	Description	Units/Resolutions/Range
MEAS OPTION	Echo detect mode	Standard dual Dual echo-to-echo Thru-Coat Mode 1 Mode 2 Mode 3
MEAS TYPE	Special measurement modes	Standard or Oxide (optional) Barrier Layer (optional) First Peak
PROBE TYPE	Transducer types	Dual element Direct contact Delay line Immersion EMAT
PULSER POWER	Pulser power	60 V, 110 V, 150 V, or 200 V
MAX GAIN	Maximum receiver gain	0.0 dB to 99.8 dB, 0.3 dB steps
INIT GAIN	Initial TDG gain	0 to MaxGain, 1 dB steps.
TDG SLOPE	Time Gain slope (default)	0.0 dB/s to 39.9 dB/s
MB BLANK	Main Bang Blank	0 ns to 225 μ s

Table 39 Setup parameter description (continued)

Name	Description	Units/Resolutions/Range
ECHO WINDOW	Echo detect gate which begins at end of MB (main bang) blank in mode 1 or interface echo in modes 2 and 3. The value reported for the end of echo window is relative to the main bang.	0 ns to 224.71 μ s. 55 ns or MB blank time interval, whichever is less.
ECHO 1 DETECT	Detection polarity of first echo	+ or –
ECHO 2 DETECT	Detection polarity of second echo	+ or –
IF BLANK	Blank after interface echo	0 μ s to 20 μ s
M3 BLANK	Blank after first measured back-wall echo in mode 3	0 μ s to 20 μ s
VELOCITY	Ultrasonic sound velocity of material to be measured	0.0200 in./ μ s to 0.7362 in./ μ s (0.508 mm/ μ s to 18.699 mm/ μ s)
ZERO	Zero calibration factor	0.00 to 999.99

Table 40 General specifications

Element	Description
Keypad	Sealed and embossed membrane surface Tactile and audible feedback, color-coded graphics, 21 keys
Dual element transducers	Automatically identifies the transducer type and optimizes the gage for that transducer. Non-Olympus transducers might work, but performance is not guaranteed. Following transducers are supported: D790, D790-SM, D791, D791-RM, D792, D793, D794, D795, D797, D798, D7906-SM, D7908, D799, and MTD705
Single element transducers	Can be used with contact, delay line, and immersion transducers from 2 MHz to 30 MHz. High precision software option expands the frequency range to 0.5 MHz to 30.0 MHz

Appendix B: Sound Velocities

The following table consists of the sound velocities in a variety of common materials. Use this table only as a guide. The actual velocity in these materials may vary significantly due to a variety of causes, such as composition, preferred crystallographic orientation, porosity, and temperature. Therefore, for maximum accuracy, establish the sound velocity in a given material by first testing a sample of the material.

Table 41 Sound Velocities in common materials

Material	V (in./ μ s)	V (m/s)
Acrylic resin (Perspex)	0.107	2730
Aluminum	0.249	6320
Beryllium	0.508	12900
Brass, naval	0.174	4430
Copper	0.183	4660
Diamond	0.709	18000
Glycerin	0.076	1920
Inconel	0.229	5820
Iron, Cast (slow)	0.138	3500
Iron, Cast (fast)	0.220	5600
Iron oxide (magnetite)	0.232	5890
Lead	0.085	2160
Lucite	0.106	2680
Molybdenum	0.246	6250
Motor oil (SAE 20/30)	0.069	1740
Nickel, pure	0.222	5630

Table 41 Sound Velocities in common materials (continued)

Material	V (in./ μ s)	V (m/s)
Polyamide (slow)	0.087	2200
Nylon, fast	0.102	2600
Polyethylene, high density (HDPE)	0.097	2460
Polyethylene, low density (LDPE)	0.082	2080
Polystyrene	0.092	2340
Polyvinylchloride, (PVC, hard)	0.094	2395
Rubber (polybutadiene)	0.063	1610
Silicon	0.379	9620
Silicone	0.058	1485
Steel, 1020	0.232	5890
Steel, 4340	0.230	5850
Steel, 302 austenitic stainless	0.223	5660
Steel, 347 austenitic stainless	0.226	5740
Tin	0.131	3320
Titanium, Ti 150A	0.240	6100
Tungsten	0.204	5180
Water (20 °C)	0.0580	1480
Zinc	0.164	4170
Zirconium	0.183	4650

References

Folds, D. L. "Experimental Determination of Ultrasonic Wave Velocities in Plastics, Elastomers, and Syntactic Foam as a Function of Temperature," Naval Research and Development Laboratory, Panama City, Florida, 1971.

Fredericks, J. R. Ultrasonic Engineering, John Wiley & Sons, Inc., New York, 1965.

"Handbook of Chemistry and Physics" Chemical Rubber Co., Cleveland, Ohio, 1963.

Mason, W. P. Physical Acoustics and the Properties of Solids, D. Van Nostrand Co., New York, 1958.

Papadakis, E. P. Panametrics – unpublished notes, 1972.

Appendix C: Accessories and Replacement Parts

Table 42 Software Options

Description	Part Number
Optional Oxide software (installed in units via activation code)	38DLP-OXIDE [U8147014]
Optional High Resolution software (installed in units via activation code)	38DLP-HR [U8147015]
Optional Multi-Measurement Software (installed in units via activation code)	38DLP-MM [U8147016]
Optional High Penetration software (installed in units via activation code)	38DLP-HP [U8147017]

Table 43 Accessories and replacement parts

Description	Part Number
Carrying case	38-CC [U8764099]
Protective rubber boot with chest harness	38DLP/RPC [U8779306]
Gage stand	EPLTC-PS [U8780044]
Chest harness	441-087 [U8902895]
Rectangular rubber boot rings	412-1061LF [U8907259]
38DL PLUS User's Manual	DMTA-10004-01EN
Interface program CD-ROM (standard)	GageView [U8147006]
Batteries	Rechargeable Lithium-ion battery: 38-BAT [U8760054] AA battery holder: 38DLP/AA [U8780290] Alkaline and NiMH
Remote save/send foot switch	38DLP/RFS [U8780288]

Table 43 Accessories and replacement parts (continued)

Description	Part Number
Extended warranty — 1 year	38DLP-EW [U8778348]
Bar code reader	38DLP/BCW/NC [U8780289]

Table 44 Interface Cables and Power Accessories

Description	Part Number
6 ft (1.83 m), 9-pin female “D” (top connector)	38-9F6 [U8840167]
6 ft (1.83 m) top USB cable	38-C-USB-IP67 [U8800998]
6 ft (1.83 m) USB cable (connects under I/O door)	EPLTC-C-USB-A-6 [U8840031]
VGA output cable 6 ft (1.83 m)	EPLTC-C-VGA-6 [U8840035]
2 GB external microSD memory card	MICROSD-ADP-2GB [U8779307]
Cable for portable printers	38DLP-PR6 [U8780287]
Universal charger/AC adaptor	EP-MCA-X where X denotes power cord type: <ul style="list-style-type: none"> • U for North America, Japan, and Korea [U8050397] • A for Australia [U8767330] • K for United Kingdom [U8767287] • I for Italy [U8767289] • D for Denmark [U8767290] • P for Pakistan, India, South Africa, and Hong Kong [U8767291] • E for Europe [U8767288]
AC/adaptor power cord for: North America, South America, Japan, and Korea	2111 [U8840015]
AC/adaptor power cord for: European—Austria, Belgium, Finland, France, Germany, Netherlands, Sweden, Norway, Israel, and Greece	1514 [U8840003]
AC/adaptor power cord for Australia	1515 [U8840005]

Table 44 Interface Cables and Power Accessories (continued)

Description	Part Number
AC/adaptor power cord for United Kingdom	1516 [U8840007]
AC/adaptor power cord for Italy	1517 [U8840009]
AC/adaptor power cord for Denmark	1518 [U8840011]
AC/adaptor power cord for India, Pakistan, South Africa, and Hong-Kong	1519 [U8840013]

Table 45 Couplants

Description	Part Number
Propylene glycol, 2 oz. (0.06 l)	Couplant A-2 [U8770273]
Glycerin, 2 oz. (0.06 l)	Couplant B-2 [U8770023]
Gel type, 12 oz. (0.35 l)	Couplant D-12 [U8770026]
Ultratherm-high temperature up to 1000 °F (538 °C), 2 oz. (0.06 l)	Couplant E-2 [U8770274]
Medium temperature up to 500 °F (260 °C), 2 oz. (0.06 l)	Couplant F-2 [U8770141]

Table 46 Test blocks

Description	Part Number
5-step, 1018 steel English units; 0.100 in., 0.200 in., 0.300 in., 0.400 in., 0.500 in.	2214E [U8880014]
5-step, 1018 steel Metric units; 2.5 mm, 5.0 mm, 7.5 mm, 10.0 mm, 12.5 mm	2214M [U8880016]
5-step, aluminum English units; 0.100 in., 0.200 in., 0.300 in., 0.400 in., 0.500 in.	2213E [U8880010]
4-step, 1018 steel English units; 0.250 in., 0.500 in., 0.750 in., 1.500 in.	2212E [U8880008]
2-step, 303 stainless steel English units; 0.050 in., 0.150 in.	2218E [U8880022]

Table 46 Test blocks (continued)

Description	Part Number
2-step, 303 stainless steel Metric units; 1 mm, 15 mm	2218M [U8880024]
2-step, 303 stainless steel, English units; 0.200 in., 1.500 in.	2219E [U8880026]
2-step, 303 stainless steel, Metric units; 5 mm, 30 mm	2219M [U8880028]

List of Figures

Figure 1-1	Measuring thicknesses with the 38DL PLUS	13
Figure 1-2	The 38DL PLUS hardware components	17
Figure 1-3	The 38DL PLUS connections	17
Figure 1-4	The top end connectors	18
Figure 1-5	The connectors behind the I/O door	19
Figure 1-6	The 38DL PLUS keypads	20
Figure 2-1	The power indicator for battery and AC operation	25
Figure 2-2	Connecting the charger/adaptor	26
Figure 2-3	Connecting the DC power plug	27
Figure 2-4	Opening the battery compartment	30
Figure 2-5	Selecting the new battery type	31
Figure 3-1	The main elements of the measurement screen	33
Figure 3-2	The ID bar	34
Figure 3-3	Example of other elements appearing on the measurement screen	35
Figure 3-4	The loss-of-signal (LOS) indicator	35
Figure 3-5	Menu and submenu example	36
Figure 3-6	Parameter screen example	37
Figure 3-7	Example of the virtual keyboard	39
Figure 3-8	The character cycle of the traditional text edit method	40
Figure 4-1	Selecting the user interface language	44
Figure 4-2	Selecting clock parameters	45
Figure 4-3	The DISPLAY SETTINGS screen	46
Figure 4-4	Example of the indoor and the outdoor color schemes	47
Figure 4-5	Examples of the rectification modes	48
Figure 4-6	Examples of waveform trace modes	50
Figure 4-7	The range of the waveform display	50
Figure 4-8	Comparing normal and zoomed display in mode 1	52
Figure 4-9	Comparing normal and zoomed display in mode 2	53
Figure 4-10	Comparing normal and zoomed display in mode 3	53
Figure 4-11	The measurement update rate indicator	54

Figure 5-1	Plugging the transducer	58
Figure 5-2	Initial screen with a standard D79X dual element transducer	58
Figure 5-3	Selecting a default single element transducer setup	59
Figure 5-4	Performing the material sound velocity calibration on a 5-step test block	62
Figure 5-5	Performing the zero calibration on a 5-step test block	63
Figure 5-6	Example of a 5-step test block	64
Figure 5-7	Entering a known material sound velocity	66
Figure 5-8	The calibration lock message	67
Figure 5-9	Coupling dual element transducer and reading the measured thickness	70
Figure 5-10	The active file name appearing in the ID bar	71
Figure 5-11	Opening the THRU COAT SETUP dialog box	72
Figure 5-12	Measuring with the standard echo detection mode	74
Figure 5-13	Measuring with the automatic echo-to-echo detection mode	75
Figure 5-14	Measuring with the manual echo-to-echo detection mode	76
Figure 5-15	Comparing manual measurements	78
Figure 6-1	EMAT transducer and filter adaptor connection	84
Figure 7-1	The OPTIONS screen to activate software options	88
Figure 7-2	The OXIDE screen	91
Figure 7-3	Selecting which measurement appears with the larger font	92
Figure 7-4	Measurement screen with the oxide layer software option	93
Figure 7-5	Measurement screen for a disbanded oxide layer	94
Figure 7-6	Waveform display screen	96
Figure 7-7	Setting multi-measurement parameters in the normal mode	97
Figure 7-8	Multi-measurement display modes with three layers and the sum	98
Figure 7-9	Setting multi-measurement parameters in the soft contact mode	100
Figure 7-10	Setting multi-measurement parameters in the % total thickness mode ..	101
Figure 7-11	Encoded B-scan main screen	102
Figure 7-12	Changing B-scan parameters	103
Figure 7-13	7 inch scan zoom set to 1	106
Figure 7-14	7 inch scan zoom set to 5	106
Figure 7-15	7 inch scan zoom set to 10	107
Figure 8-1	Normal differential mode	110
Figure 8-2	The DIFF screen	111
Figure 8-3	Displaying the minimum and/or maximum thickness	112
Figure 8-4	Example of a HIGH alarm indicator	114
Figure 8-5	Example of a B-scan alarm mode	116
Figure 8-6	YEL (yellow) and RED alarm indicators	117
Figure 8-7	Setting up the STANDARD alarm	118
Figure 8-8	Example of a locked function message in the help bar	120
Figure 8-9	The INSTRUMENT LOCK screen	121
Figure 9-1	The MEAS screen	124
Figure 9-2	The SYSTEM screen	126

Figure 9-3	Changing the communication parameters	128
Figure 10-1	Manually adjusting the gain	134
Figure 10-2	Adjusting the extended blank length	136
Figure 10-3	B-scan example for a 5-step test block	137
Figure 10-4	Changing B-scan parameters	138
Figure 10-5	The half-size and full-size B-scans	139
Figure 10-6	B-scan elements	139
Figure 10-7	B-scan freeze review elements	141
Figure 10-8	Example of the half-size DB grid	145
Figure 10-9	Changing DB grid parameters	146
Figure 10-10	Example of half-size and full-size DB grids	147
Figure 10-11	Grid transposition example	147
Figure 10-12	Example of a linearized DB grid	148
Figure 10-13	The highlighted DB grid cell in the ID review screen	149
Figure 10-14	Example of an inserted cell	150
Figure 10-15	Example of a zoomed inserted cell	151
Figure 10-16	Opening the Avg/Min measure dialog box	152
Figure 10-17	Examples of the measurement screen with the AVG/MIN measurement active	153
Figure 10-18	The TEMP COMP screen	155
Figure 10-19	Displaying temperature compensation data	156
Figure 11-1	The active file name appearing in the ID bar	158
Figure 11-2	Identifying datalogger parameters	159
Figure 11-3	Example of the CREATE screen	162
Figure 11-4	The CREATE screen for the incremental data file type	164
Figure 11-5	Selecting the ID range for the sequential file type	166
Figure 11-6	Configuring the ID range for a sequential with custom points data file type	168
Figure 11-7	General 2-D grid example	169
Figure 11-8	One grid for 75 identical parts	170
Figure 11-9	Different named grid for each part	171
Figure 11-10	Configuring the ID range for a 2-D grid data file type	172
Figure 11-11	Configuring the ID range for a 2-D grid with custom points data file type	174
Figure 11-12	Configuring the ID range for a 3-D grid data file type	176
Figure 11-13	Configuring the ID range for a boiler data file type	178
Figure 11-14	Configuring the ID range for a 3-D custom data file type	179
Figure 11-15	The file menu and report submenu	181
Figure 11-16	Opening a file	182
Figure 11-17	Copying a file	183
Figure 11-18	Entering new file information	185
Figure 11-19	Displaying the grid edit screen	185

Figure 11-20	Deleting a file	187
Figure 11-21	Deleting the data of an ID range in the active file	188
Figure 11-22	Warning message when resetting measurements	189
Figure 11-23	The FILE NOTES screen	189
Figure 11-24	Selecting a note from the notes table	191
Figure 11-25	Copying a note table from one file to another	193
Figure 11-26	The ID overwrite protection message	194
Figure 11-27	Identifying the ID review screen	195
Figure 11-28	Editing the ID # edit mode	197
Figure 11-29	The message when the edited ID is not in the database	198
Figure 11-30	Selecting the bar code RS-232 device	200
Figure 11-31	The FILE SUMMARY report screen	202
Figure 11-32	The FILE SUMMARY report result screen	202
Figure 11-33	The MIN/MAX SUMMARY report screen	203
Figure 11-34	The FILE COMPARISON report screen	204
Figure 11-35	The FILE COMPARISON report result screen	204
Figure 11-36	The ALARM SUMMARY report result screen	205
Figure 11-37	The MIN/MAX SUMMARY report result screen	206
Figure 11-38	Returning to the measurement screen	206
Figure 12-1	The GENERIC SETUP SELECTION screen	211
Figure 12-2	Example of the ACTIVE screen	212
Figure 12-3	Illustration of the V-path	214
Figure 12-4	Answering YES at the V-path calibration prompt	216
Figure 12-5	Editing point 1 of the V-path calibration	217
Figure 12-6	Saving the setup	218
Figure 13-1	The ACTIVE screen for the setup of a single element transducer	221
Figure 13-2	Adjusting the waveform parameters	223
Figure 13-3	Mode 1 detection example	224
Figure 13-4	Mode 2 detection example	225
Figure 13-5	Mode 3 detection example	225
Figure 13-6	Detection of the first or the second negative peak	226
Figure 13-7	Comparing pulser power set to 60 V and 200 V	227
Figure 13-8	The TDG zones and parameters	228
Figure 13-9	Main bang blank position for mode 1	230
Figure 13-10	Main bang blank position for mode 2 and mode 3	231
Figure 13-11	Echo window setting for mode 1	232
Figure 13-12	Echo window setting for mode 2 and mode 3	232
Figure 13-13	Negative and positive echo detection examples	233
Figure 13-14	Examples of the interface blank in mode 2	235
Figure 13-15	Examples of the interface blank in mode 3	236
Figure 13-16	Examples of M3 Blank adjustment	237
Figure 13-17	Saving custom setups	238

Figure 14-1	Connecting the 38DL PLUS to a computer	243
Figure 14-2	Viewing communication parameters	245
Figure 14-3	Selecting a file to send	247
Figure 14-4	Identifying a range of ID numbers to send	248
Figure 14-5	The EXPORT screen	250
Figure 14-6	Example of the IMPORT screen	251
Figure 14-7	The Device Configuration dialog box	254
Figure 14-8	The Device Tools dialog box with a screen capture	255
Figure 14-9	Viewing or changing the file output format	258
Figure 14-10	Selecting the COMMUNICATION RESET	259
Figure 15-1	Activating a reset function	265
Figure 15-2	The KEYPAD TEST screen	266
Figure 15-3	The DUAL XDCR TEST screen	267
Figure 15-4	Example of the SW DIAG screen	268
Figure 15-5	Example of the STATUS screen	269

List of Tables

Table 1	Label contents	3
Table 2	Keypad functions	20
Table 3	Recommended transducers for various steel thickness ranges	79
Table 4	38DL PLUS software options	87
Table 5	Oxide layer transducers	90
Table 6	Sample scan-speed calculations	104
Table 7	Sample maximum-distance calculations	105
Table 8	Alarm calculation example with the ABSOLUTE DIFF mode	115
Table 9	Alarm calculation example with the % DIFF mode	116
Table 10	File contents summary	158
Table 11	Additional information stored with the data	160
Table 12	Resulting ID examples for the INCREMENTAL file type	163
Table 13	Resulting ID examples for the SEQUENTIAL file type	165
Table 14	Resulting ID example for the SEQ+CUSTOM PT file type	167
Table 15	Resulting ID example for the 2D+CUSTOM PT file type	173
Table 16	Resulting ID example for the 3-D GRID file type	175
Table 17	Resulting ID example for the BOILER file type	177
Table 18	Resulting ID example for the 3-D CUSTOM file type	178
Table 19	File data mode stored measurements	180
Table 20	Predefined setups	209
Table 21	Default transducers	211
Table 22	Polarity of echoes	234
Table 23	Optional RS-232 cables	244
Table 24	Serial data output format for dual element transducers	256
Table 25	Serial data output format for single element transducers	257
Table 26	Default communication parameter values	258
Table 27	Measurement default settings	263
Table 28	Default communication settings	264
Table 29	Measurement troubleshooting	270
Table 30	General EN15317 Specifications	273

Table 31	Display EN15317 Specifications	274
Table 32	Transmitter EN15317 Specifications	274
Table 33	Receiver EN15317 Specifications	274
Table 34	Other EN15317 Specifications	275
Table 35	Environmental rating specifications	275
Table 36	Measurement specifications	276
Table 37	Datalogger Specifications	276
Table 38	Typical measurement ranges and default setups for single element transducer	277
Table 39	Setup parameter description	278
Table 40	General specifications	279
Table 41	Sound Velocities in common materials	281
Table 42	Software Options	283
Table 43	Accessories and replacement parts	283
Table 44	Interface Cables and Power Accessories	284
Table 45	Couplants	285
Table 46	Test blocks	285

Index

Symbols

% total mode, multi-measurement 100

Numerics

2-D grid data file 168

2-D grid with custom points data file 172

3-D grid custom data file 178

3-D grid data file 174

A

AA battery holder 27

AC power 26

cord 17

using 26

accessories and replacement parts 283

acoustic properties of test material 68

activating

DB grid 145

differential mode 110

min/max mode 113

quick setup recall 239

resets 264

software options 88

V-path 214

zoom 52

active file name 71, 158

active ID, changing 196

active measurement 96

adjusting

delay value 51

extended and E1 blanks 77

extended blank with D79X series transducers

135

gain with DE and EMAT transducers 133

update rate 54

waveform parameters 222

advanced gaging functions 133

alarm

setting 117

alarm indicator 35

alarms 114

Alkaline batteries

operating time 28

using 27

arrow keys 20

A-scan 34

associating note to IDs 191

Australia EMC compliance 4

AUTO E-TO-E 75

AVG/MIN

configuring 151

measuring thickness 153

Avg/Min measurements 151

B

bar code reader, using to enter ID 199

basic operation 57

manual 6

battery

charge 25

charging 28

compartment door 30

full capacity 29

operating time 28

power 27

rechargeable 27

- replacement 30
- resolving problems 269
- storage instructions 29
- usage instructions 29
- beeper 43, 126
- blank
 - adjusting 77
 - interface 234
 - main bang 230
 - mode 3 echo 236
 - thickness value 71
- boiler data file 176
- boiler tube 90
 - thickness measurement 93
- brightness, display 46
- B-scan
 - about the 137
 - alarm 116
 - freeze mode 140
 - max THK mode 141
 - saving 143
 - scan direction 139
 - using 142
 - using the alarm mode 142
- building V-path for DE transducers 215
- C**
- calibrating
 - EMAT transducer 85
 - oxide layer measurements 92
- calibration 60, 67
 - instrument 61
 - locked 67
 - material sound velocity 65
 - test block 64
 - THRU-COAT 73
 - transducer zero compensation 64
- Canada, ICES-003 compliance 10
- capturing screen with GageView 253
- caution notes
 - AC power cord 18, 26
 - battery replacement 30
 - cannot guarantee accuracy and performance with non-D79X transducers 215
 - cannot recover data after measurement reset 188
 - cannot recover deleted file content 186
 - cannot recover erased data 198
 - definition 7
 - do not delete existing notes 192
 - experienced operator only 135, 220
 - ingress protection guarantee 16
 - instrument disassembly, modification, or repair 6
 - internal memory reset deletes all data 263
 - master reset deletes all data 264
 - overwriting notes with copied note table 193
 - replacing setup deletes original data 218, 238
 - unsaved data lost 213
- CE mark 4
- changing
 - active ID 196
 - active measurement 96
 - display settings 45
 - echo detection mode 76
 - file data mode 181
 - highlighted cell in DB grid 149
 - language 43
 - RS-232 output file format 257
 - thickness measurement resolution 55
- character
 - cycle in traditional method 40
 - deleting 41
 - inserting 41
- charging batteries 28
- China RoHS 4, 9
- cleaning, instrument 262
- clock
 - reset 264
 - setting 45
- coated material 72
- color scheme 46
 - changing 45
- comment notes 34, 80
- communication
 - configuring 127
 - reset 259, 264
- compensation, temperature 154
- compliance
 - CE (Europe) 4
 - C-Tick (Australia) 4
 - EMC directive 10

-
- FCC (USA) 10
 - ICES-003 (Canada) 10
 - configuring
 - AVG/MIN 151
 - beeper 43
 - communications 127
 - DB grid 145
 - differential mode 110
 - inactive time 43
 - instrument 123
 - measurement parameters 123
 - radix type 43
 - system parameters 126
 - connecting
 - EMAT transducer 84
 - connections 17
 - copying
 - file 183
 - note table 193
 - copyright ii
 - corrosion applications 72
 - couplant types 70
 - coupling technique 67
 - creating
 - custom setups for SE transducers 220
 - data file 161
 - notes 190
 - setup for nonstandard DE transducers 210
 - C-Tick mark 4
 - curvature of test piece 68
 - curvature, soft contact 95
 - custom setups 220
 - D**
 - D79X standard transducers 209
 - danger notes
 - definition 7
 - electric shock 1
 - instrument intended use 5
 - data
 - erasing in active file 198
 - exchange 246
 - output formats 256
 - saving 71
 - data file
 - 2-D grid 168
 - 2-D grid with custom points 172
 - 3-D grid 174
 - 3-D grid custom 178
 - boiler 176
 - creating 161
 - incremental 163
 - sequential 165
 - sequential with custom points 166
 - datalogger
 - about the 157
 - echo-to-echo flags 80
 - file based system 70, 157
 - functions 15
 - date, setting 45
 - DB grid
 - about the 145
 - activating and configuring 145
 - changing the highlighted cell 149
 - saving readings 149
 - viewing inserted cell 150
 - DC power connector 18
 - DE-AEtoE indicator 75
 - default file 71
 - delay 50
 - adjusting value 51
 - deleting
 - a character 41
 - all files 188
 - file or content 186
 - notes from a file 192
 - range of IDs 187
 - DE-MEtoE indicator 75
 - DE-STD indicator 74
 - detection modes 224
 - detection of echo 1 and 2 233
 - diagnostic test 265
 - differential mode 109
 - direct current symbol 4
 - display
 - brightness 46, 47
 - changing settings 45
 - options 15
 - document
 - copyright ii
 - part number ii
 - publishing date ii
-

- revision ii
- doubling 79
- download indicator 34
- dual element transducer
 - connector 17
 - selection for echo-to-echo modes 78
 - zero compensation 60, 64
- E**
- E1 blank
 - adjusting 77
 - description 77
- E110-SB EMAT transducer 85
- eccentricity or taper 68
- echo detection mode 74
 - changing 76
- echo window 231
- echo-to-echo mode
 - blanking adjustments 77
 - flags 80
- editing
 - file 184
 - ID 197
 - notes 190
 - value with traditional method 41
 - value with virtual keyboard 39
- electric shock, danger note 1
- electromagnetic acoustic transducer 83
- EMAT transducer 83
- EMC directive compliance 10
- EN15317 specifications 273
- enabling THRU-COAT 72
- English keypad 20
- entering known material sound velocity 66
- environmental rating 16
- EPRI 172
- erasing data in active file 198
- error messages 269
 - calibration 63
- exchanging data 246
- exporting files to memory card 249
- extended blank 135
 - adjusting 77
 - using 136

- F**
- fast mode 54
- FCC (USA) compliance 10
- file
 - copying 183
 - deleting 186
 - deleting all 188
 - editing 184
 - opening 182
 - renaming 184
- file data modes 180
- file name 71, 158
- filled waveform 50
- first peak 226
- flags, echo-to-echo 80
- freeze indicator 35
- freezing
 - waveform 121
 - waveforms 121
- full rectification 48
- G**
- GageView
 - about 241
 - installation 242
 - manual 6
- gain
 - adjustments (DE and EMAT transducers) 133
 - initial 229
 - maximum 228
 - time dependent 227
- generating
 - report 201
- getting started manual 5
- H**
- half- rectification 48
- half+ rectification 48
- hand strap 16
- help text bar 35
- high penetration software option 87, 107
- high resolution software option 55, 87, 89
- high temperature measurements 65
- I**
- I/O door 18

-
- ICES-003 (Canada) compliance 10
 - ID bar 33, 34
 - ID number 34
 - ID overwrite protection 194
 - ID review screen 194
 - ID, editing 197
 - important notes
 - definition 7
 - determine thickness range 215
 - forgotten password 120
 - setups for each multi-measurement layer 96
 - turning off before procedure completion 63
 - importing survey files from memory card 251
 - inactive time 43
 - incremental data file 163
 - indicators
 - alarm 35
 - DE-AEtoE 75
 - DE-MEtoE 75
 - DE-STD 74
 - download 34
 - freeze 35
 - LOS 35
 - microSD card 34
 - power 25, 33
 - rectification 33
 - zoom 35
 - indoor color scheme 47
 - initial gain 229
 - initial screen 58
 - inserting a character 41
 - instruction label
 - content 3
 - location 2
 - instruction manual 5
 - instrument
 - calibrating 61
 - cleaning 262
 - configuring 123
 - locking 119
 - status 269
 - intended use 5
 - interface blank 234
 - internal memory reset 263
 - internal oxide 94
 - international keypad 20
 - IP67 ingress protection 16
 - K**
 - keypad 19
 - functions 19, 20
 - secondary function 20
 - known material sound velocity 66
 - L**
 - labels
 - instructions 2, 3
 - safety 1
 - language, changing 43
 - last ID 71
 - lenses, soft contact 95
 - loading, setup 59
 - locked calibration 67
 - locking
 - instrument 119
 - loss-of-signal indicator 35
 - M**
 - magnetite 90
 - main bang blank 230
 - maintenance 261
 - gage 261
 - transducer 262
 - transducers 262
 - MANUAL E-TO-E 75
 - manual gain adjust with D79X series transducer 133, 135
 - master reset 264
 - material
 - coated or painted 72
 - entering sound velocity 66
 - sound velocity calibration 60, 62, 65
 - maximum gain 228
 - maximum mode 112
 - measurement
 - features 14
 - parameters, configuring 123
 - reset 263
 - troubleshooting 270
 - update rate 54
 - measurement mode
 - ID overwrite protection 194
-

- supervisor lock 119
- measurement screen 33
- measuring thickness 70
- membrane vent 4
- memory card
 - exporting files to 249
 - importing survey files from 251
- indicators 34
- microSD 17
- screen capture 255
- slot 18
- menus 35
 - selecting a ~ command 36
- messages, error 269
- min/max
 - mode 112
 - preventing false readings 113
- minimum mode 112
- mode 1 52
- mode 2 53
- mode 3 53
- mode 3 echo blank 236
- multi-measurement software option 87, 95

N

- negative detection 233
- NiMH rechargeable batteries 27
 - operating time 28
- NONAME00 default file 71
- normal mode, multi-measurement 97
- notes
 - about 189
 - adding row or column 172
 - alarm colors only with indoor color scheme 47
 - alarm indicator and color 114, 117
 - alarm reference values and units 119
 - also saving temperature value 156
 - A-scan zoom not recommended 141
 - battery charge cycles 29
 - battery not initially fully charged 27
 - battery withstands several hundred discharge-recharge cycles 270
 - B-scan appears only when enabled 118
 - calibration error 63
 - copying table 193

- couplant types 70
- couplant with M2091 shear transducer 92
- creating data file in GageView 161
- creating note table in GageView 190
- creating or editing 190
- data saved with a B-scan 144
- database tracking and setting overwriting 129
- definition 8
- deleting an ID 199
- deleting and delete protection 187
- deleting from a file 192
- display brightness and battery life 48
- display update rate and min/max mode 113
- displaying file header 184
- entering + and – signs 155
- entering known material sound velocity 74
- experienced operator only 134
- extended blank effects 137
- F1 format in USB communications 256
- filled waveform trace condition 49
- fixed RS-232 parameters 131
- freeze to center the B-scan 140
- fully charge battery after replacement 31
- fully charged battery 29
- GageView installation 242
- grid transposition and ID increments 147
- high temperature measurement 65
- ID increment number of digit 163
- incrementing passed Z 174, 179
- max gain always higher than initial gain 229
- menu selection writing convention 36
- modes and echo window 226
- move to the next line in text edit 40
- mutually exclusive MIN/MAX and HOLD BLANK functions 125
- no stored data shown while editing ID 196
- optional foot switch 127
- output format details 128
- parameter selection writing convention 38
- previously created notes 190
- printing bar code labels 200
- quick setup recall only for single element transducers 239
- redo zero with M2008 transducer 107
- remove external oxide 83

- remove oxide scale for accurate measurement 94
 - RS-232 printers only 241
 - saving calibration and setup parameters 127
 - sending blank reading resets min/max and freeze functions 249
 - shear wave with EMAT 85
 - thickness readings not accurate 216
 - transmitted data depends on output format 249
 - transmitted data remains in 38DL PLUS 246
 - unfreezing display 122
 - untagged letter codes when sending data 192
 - user defined setups 60
 - varying number of DB grid columns 146
- O**
- Olympus
 - office address ii
 - technical support 11
 - opening
 - file 182
 - options, software 87
 - outdoor color scheme 47
 - outline waveform 50
 - overwrite protection 194
 - oxide layer
 - measurement calibration 92
 - measurement setup 90, 91
 - software option 87, 89
 - thickness measurement 93
- P**
- painted material 72
 - parameter
 - screens 36
 - selecting 37
 - password
 - setting 120
 - patent label 2
 - performing
 - diagnostic tests 265
 - THRU-COAT calibration 73
 - phase
 - distortion 69
 - reversal 69
 - polarity of detection 233
 - positive detection 233
 - power
 - AC 26
 - battery 27
 - indicator 25, 33
 - preventing false min/max readings 113
 - printer 246
 - product description 13
 - protective rubber boot 16
 - pulse power 227
- Q**
- quick setup recall, activating 239
- R**
- radius of curvature 95
 - radix type 43
 - range 50
 - deleting 187
 - selecting value 51
 - recalling
 - custom DE transducer setup 213
 - quick setup 239
 - receiving
 - files from a computer 252
 - rectification
 - changing setting 46
 - indicator 33
 - mode 48
 - renaming a file 184
 - repair and modification 6
 - replacing the battery 30
 - report, generating 201
 - reports 200
 - resets 263
 - resetting
 - communication 259
 - resolution, changing 55
 - review screen 194
 - reviewing stored data 196
 - RF rectification 48
 - RoHS symbol 4, 9
 - RS-232 communications 244
 - serial data output formats 256
 - setting 244

S

- safety
 - labels and symbols 1
 - signal words 7
 - symbols 6
- sagittal height 95
- saving
 - B-scan 143
 - data 71
 - DB grid readings 149
 - setup parameters 237
- scale, boiler tube 90
- secondary key function 20
- selecting
 - menu command 36
 - parameter and value 37
 - range value 51
 - text edit mode 38
- sending
 - entire files to a computer 246
 - range of IDs 247
 - screen capture to GageView 253
 - screen capture to memory card 255
- sequential data file 165
- sequential with custom points data file 166
- serial communication connector 18
- serial number
 - label content 3
 - label location 2
- setting 244
 - alarms 117
 - clock 45
 - ID overwrite protection 194
 - oxide layer 90
 - oxide layer measurement 91
 - password 120
 - transducer 57
 - units 44
 - USB communications 242
- setups
 - creating for nonstandard DE transducers 210
 - creating for SE transducers 220
 - custom for SE transducers 219
 - dual element transducer 209
 - loading 59
 - recalling custom DE transducer 213
 - saving parameters 237
- shear-wave, unwanted 79
- single send 248
- slope, TDG 229
- soft contact lenses 95
- soft contact mode, multi-measurement 99
- software diagnostic 268
- software options 87, 283
 - activating 88
 - high resolution 55, 89
 - multi-measurement 95
 - oxide layer 89
- sound
 - attenuation or absorption 69
 - scattering 68
 - velocities 281
 - velocity calibration 60, 65
- special functions 109
- stand 16
- standard echo detection mode 74
- status, instrument 269
- steam, boiler tube 90
- step test block 64
- stored data review 196
- strap rings 16
- submenus 35
- supervisor lock 119
- support information 11
- surface roughness of test piece 67
- symbols
 - CE (Europe) 4
 - C-Tick (Australia) 4
 - direct current 4
 - RoHS 4, 9
 - safety 1
 - WEEE 4
- system parameters, configuring 126

T

- T/R transducer connector 18
- taper or eccentricity 68
- TDG slope 229
- technical specifications 273
- technical support 11
- temperature compensation 154

- test block 64
 - test piece, curvature of 68
 - text edit
 - mode selection 38
 - traditional method 40
 - virtual keyboard 38
 - thickness
 - measuring 70
 - resolution 54
 - THRU-COAT
 - enabling 72
 - measurement 72
 - performing calibration 73
 - time, setting 45
 - time-dependent gain 227
 - tip notes
 - definition 8
 - replacing a thickness reading 199
 - save both thickness value and waveform 72
 - scroll between parameters 162
 - start with existing setup to create a new one 220
 - switching between echo detection modes 76
 - try communication reset to solve communication problems 243, 246
 - when to turn off AGC 125
 - title bar 37
 - trademark disclaimer ii
 - traditional text edit method 40, 41
 - transducer
 - maintenance 262
 - setting 57
 - transmitting data 246
 - troubleshooting 261
- U**
- units, setting 44
 - unlocking, instrument 120
 - unwanted shear-wave echo 79
 - update rate 54
 - adjusting 54
 - USA FCC compliance 10
 - USB
 - client connector 18
 - communications, setting 242
 - connector 17
 - USB/RS-232 connector 17, 18
 - user interface language 43
 - using
 - AC power 26
 - AVG/MIN measurement 153
 - B-scan 142
 - B-scan alarm mode 142
 - extended blank 136
 - high penetration with M2008 transducer 107
 - multi-measurement % total mode 100
 - multi-measurement normal mode 97
 - multi-measurement soft contact mode 99
 - temperature compensation 154
 - VGA output 80
- V**
- velocity
 - calibration 60, 65
 - variations 69
 - VGA output
 - activating 46
 - connector 17, 18
 - using 80
 - viewing
 - inserted DB grid cell 150
 - instrument status 269
 - virtual keyboard 38
 - editing value 39
 - V-path
 - about the 213
 - activating 214
 - building for DE transducers 215
- W**
- warning notes
 - charger/adaptor usage 28
 - definition 7
 - electrical 8
 - general 8
 - warranty information 10
 - waveform
 - delay 50
 - display 33
 - freezing 121
 - parameters adjusting 222
 - range 50

rectification 48
rectification, changing 46
trace 34, 49
trace, changing 46
WEEE directive 4, 9

Z

zero calibration 60, 63
zero compensation 60
zoom
 activating 52
 indicator 35
zoomed display 52